




## Weight Controller

HI-3030

### INSTALLATION AND SERVICE MANUAL



Hard Instruments Document Number: 0596-0266-01 Rev. P

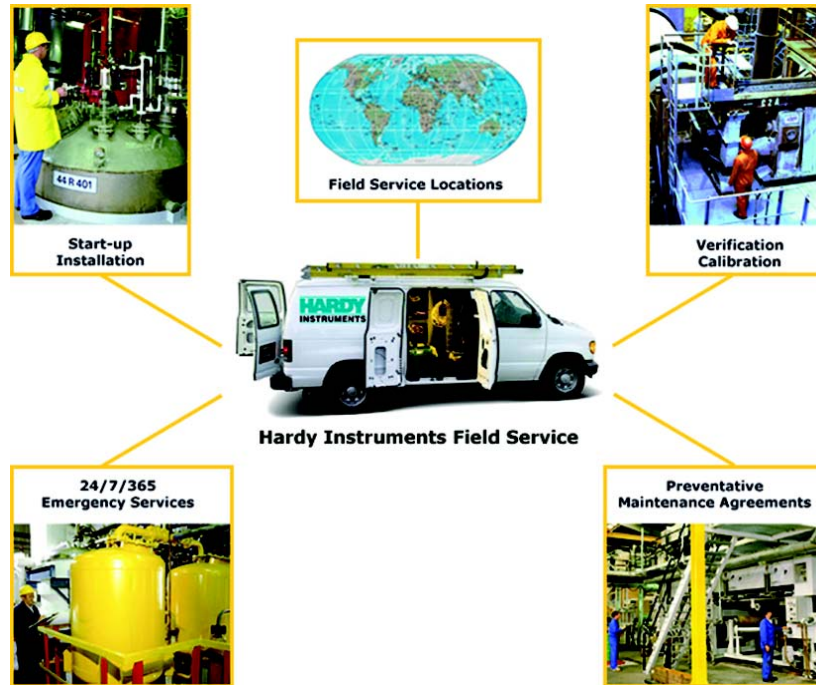

## Local Field Service

Hardy has over 200 field technicians in the U.S., and more positioned throughout the world to assist you in your support needs. We also have factory engineers who will travel to your facility anywhere in the world to help you solve challenging applications. We're ready to support you with:

- **Installation and start-up**
- **Routine maintenance and certification**
- **Plant audits and performance measurement**
- **Emergency troubleshooting and repair**

To request Emergency Service and Troubleshooting, Start-up, Installation, Calibration, Verification or to discuss a Maintenance Agreement please call **800-821-5831 Ext. 1757** or Emergency Service after hours (Standard Hours 6:00 AM to 6:00 PM Pacific Standard Time) and weekends Ext. 1111.

## Outside the U.S

Hardy Instruments has built a network of support throughout the globe. For specific field service options available in your area please contact your local sales agent or our U.S. factory at **+1 858-292-2710, Ext. 1757**.

## Table of Contents

<b>Table of Contents</b>	-----	<b>i</b>
<b>Chapter 1</b>	<b>Overview</b>	<b>1</b>
	General Introduction to the Hardy HI 3030 Service Manual	1
	Description	1
	Typical Applications	2
	Hardy Web Tech	3
	Connectivity	3
	Mapped I/O	3
	WAVERSAVER®	3
	C2® Calibration	3
	INTEGRATED TECHNICIAN™ (IT®)	4
	Secure Memory Module (SMM)	4
	Serial Port	4
	NIST/NTEP Option (-NTEP)	4
	CWM	4
	Mounting Options	4
	Power Supply Options	4
	Sensor Input Options	4
	Rate of Change Option	4
	Peripherals/System Components	4
	C2 Cable	4
	ADVANTAGE® Load Points	4
	Platform and Floor Scale Bases	5
	HI 215JB Series Junction Boxes	5
	HI 215IT Series Junction Boxes	5
	ACCESSORIES	5
	HI 3000-RC (NEMA 4/4X Rear Cap)	5
	HI 3000-MB	5
	HI 3000-GF	5
	HI 3000-TM	5
	HI 3000-OM	5
	Communication Options	5
	DeviceNet	5
	EtherNet/IP™	5
	MOD-Bus/TPC/IP	5
	OPC	5
	Remote I/O (RIO) Interface to the Allen Bradley Network	6
	ControlNet	6
	Profibus	6
	Analog Output (2AN)	6
<b>Chapter 2</b>	<b>Specifications</b>	<b>7</b>
	About Chapter 2	7
	Specifications for a Standard Instrument	7
	Number of Channels:	7
	Update Rate:	7
	Resolution	7
	Excitation Voltage:	7
	Averages:	7
	Input:	7
	Display:	7
	Display Increments (Graduations):	7
	Standard Opto 22 Electronic AC Relays:	7
	Standard Opto 22 Electronic DC Relays:	7

- Non-Linearity: - - - - - 7
- WAVERSAVER®: - - - - - 7
- Calibration Techniques: - - - - - 7
- Standard Interfaces: - - - - - 7
- Power and Utility Requirements: - - - - - 8
- Total Power: - - - - - 8
- Watts available for DeviceNet Power: - - - - - 8
- Common Mode Voltage Range - - - - - 8
- Common Mode Rejection: - - - - - 8
- Environmental Requirements: - - - - - 8
  - Operating Temperature Range: - - - - - 8
  - Storage Temperature Range: - - - - - 8
  - Temperature Coefficient: - - - - - 8
  - Humidity Range: - - - - - 8
- Approvals: - - - - - 8
- Instrument Local I/O: - - - - - 8
- Physical Characteristics: - - - - - 8
  - Panel Mount (Model # HI 3030-PM) - - - - - 8
  - Wall Mount (HI 3030-MB) - - - - - 8
- Specifications for I/O Option Boards - - - - - 9
  - Profibus Option Board - - - - - 9
  - ControlNet Option Board - - - - - 9
  - EtherNet/IP™ Option Card - - - - - 9
- Rate of Change Option - - - - - 9

**Chapter 3**

- Installation - - - - - 11**
- About Chapter 3 - - - - - 11
- Unpacking - - - - - 11
- Mechanical Installation - - - - - 11
  - Installing the HI 3030 Weight Controller in a Panel - - - - - 11
    - Panel Cutout Specifications - - - - - 11
    - Installing the HI 3030 Weight Controller - - - - - 12
  - Installing the HI 3030 in a Swivel/Wall Mount - - - - - 12
    - About the Swivel/Wall Mount - - - - - 12
  - Installing Printed Circuit Boards - - - - - 14
- Network Option Card Installation - - - - - 15
  - Removing Printed Circuit Boards - - - - - 15
- Electrical Installation - - - - - 16
  - Cabling and Interconnecting - - - - - 16
    - Recommended Installation Procedures - - - - - 16
    - AC Power Wiring - - - - - 16
    - DC Power Wiring - - - - - 16
- Load Point Connections - - - - - 17
  - C2® Load Point Connection - - - - - 17
  - Non-C2 Load Point Connection - - - - - 17
  - LVDT and Half Bridge Load Cells/Sensors - - - - - 17
- Junction Box Wiring - - - - - 17
- Installation of Secure Memory Module (SMM) (See Fig. 3-18) - - - - - 18
  - Transferring a Secure Memory Module - - - - - 18
- NTEP Option Installation - - - - - 18

**Chapter 4**

- Configuration - - - - - 21**
- About Chapter 4 - - - - - 21
- Getting Started - - - - - 21
- Help - - - - - 21
  - About Help - - - - - 21
- Description of the Front Panel - - - - - 21

Front Panel Display	- 21
Button Functions	- 21
Tare Button	- 21
Zero Button	- 21
Help Button	- 21
Display Button	- 22
Print Button	- 22
Up/Down - Left/Right Buttons	- 22
Enter Button	- 22
Exit Button	- 22
Clear Button	- 22
1 Button	- 22
2/ABC Button	- 22
Setup/3/DEF Button	- 23
Amount/4/GHI	- 23
Units/5/JKL Button	- 23
6/MNO Button	- 23
Tare Val/7/PQRS Button	- 23
8/TUV Button	- 23
Test/9/WXYZ Button	- 23
User./_/@ Button	- 23
0/Char. Button	- 23
Starting Up for the First Time	- 23
Weight Controller Configuration From the Front Panel	- 24
Unit of Measure Parameters	- 25
About Unit of Measure	- 25
Decimal Point Parameter	- 25
About the Decimal Point Parameter	- 25
Motion Tolerance Parameter	- 26
About Motion Tolerance	- 26
Graduation Size Parameter	- 26
About the Graduation Size Parameter	- 26
Zero Tolerance Parameter	- 26
Auto ZeroZero Tolerance Parameter	- 26
Zero Reminder Parameter	- 26
About Zero Reminder	- 26
Tare Reminder Parameter	- 28
About the Tare Reminder Parameter	- 28
Averages Parameter	- 28
About the Averages Parameter	- 28
Scale Capacity Parameter	- 28
About the Scale Capacity Parameter	- 28
The WAVERSAVER® Parameter	- 29
About the WAVERSAVER Parameter	- 29
Operator ID	- 29
About Operator ID	- 29
Instrument ID	- 29
About Instrument ID	- 29
Serial Port Parameters	- 30
About the Serial Port Setup Parameters	- 30
Tare Limit Parameter	- 31
About the Tare Limit Parameter	- 31
Set Clock Parameter	- 31
About Setting the Clock	- 31
About Timezones (Greenwich Mean Time)	- 32
Set LCD Contrast Parameter	- 34
About the Set LCD Contrast Parameter	- 34

- Ethernet Parameters - - - - - 34
  - About the Ethernet Parameters - - - - - 34
  - About IP Addresses - - - - - 34
- Option Cards Configuration - - - - - 35
  - Analog Option Card Configuration - - - - - 35
    - Configuring the Analog Option Card from the Web Page - - - - - 35
    - Mapping the Output - - - - - 36
- Weight Controller Configuration From the Web Page - - - - - 39
  - Set Date/Clock Parameters - - - - - 44
  - The Instrument Configuration is complete - - - - - 44
- Options Configuration - - - - - 44
  - Option Cards Configuration - - - - - 44
  - Rate of Change (-ROC) Option Configuration - - - - - 44
    - ROC Configuration from the Front Panel - - - - - 44
    - ROC Configuration from the Browser - - - - - 45
  - DeviceNet Parameters - - - - - 46
    - About the DeviceNet Parameters - - - - - 46

**Chapter 5**

- Calibration - - - - - 47**
- About Chapter 5 - - - - - 47
- Getting Started - - - - - 47
  - Binding - - - - - 47
  - Electrical Check Procedures - - - - - 47
- C2 Calibration From the Front Panel - - - - - 47
  - About The Gravitation Correction Factor - - - - - 48
- C2 Calibration From the Web Page - - - - - 50
- Traditional Calibration From the Front Panel - - - - - 51
  - About Traditional Calibration - - - - - 51
- Traditional Calibration From the Web Page - - - - - 52

**Chapter 6**

- Mapping - - - - - 55**
- About Mapping - - - - - 55
  - Mapping to an HI 3030 with a pre-2.3 Firmware Version - - - - - 55
  - Mapping to an Output Relay - - - - - 55
  - Example #2 Mapping an Input - - - - - 58
  - Mapping Multiple Sources - - - - - 59
  - Simple Network Mapping - - - - - 60
    - Mapping to a Network Output - - - - - 60
    - Mapping a Network Input to a Local Output - - - - - 61
- More Advanced Mapping - - - - - 62
  - Glossary of Mapping Terms - - - - - 62
  - Rules for Hardy Control Link Mapping - - - - - 62
- Local Input - - - - - 62
- Local Output - - - - - 63
- Volatile and Non-Volatile Memory - - - - - 63
- A Definition of Mapping - - - - - 63
- Local Mapping Example - - - - - 64
  - Local Mapping Output - - - - - 64
- Network Input - - - - - 64
- Network Output - - - - - 65
  - Hardy Control Link Network Mapping - - - - - 65
    - Boolean Mapping - - - - - 66
    - Analog Mapping - - - - - 66
    - Mixed Mapping - - - - - 67
    - Special (Command) Mapping) - - - - - 67
- Command Interface - - - - - 68
  - Parameter Numbers, Code Explanations, Valid Ranges

	and Default Settings	68
	Getting the Parameter Information on the Web Browser	70
	Mapping from the Front Panel	71
	Unmapping Procedures	73
	Mapping a Hardy Control-Link Network to a ControlNet/DeviceNet/Profibus Network	73
<b>Chapter 7: Trouble-</b>	About Chapter 7	75
<b>shooting 75</b>	Disassembly and Reassembly Notes and Cautions	75
	Error Messages	75
	General Troubleshooting Flow Chart Index	76
	A - Stability Test	77
	B - Guidelines for Instabilities on Formerly Operating Systems	78
	B1 - Guidelines for Instabilities on Formerly Operating Systems (Cont'd)	79
	B2 - Guidelines for Instabilities on Formerly Operating Systems: Mechanical Stability and Configuration Settings	80
	C - Guidelines for Instabilities on Formerly Operating Systems	81
	C1 - Guidelines for Instabilities on formerly Operating systems with the Integrated Technician Summing Junction Box diagnostics	82
	E - Return to Zero Test	83
	F - Verify Individual Load Cell Milli-Volt Readings	84
	F(a) - Verify Individual Load Cell Readings Using INTEGRATED TECHNICIAN™	85
	G - A/D Failure Error	86
	H - Mechanical Inspection	87
	J - Electrical Inspection	88
	K - Load Sharing and Load Sensor Checkout	89
	M - Weight Reading Stops Incrementing	90
	N - Blank Screen	91
	O - Display Stuck on a Screen	92
	R - View Input States	93
	S - Forcing Outputs	94
	System Integrity Check and Fault Determination From the Front Panel	95
	Diagnostics	95
	About Diagnostics	95
	Checking the Device Data List	95
	Diagnostics	100
	INTEGRATED TECHNICIAN™ (IT®)	100
	Using IT From the Front Panel	100
	Stability Test	103
	Factory Defaults	104
	Return to Zero Test	104
	View Input States	105
	Force Outputs	105
	System Integrity Check and Fault Determination From the Web Browser	106
	Diagnostics	106
	Using IT From the Web Browser	106
	Setting the Factory Defaults from the Web Browser	108
	Overview of Typical Load Cell System	108
	Troubleshooting The Network Connections and Configuration with the "Ping" Tool	109
	Selecting the module by number for Testing	109
	Exiting the Root Directory	110
	About Solid State Relays With Light Loads	110
	SCR SWITCHING LOAD CIRCUIT	110
	General Policies and Information	110
	Ordering Replacement Parts	111

System Support - - - - - 111  
Warranty - - - - - 111

**Dictionary of Mapping  
Symbols**

**Index**



## CHAPTER 1: OVERVIEW

### General Introduction to the Hardy HI 3030 Service Manual

This Service Manual describes the procedures for installation, setup, and troubleshooting of the HI 3030 Weight Controller.

Two other manuals also provide information about the HI 3030. See these manuals if you do not find the information you need in this manual.

- The HI 3030 Users Guide provides operating procedures
- The HI 3000 Series Operation and Installation Manual covers processes that are the same for all HI 3000 Series instruments, e.g., the procedures for communications, network, installation, and setup.

The latest revised manuals are available FREE in the Support section of our Web site.

<http://www.hardyinst.com>

To ensure the safe installation, operation, and repair, be sure you understand the cautions, warnings, and safety procedures described in the manuals, and for maximum service life, use the HI 3030 in accordance with practices recommended in the manuals.

### Other Sources of Help

Our Web site provides information and answers questions about load points, process weighing, vibration analysis and other Hardy Instruments products.

Hardy Web Tech, our Online Tech Support knowledge base, provides answers to questions based on previous customer interactions. It can help you find immediate answers to the technical questions you type in. You can create your personalized support page and your own support section that you can access 24/7. This allows you to view and update a profile containing your product and system information and your call history so we can more quickly and effectively understand your needs.

Within the contiguous US states, contract field service is available for plant-down or emergency assistance 365 days a year, 24 hours a day. You can contact the Technical Support Help Desk by phone during our operating hours, and you can sign up for the Hardy Newsletter to get the latest information on all Hardy products and services.

Use the "Provide Feedback" link on our Website to let us know how we're doing, what you like or dislike about the

product and our support services, or anything else. We encourage your input about the performance and operation of our products. Your comments help us shape the future direction of our products.

We appreciate your business. Should you not understand any information in this manual or experience any problems with this product, contact our Technical Support Department at:

**Phone:** (858) 278-2900

**FAX:** (858) 278-6700

**E-Mail:**

- [hardysupport@hardyinst.com](mailto:hardysupport@hardyinst.com)
- [hardyinfo@hardyinst.com](mailto:hardyinfo@hardyinst.com)

### Description

Hardy Instruments weight controllers are part of a line of application-specific process weighing and condition monitoring instruments. The HI 3030 Weight Controller instrument is available as either a standalone controller with a keypad and 4-line, 20-character display or an HI 3030R, blind remote controller, swivel mounted with no display.

The HI 3030 Weight Controller has flexibility to monitor and control up to four scales simultaneously. In addition to these control functions, the HI 3030 can function as a front end to a PLC, PC, or DCS system for applications such as leveling, batching, filling, dispensing, check weighing or as a standalone weigh controller or weight monitor.

The HI 3030 Weight Controller offers the following Hardy Instruments features:

- **WAVERSAVER<sup>®</sup>** - Eliminates the effects of vibration on the scale.
- **C2<sup>®</sup> Electronic Calibration** - Allows for calibration without test weights.
- **INTEGRATED TECHNICIAN<sup>™</sup> (IT)** provides built-in diagnostics to help you troubleshoot and diagnose your weighing system from the front panel or Web interface. With the IT Junction Box option, IT enables you to read individual load sensor voltages and weights, make comparisons, and isolate individual system components for quick and easy troubleshooting.
- **SMM (Secure Memory Module)** - Provides memory for manual transfer of configuration data to other HI 3030 instrument(s).

Hardy's 3000 Series instruments come standard with a selectable 10/100 BaseT Ethernet port and an embedded web server to link performance diagnostics and setup using your local Intranet, Extranet, VPN, or the Internet.

An optional Devicenet interface lets you add third-party I/O to the system and view and control multiple applications




from one display. The controllers act as servers over Devicenet communications and interfaces for Allen-Bradley Remote I/O, Profibus, ControlNet, or an analog card to provide communications to PLC<sup>®</sup> and DCS systems. Mapped I/O saves you wiring costs by distributing the I/O where you need it at the process or in the control room.

**NOTE:** PLC<sup>®</sup> is a registered trademark of the Allen-Bradley Corporation. INTEGRATED TECHNICIAN<sup>®</sup>, IT<sup>®</sup> C2<sup>®</sup> and WAVERSAVER<sup>®</sup>, are registered trademarks of Hardy Instruments.


### Typical Applications

- Filling a vessel from a feeder - Filling is the adding (gain-in-weight) of a material into a container on a scale. (See Fig. 1-1)

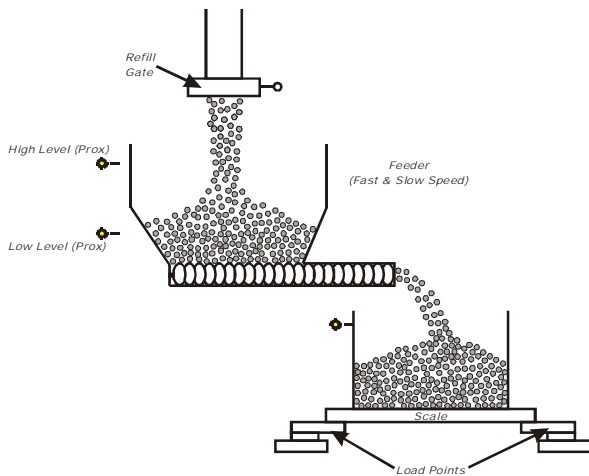


**FIG. 1-1 FILLING A VESSEL USING A FEEDER**

- Dispensing a vessel - Adding a material to an off-scale container by weight loss from a vessel on the scale. (See Fig. 1-2)

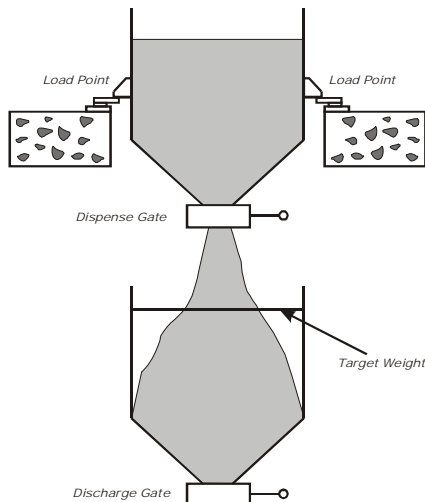

**FIG. 1-2 DISPENSING (LOSS-IN-WEIGHT) FROM A VESSEL TO ANOTHER VESSEL**

- Sequential Batch Control - A gain-in-weight application where multiple ingredients are added one at a time into a single weight hopper. (See Fig. 1-3)

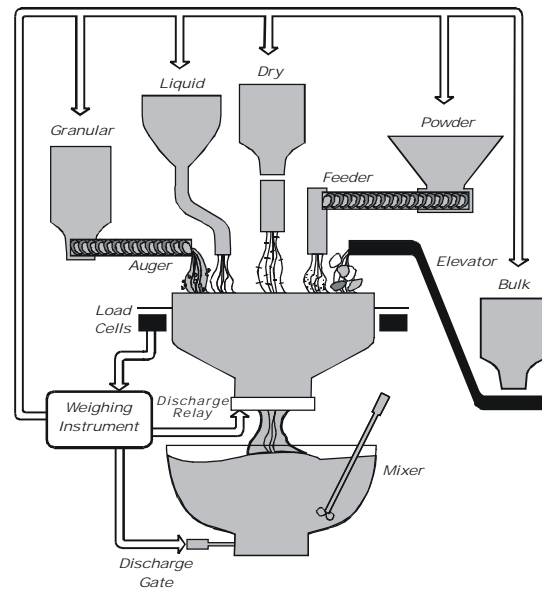

**FIG. 1-3 SEQUENTIAL BATCH CONTROL**

- Level monitoring - Maintaining material levels in various vessels. (See Fig. 1-4)



**FIG. 1-4 LEVEL MONITORING**

- Check weighing - Comparing a weight against limits to determine if the weight is within preset limits.
- Weight control or weight monitoring.

## Connectivity

HI 3000 Series products have a selectable 10/100 base T Ethernet port and an embedded web server to link (Hardy Control-Link Network) performance, diagnostics and setup data to and from your intranet, extranet, VPN or the Internet. You can also receive alarms via e-mail or over WAP-enabled devices including cellular phones and PDAs. A DeviceNet interface allows multiple applications to be viewed and controlled from a display and to add third-party I/O to the weigh process control system. The controller has a single RS-232 serial port configured as a printer port.

## Mapped I/O

Mapped I/O saves wiring costs by distributing the I/O where you need it, at the process or in the control room. The controller is a DeviceNet Scanner using a DeviceNet Scan table that is configured using RS NetWorx<sup>®</sup>. Optional interfaces for Allen-Bradley Remote I/O, Profibus, or an Analog card provide communications to PLC and DCS systems. For Installation and Configuration instructions for Ethernet, Remote I/O, DeviceNet and ControlNet, see the HI 3000 Operation and Installation Manual, Communications/Cabling/Network Chapters.

## WAVERSAVER<sup>®</sup>

In industrial weight control and measurement applications, vibratory noise signals from machinery in the plant environment can interfere with the weight data you are trying to measure. WAVERSAVER<sup>®</sup> helps to eliminate the noise signals so that the controller can better read the actual weight data. From the front panel you can choose to ignore noise with frequencies as low as 0.25 Hz or one of four higher frequencies for a faster response time. The default factory configuration is 0.50 Hz vibration frequency immunity.

## C2<sup>®</sup> Calibration

C2<sup>®</sup> Second Generation Calibration can calibrate a scale system electronically without using certified test weights. A C2 weighing system consists of up to eight load sensors, a junction box, interconnecting cable and an instrument with C2 capabilities, such as the Weight Controller. Each Hardy Instruments C2-certified load sensor sends a digital signal which the Hardy Weight Controller reads for weight information and to count the number of active sensors. Calibration also uses a reference value that is entered from the front panel or Web interface. The reference can be zero (no weight on the scale) or any known weight on the scale.

The instrument is also capable of performing traditional calibration such as with the use of certified test weights.

## INTEGRATED TECHNICIAN<sup>™</sup> (IT<sup>®</sup>)

A built-in diagnostics utility allows the operator to rapidly troubleshoot a weighing system from the front panel of the

controller or via the Web Browser. The operator presses the Test/9 button and scrolls through several test values that furnish the current state of each of the parameters that concern your application and the weigh system. A Help function is available to describe the parameter or explain the displayed information.

## Secure Memory Module (SMM)

The Secure Memory Module stores and protects critical data relating to configuration (up to 12 material configurations), calibration, and setup. New parameter values are automatically updated to the SMM. The SMM is conveniently accessible from the instruments rear panel. Data stored in one HI 3030 can be restored in another HI 3030 by transferring the SMM to the new instrument.

## Serial Port

One standard RS 232 serial port can be configured to transmit weight data to a serial device (e.g., a printer). Baud rates are user selectable at 600, 1200, 2400, 4800, 9600 or 19,200.

## NIST/NTEP Option (-NTEP)

The HI 3030 is approved for NIST) applications (National Institute of Standards and Technology - formally called the National Bureau of Standards). With the NIST mode activated, the HI 3030 is certified under the National Type Evaluation Program (NTEP) for up to 10,000 counts. This option is required when products are to be directly sold based on weight readings of the scale. For price, availability and installation instructions, contact your local Hardy Representative or the Hardy Instruments Service Center.

*NOTE: The NTEP Option requires HI 3030 Firmware version 2.8.00.00 or above.*

## -CWM

The HI 3030 is approved for Measurement Canada, Canada Weights and Measures Class III / III HD (3000 d). This option is required when products are to be directly sold based on weight readings of the scale. It is not available on the blind remote version.

## Mounting Options

- **-PM** Panel Mount includes mounting frame and Gasket.
- **-SA** Stand alone which includes keyboard and 4x20 LCD display.
- **-MB** Swivel mounted which includes bracket and hardware.

## Power Supply Options

- **-AC** 120/240 VAC with NO Output relays
- **-AA** 120/240 VAC with AC Output Relays

- **-AD** 120/240 VAC with DC Output Relays
- **-DA** 12-24 VDC with AC Output Relays
- **-DD** 12-24 VDC with DC Output Relays
- **-DC** 12-24 VDC with DC NO Output Relays

### Sensor Input Options

- **-LC** Single Scale Single Load Cell or Summed Load Cell Input
- **-2S** Dual Scale Input
- **-4S** Four Scale Input
- **-JB** Four Load Cell Input (Single Scale) - Enables the instrument to sum four load sensor inputs to act as a built-in summing box.

### Rate of Change Option

The ROC option measures and displays the rate at which a material enters or is dispensed from the scale over a period of time. To develop ROC data, a register is used that is 21 entries in length. New weight values are written to the register at the rate of 1/20th of the time base. The first register is subtracted from the 21st Register. The 21st register is one time base older than the 1st register. The time frame can be set to units per second, minute or hour. A time base of discrete values is selectable from 1 to 1800.

### Peripherals/System Components

#### C2 Cable

C2 Certified Load Cell Cable

#### ADVANTAGE<sup>®</sup> Load Points

Refer to the Hardy Instruments Load Point Selection Guide.

#### Platform and Floor Scale Bases

Refer to the Hardy Instruments Load Point Selection Guide.

#### HI 215JB Series Junction Boxes

Refer to the Hardy Instruments Load Point Selection Guide.

#### HI 215IT Series Junction Boxes

Refer to the Hardy Instruments Load Point Selection Guide.

### ACCESSORIES

#### HI 3000-RC (NEMA 4/4X Rear Cap)

Rear cap for the HI 3000 Series controllers. Upgrades the entire assembly to a NEMA 4/4X rating by enclosing all the rear panel connectors. Includes 2 cable grips.

#### HI 3000-MB

Swivel mount, includes bracket and hardware.

#### HI 3000-GF

Front gasket for the panel mount.

#### HI 3000-CD

Replacement or Additional CD's.

#### HI 3000-TM

Technical Manual (printed).

#### HI 3000-OM

Operators Manual (printed).

### Communication Options

*NOTE: For Installation, Configuration and Setup, refer to the HI 3000 Operation and Installation Manual, Cabling and Networks Sections.*

#### DeviceNet

The DeviceNet Network is an open, global industry-standard communication network designed to provide an interface through a single cable from a programmable controller or PC directly to all HI 3000 Series instruments as well as smart devices such as sensors, push buttons, motor starters, simple operator interfaces, drives and other weigh modules.

#### EtherNet/IP<sup>™</sup>

Ethernet technology lets you access device-level data via the Internet. EtherNet/IP, short for **E**thernet **I**ndustrial **P**rotocol, is an open industrial networking standard that takes advantage of existing commercial, off-the-shelf Ethernet communication chips and media. It supports both implicit (real-time I/O) and explicit messaging (message exchange).

TCP/IP is the transport and network layer protocol of the Internet that is commonly linked with all Ethernet installations and the business world. It provides a set of services that any two devices can use to share data. Because Ethernet technology and TCP/IP have been published for public use, standardized software tools and physical media have been mass-produced, offering you the benefits of known technology and easy access. Also used with an Ethernet network, UDP/IP (User Datagram Protocol) offers fast, efficient data transport needed for real-time data exchange.

#### MOD-Bus/TPC/IP

TCP/IP is a set of common layered protocols used for the Internet that provides a reliable data transport mechanism between machines. The de facto standard of corporate enterprise systems, Ethernet has also become the standard for factory networking. The cost of implementing an Ethernet solution has dropped to a point where it is commensurate with today's field-buses. Using Ethernet TCP/IP in the factory allows true integration with the corporate Intranet and MES systems that support your factory.

## OPC

OLE for Process Control (OPC) enables an HI 3000 module to communicate with any device that supports OLE/COM. The architecture is designed to utilize the Microsoft distributed OLE technology (DCOM) to facilitate clients interfacing to remote servers.

### Remote I/O (RIO) Interface to the Allen Bradley Network

The RIO port allows bi-directional communications with Allen-Bradley Programmable Logic Controllers (PLC) and Small Logic Controllers (SLC). The HI 3010 represents a selectable 1/4, 1/2, 3/4 or full rack of discrete I/O (32 bits in the Logic Controllers output and input image files) to the PLC Controller and supports both discrete and block transfers of data. It can support up to 230.4 Kbaud transfer rates.

### ControlNet Option

ControlNet is an open network protocol used in industrial automation applications for linking an HI 3030 to any ControlNet-capable device (such as PLCs). See 3000 Series Manual for details

### Profibus

Allows bi-directional communications to Profibus (Process Fieldbus) products including those made by Siemens, GE Fanuc and Texas Instruments. This interface supports PRO-FIBUS-DP (Decentralized Periphery) and processes both Selectable Predetermined and Block transfer commands. It supports up to 12 Mbaud transfer rates.

### Analog Output (2AN)

The -2AN option provides two independent Analog Outputs per option card which can be configured from the front panel or the embedded web server. This option allows the transmission of Gross, Net, Optional ROC or “mapped” Total weight as 0-5V, 0-10V and 0-20mA or 4-20mA (or the reverse of these) simultaneous, and makes it possible to span these ranges over a portion of the weight data. All parameters can be mapped to these Analog outputs. All the outputs can be assigned (mapped) to one channel or spread over multiple channels all independent of each other.

You can install up to two -2AN options in one controller. When you install two -2AN options, the only other available communication option is DeviceNet, which does not use an option slot. A single -2AN option can be combined with any of the other available network interface which takes up an option slot.

*NOTE: When you install the RIO or ControlNet communication options, you must install the Analog 2AN option card in the lower Option Slot.*



## CHAPTER 2: SPECIFICATIONS

### About Chapter 2

Chapter 2 lists the specifications for the HI 3030 Weight Controller. Specifications are listed for the standard instrument and for instruments fitted with optional equipment. The specifications listed are designed to assist in the installation, operation and troubleshooting of the instrument. Service personnel should be familiar with this section before attempting an installation or repair of the instrument.

### Specifications for a Standard Instrument

#### Number of Channels:

- 4 Channels

#### Update Rate:

- 55 updates per second

#### Resolution:

- Displayed: 1:985,000 (3 mV/V load cells)
- Internal 1:1,048,5761

#### Excitation Voltage:

- 5 VDC
- Drives up to 16 350 ohm load cells

#### Averages:

- 1 to 250 - Sliding, User Selectable in Single Unit Increments

#### Input:

- Up to sixteen (16) 350 ohm Full Wheatstone Bridge, Strain Gauge Load Sensors/ Cells (5 volt excitation) on one vessel.
- Up to 4 LVDT Load Sensors, (1 load sensor per channel)

**WARNING: BECAUSE THE LVDT LOAD SENSORS ARE A VOLTAGE SOURCE, ONLY USE 1 LOAD SENSOR PER CHANNEL. NOT TO DO SO MAY CAUSE PROPERTY DAMAGE AND/OR PERSONAL INJURY.**

**CAUTION: LVDT LOAD SENSORS ARE NOT RATED FOR WASHDOWN APPLICATIONS. THE LOAD SENSORS ARE NOT HERMETICALLY SEALED AND WILL LEAK CAUSING INCORRECT WEIGHT READINGS AND INTERNAL CORROSION OF THE COILS.**

- Signal Voltage Range 0-120 mV/V ( $\pm$  600 millivolts).

#### Display:

- 4 line x 20 character backlit LCD
- 5 x 7 dot matrix

#### Display Increments (Graduations):

- 1,2,5,10,20,50,100,200,500, 1000 user selectable
- Corresponding weight is dependent on the decimal point location.

#### Standard Opto 22 Electronic AC Relays:

- Wire Size: 12 AWG Maximum
- Maximum Switch Current: .5 Amps
- Maximum Switch Power: 120 Watts
- Maximum Switch Voltage: .5 Amps @ 240 VAC
- Single Cycle Surge: 85 Amps (Peak)

#### Standard Opto 22 Electronic DC Relays:

- Wire Size: 12 AWG Maximum
- Maximum Switch Current: .5 Amps
- Maximum Switch Voltage: .5 Amps @ 60 VDC
- Switch Voltage: 5-60 VDC
- 1 second surge: 5 Amps

#### Non-Linearity:

- 0.0015% of Full Scale

#### WAVERSAVER®:

- OFF
- 7.5 Hz
- 3.5 Hz
- 1.0 Hz
- 0.5 Hz
- 0.25 Hz

#### Calibration Techniques:

- C2® - Second Generation: Electronic
- Traditional - Calibration with test weights

#### Standard Interfaces:

- Ethernet - 10/100 Base T; embedded server
- DeviceNet - Master Scanner
- ControlNet - Master Scanner
- Profibus - Master Scanner

- Serial RS 232 - simplex to Printer.

**Power and Utility Requirements:**

Voltage - Universal Power Supply (50/60 Hz)

- 120-240 VAC  $\pm$  10%
- 12 - 24 VDC

Frequency

- 47-63 Hz

**Total Power:**

- 25 Watts maximum with options

**Watts available for DeviceNet Power:**

- 15 Watts

**Common Mode Voltage Range**

- $\pm$  2.5 VDC

**Common Mode Rejection:**

- 100dB @ 50-60Hz

**Environmental Requirements:**

**Operating Temperature Range:**

- -10° to 50° C (14° to 122° F)

**Storage Temperature Range:**

- -20° to 70° C (-4° to 158° F)

**Temperature Coefficient:**

- Less than 0.005% of full scale per degree C for zero and span.

**Humidity Range:**

- 0-90% (non-condensing)

**Approvals:**

- CE
- UL
- CUL
- NTEP
- CWM

**Instrument Local I/O:**

- 5 mappable inputs optically isolated
- 4 mappable outputs 48-240 VAC Opto 22
- 3rd party mappable over DeviceNet, ControlNet, Profibus

**Physical Characteristics:**

**Panel Mount (Model # HI 3030-PM)**

Depth

- 8.03" (203.96mm) Back of the Bezel to rear cable clearance.

Case Dimensions

- 6.125"H x 8.56"W x 6.03"D (155.57mmH x 217.42mmW x 1.53.16mmD)

Front Panel Dimensions

- 7.686" H x 9.40" W x 0.625" D (195.22mm H x 247.39mm W x 15.87mmD)

Panel Cutout Dimensions

- 6.75" H x 8.94" W (1775mm H x 227mm W)

Case Material

- GE Cyclocac Type KJW - Flame Retardant ABS (Acrylanitrile Butadiene Styrene)

Weight

- 4.6 pounds (2.1 Kilograms)

Rating

- Front Panel NEMA 4 Seal

**Wall Mount (HI 3030-MB)**

Base Dimensions

- 9.3" L x 4.0" W (236.22mm L x 101.60mm W)

Overall Height with HI 3030 installed, as measured from the base to the top of the front plate.

- 11.77" High (298.96mm H)



Swivel Material

- 304 Stainless Steel

- Redundant Media
- Cyclic Messaging

## Specifications for I/O Option Boards

### Profibus Option Board

**Power Supply:**

- +5V max - 350mA

**Operating Temperature:**

- 0 - 70° C (32 - 158° F)

**Profibus Services:**

- DP Services

**ID Number and GSD Support:**

- 1003H with Standard GSD File (May change if required)

**Input Size:**

- 0-122 Words

**Output Size:**

- 0-122 Words

**Combined Input and Output Size:**

- Not exceed 208 Words

### ControlNet Option Board

**Power Supply:**

- +5V max - 350mA

**Operating Temperature:**

- 0 - 70° C (32° - 158°F)

**ControlNet Baud Rate:**

- 5 Mbit/second

**Max I/O Data Capacity:**

- Input - 250 bytes
- Output - 250 bytes

**ControlNet Supported Features:**

### EtherNet/IP™ Option Card

**Power Supply:**

- +5V max 450mA

**Operating Temperature:**

- 0 - 70° C (32° - 158° F)

**Baud Rate:**

- 10/100 Mbit/s

**I/O Input:**

- 2048 bytes

**I/O Output:**

- 2048 bytes

**Application Interface:**

- Parallel

**Specification Rel. 2:**

- EtherNet/IP level 2 I/O Server CIP (ControlNet & DeviceNet)

**Functionality:**

- 10/100Mbit MB/TCP +EtherNet/IP + IT functions

### Rate of Change Option

- Selectable discrete value - 1 to 1800 seconds
- Time Frame Units - second, minute, hour



## CHAPTER 3: INSTALLATION

### About Chapter 3

All information contained in Chapter 3 pertains to unpacking, cabling, interconnecting and installing the HI 3030 Weight Controller. Alternatives to any specifications contained or implied in this section are not recommended. It is very important that the user and service personnel be familiar with the procedures contained in this chapter, before installing or operating the HI 3030 Weight Controller.

*NOTE: Ethernet and DeviceNet installation and setup instructions are located in the HI 3000 Series Operation and Installation Manual in the Cabling Section. There are also installation instructions in the Quick Installation Guide.*

### Unpacking

- Step 1. Before signing the packing slip, inspect the packing for damage of any kind.
- Step 2. Report any damage to the carrier company immediately.
- Step 3. Check to see that everything in the package matches the bill of lading. You should normally have:

#### HI 3030 Panel Mount

- (1) HI 3030 Weight Controller with mating connectors and ordered options installed.
- (1) Mounting Kit with a mounting bracket, gasket and (4) RAF 8-32 captive screws.
- CD containing User Guide and Service Manuals

- Step 4. If any items are missing, damaged, or there are any questions, please contact Customer Support at:

**Hardy Instruments**  
3860 Calle Fortunada  
San Diego, CA 92123-1825

**Phone: (858) 278-2900**  
**FAX: (858) 278-6700**  
**Web Site: <http://www.hardyinstruments.com>**  
**E-Mail: [hardysupport@hardyinst.com](mailto:hardysupport@hardyinst.com)**

- Step 5. Record the model number and serial number of the Weight Controller. Store in a convenient, secure location for reference when contacting Hardy Instruments Customer Service Department or to buy parts or firmware upgrades.


### Mechanical Installation

#### Installing the HI 3030 Weight Controller in a Panel

##### Panel Cutout Specifications

##### Enclosure Size Requirements:


- Overall depth of the enclosure must be a minimum of 8.5" to allow for the 2" clearance between the rear panel of the HI 3030 Weight Controller and the inside surface of the rear panel of the enclosure. (See Fig. 3-1)
- There must be a 1" clearance completely around the bezel and other installed units.

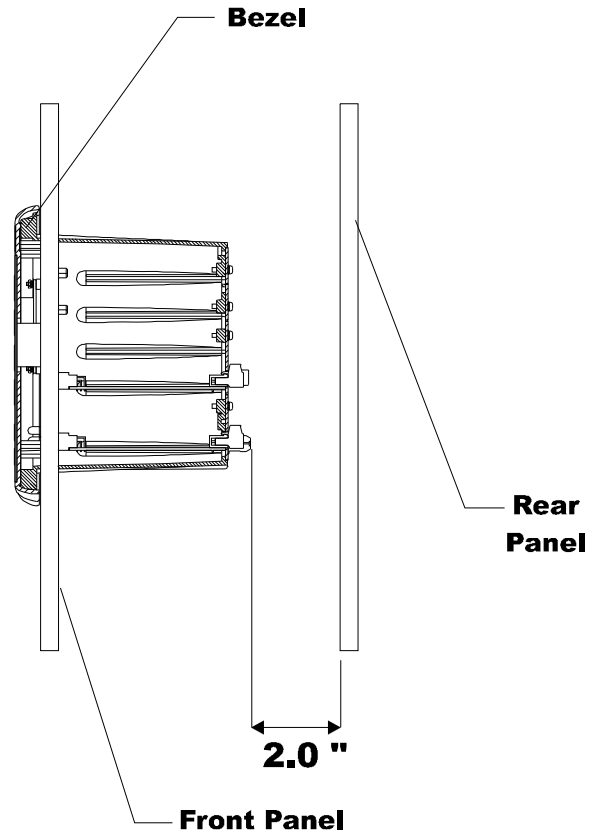

**FIG. 3-1 REAR PANEL CLEARANCE REQUIREMENT**

##### Dimensions of the panel cutout. (See Fig. 3-2)


- 8.94" ±.06 (227.076mm ± 1.52mm) Wide
- 6.625" ±.06 (168.26mm ± 1.52mm) High

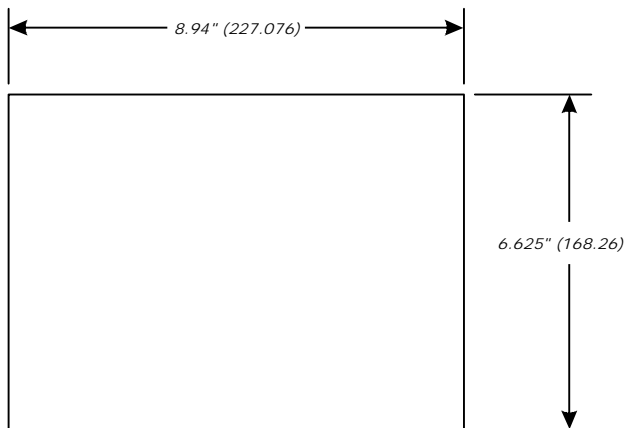

**FIG. 3-2 PANEL CUTOUT DIMENSIONS**

**Installing the HI 3030 Weight Controller**

- Step 1. Make sure that all Electrostatic Discharge (ESD) precautions are taken before and during installation.
- Step 2. The Weight Controller comes with a NEMA 4 & 4X rated compression gasket. Slide the gasket over the rear of the instrument until the gasket is flush with the back side of the front panel. (See Fig. 3-3)

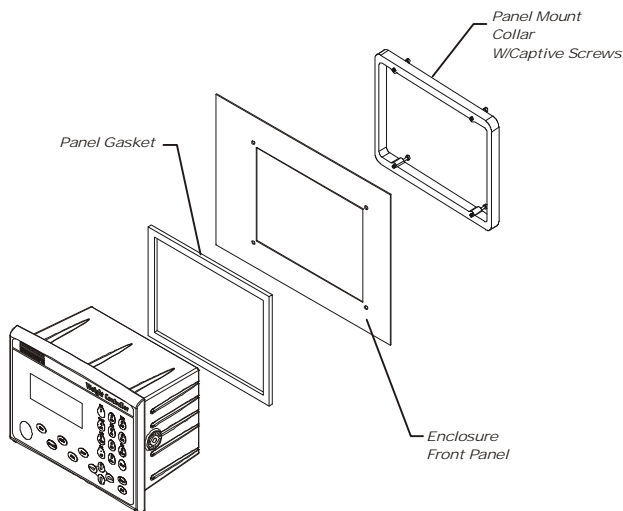


**FIG. 3-3 PANEL MOUNT INSTALLATION**

- Step 3. Gently slide the Weight Controller with the gasket into the cutout in the enclosure front panel or door until the gasket is flush with the enclosure front panel. (See Fig. 3-4) Be sure to secure the instrument with both hands when installing.
- Step 4. Line up the instrument's tapped holes with the through holes in the enclosure front panel.

**CAUTION: ONCE THE GASKET IS COMPRESSED IT SHOULD NOT BE USED AGAIN. WHENEVER THE WEIGHT**

**CONTROLLER IS REMOVED FROM THE PANEL, RE INSTALL WITH A NEW GASKET.**

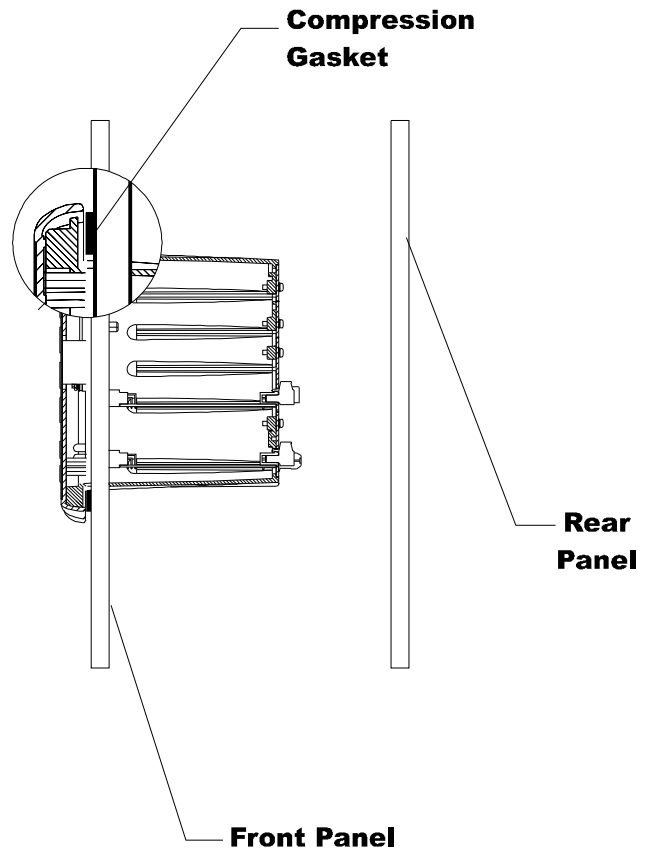

**FIG. 3-4 NEMA 4 GASKET FLUSH AGAINST THE FRONT PANEL OF THE ENCLOSURE**

- Step 5. Gently slide the Panel Mount Collar over the rear of the instrument. (See Fig. 3-3)
- Step 6. Push the captive screws through the holes in the Enclosure Front Panel and install the screws into the tapped holes on the instrument until the screws are finger tight.
- Step 7. Use a slotted head screwdriver and tighten each screw until the instrument is snug and the compression gasket is tight against the Enclosure Front Panel. **DO NOT OVERTIGHTEN!**
- Step 8. The Panel Mount installation is complete.


**Installing the HI 3030 in a Swivel/Wall Mount**

**About the Swivel/Wall Mount**

The swivel mounts allows the Weight Controller to mount on a horizontal or vertical surface. The instrument is mounted in the swivel which is fastened to a hard surface. The mount not only supports the instrument but also allows the Weight Controller to rotate for a better view of the display and more convenient access to the front panel key board. The Swivel Mount also serves as a wall mount. Simply rotate the swivel mount 90 degrees and attach it to a wall. The swivel allows


the instrument to rotate several degrees, even with cables and rear cover attached.

Step 1. Use four (4) 1/4 x 20 hex head bolts to fasten the swivel mount to a horizontal surface. (See Fig. 3-5)

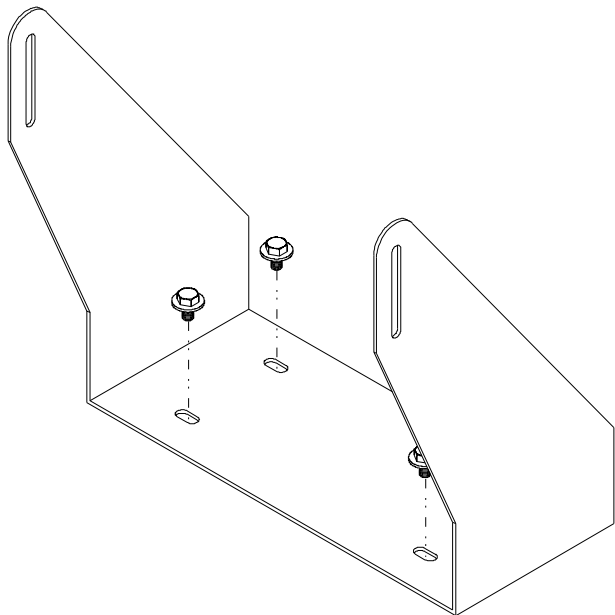

**FIG. 3-5 INSTALLING THE SWIVEL MOUNT TO A HORIZONTAL SURFACE**

Step 2. Place the Weight Controller between the Swivel Mount brackets so that the threaded holes in the instrument are aligned with the slots in the Swivel bracket. (See Fig. 3-6)

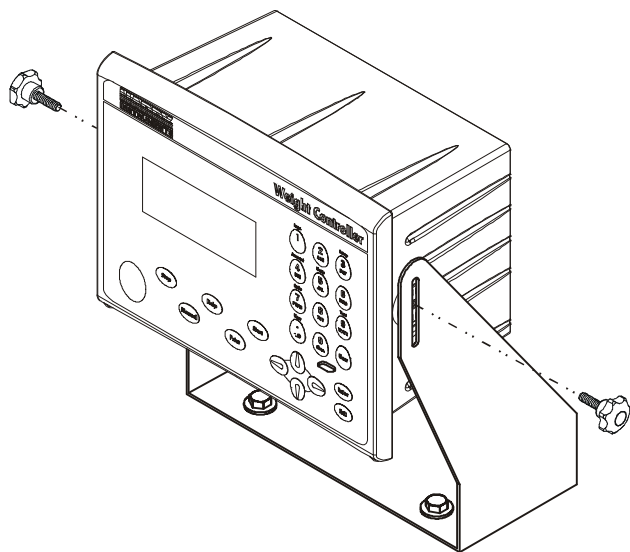

**FIG. 3-6 WEIGHT CONTROLLER INSTALLING IN A SWIVEL MOUNT**


Step 3. Screw the two (2) fastener knobs into the threaded holes on each side of the Weight Controller until the brackets are snug against the instrument. (See Figs. 3-6 & 3-7)

**CAUTION: DO NOT OVERTIGHTEN.**

Step 4. To rotate the instrument in the swivel mount, loosen the two fastener knobs.


Step 5. Rotate the instrument to the position you want.

Step 6. Re-tighten the fastener knobs.

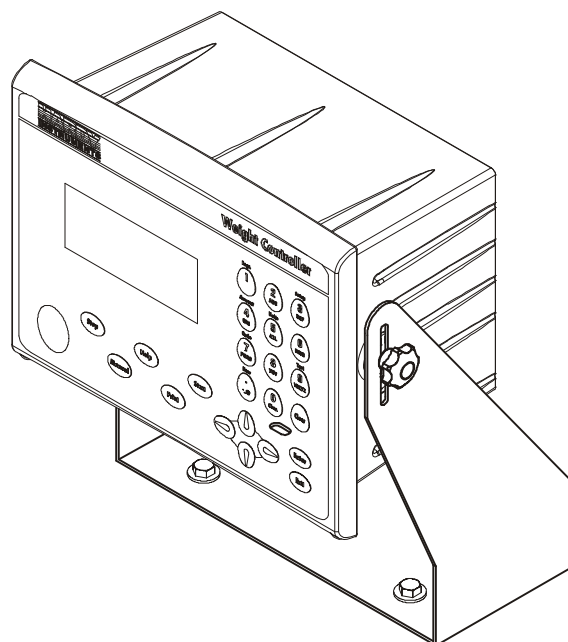


**FIG. 3-7 WEIGHT CONTROLLER INSTALLED IN A SWIVEL MOUNT**

Step 7. Use four (4) 1/4 x 20 fasteners to fasten the swivel mount to a vertical surface. (See Fig. 3-8)

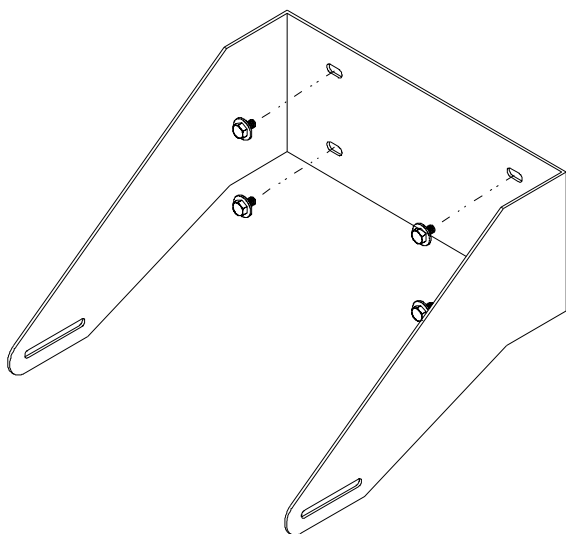


**FIG. 3-8 INSTALLING THE SWIVEL MOUNT TO A VERTICAL SURFACE**

Step 8. Place the Weight Controller between the Swivel Mount brackets so that the threaded holes in the instrument are aligned with the slots in the Swivel bracket. (See Fig. 3-9)

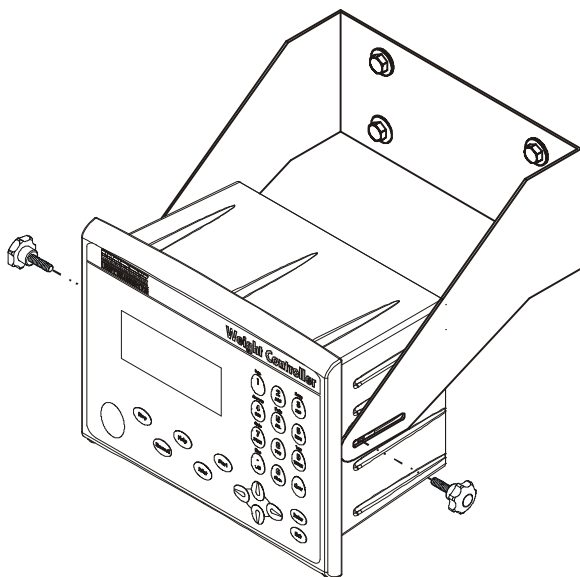

**FIG. 3-9 WEIGHT CONTROLLER INSTALLING IN A SWIVEL WALL MOUNT**


Step 9. Screw the two fastener knobs into the threaded holes on each side of the Weight Controller until the brackets are snug against the instrument. (See Figs. 3-9 & 3-10)

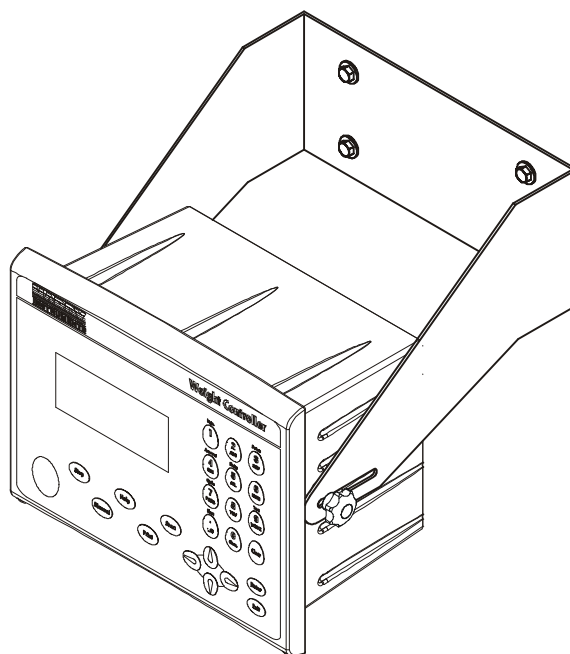

**FIG. 3-10 WEIGHT CONTROLLER INSTALLED IN A SWIVEL/WALL MOUNT**


**Installing Printed Circuit Boards**

Step 1. From the back of the instrument, align the PCB board with the housing slots in the instrument so that the backplane connector is facing the instrument. (See Fig. 3-11)

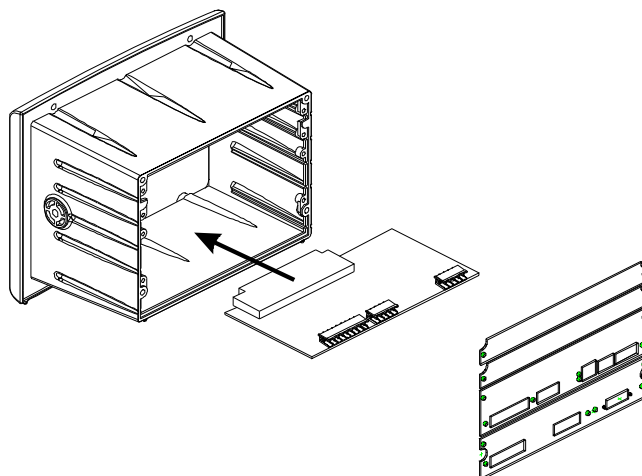

**FIG. 3-11 MAIN CONTROLLER BOARD INSTALLATION/LINING UP BOARDS WITH THE SLOTS**

Step 2. Gently slide the circuit board into the slots making sure that the each side of the PC board is in the proper slot. (See Fig. 3-12)

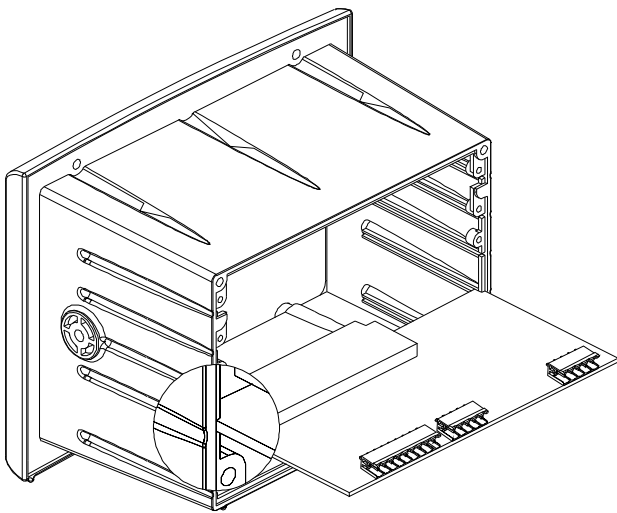


**FIG. 3-12 MAIN CONTROLLER BOARD INSTALLATION/SLIDING THE BOARD INTO THE INSTRUMENT**

- Step 3. Gently push the PC board all the way into the instrument until the backplane connector is connected to the backplane.
- Step 4. Install the Main Board rear plate. (See Fig. 3-13)

- Place the Main Board rear plate so that the threaded holes on each side of the instrument chassis are aligned.
- Screw a panhead screw (#4-40) into the threaded hole on the instrument chassis. Do not tighten.
- Screw the panhead screws that attach the rear plate to the Main Board until they are finger tight.
- Use a Phillips head screw driver and tighten all the installed screws until snug.

**CAUTION: DO NOT OVERTIGHTEN.**

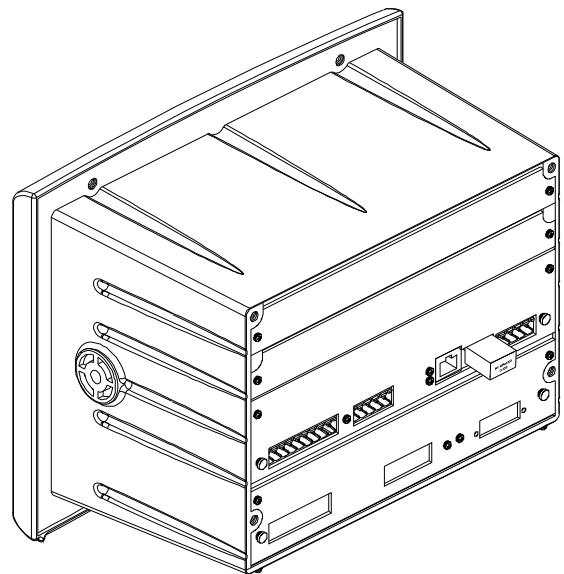

**FIG. 3-13 MAIN CONTROLLER BOARD INSTALLED WITH REAR PLATE**

- Step 5. Installation of all the PC Boards used in any HI 3000 Series Instrument requires the same procedures.

### Network Option Card Installation

All Network Option Card installation instructions can be found in the HI 3000 Manual which is located on the Resource CD you received with your HI 3000 Series instrument. If you do not currently have the Resource CD or an HI 3000 manual go to the Hardy Instruments Web Site and download a free copy.

### Removing Printed Circuit Boards

- Step 1. Unplug all the cables that are connected to the instrument.
- Step 2. Use a Phillips head screw driver and remove the two (2) pan head screws that fasten the rear plate to the instrument. You do not need to remove any of the screws that fasten the rear panel to the PC Board.
- Step 3. Use your fingers to grasp the two (2) (knurled knobs) that are mounted on the rear panels.
- Step 4. Gently pull the knobs away from the instrument until the PC Board is clear of the instrument slots.
- Step 5. Store the circuit board in a secure and dry location, free of any ESD.

## Electrical Installation

### Cabling and Interconnecting

#### Recommended Installation Procedures

- Carefully plan the cable runs and wiring connections before routing, cutting and trimming cables and wires.

**CAUTION: INSTRUMENT POWER AND RELAY WIRES SHOULD BE ROUTED AWAY FROM ALL OTHER SIGNAL CABLES TO AVOID ELECTRICAL INTERFERENCE.**

- All cabling should be neatly bundled, tied, and dressed.
- Use a 6 inch service bend to relieve stress on the connectors and to ease servicing the unit.
- Make sure that all plugs are firmly in place.
- Be sure to secure the power cord with the two (2) captive screw-on clips.
- All connections are made at the rear panel of the Weight Controller.

#### -AC Power Wiring

**WARNING: DO NOT OPERATE WITH INCORRECT LINE VOLTAGE. TO DO SO WILL RESULT IN PROPERTY DAMAGE AND/OR PERSONAL INJURY. MAKE SURE THAT THE POWER SOURCE DOES NOT EXCEED 240 VAC.**

**WARNING: IF A LITHIUM BATTERY IS REPLACED WITH AN INCORRECT TYPE IT MAY CAUSE AN EXPLOSION WHICH WILL CAUSE PROPERTY DAMAGE OR PERSONAL INJURY.**

- The AC power should be supplied by a “clean” primary line, directly from the power panel. This line should not supply any other equipment, including the feeding unit, and should be supplied with a minimum 10 amp breaker. (See Fig. 3-14)

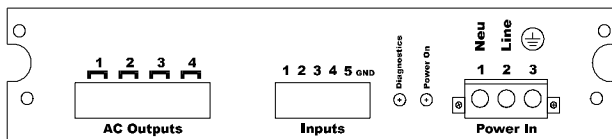


FIG. 3-14 POWER WIRING DIAGRAM

- Power Input J1

J1-1 Neu (Low)  
J1-2 Line (HI)  
J1-3 Ground

- The HI 3000 Series instruments are configured with a universal power supply rated from 120 to 240 VAC. The instruments can be powered by a 120 or 240 VAC power source and requires no switching or jumper settings.
- Install a 3-wire, minimum 14 AWG power line to the 3-pin terminal block connector. (See Fig. 3-14)
- The power and relay circuit card, filters and conditions AC power. However, for noisy power lines, external conditioning may be required. For more information, consult the HI 3000 Series Installation and Service Manual or contact Hardy Instruments Technical Support.

#### -DC Power Wiring

**WARNING: DO NOT OPERATE WITH INCORRECT LINE VOLTAGE. TO DO SO WILL RESULT IN PROPERTY DAMAGE AND/OR PERSONAL INJURY. MAKE SURE THAT THE POWER SOURCE DOES NOT EXCEED 24 VDC.**

- The DC power should be supplied by a “clean” primary line, directly from the DC power source. (See Fig. 3-15)

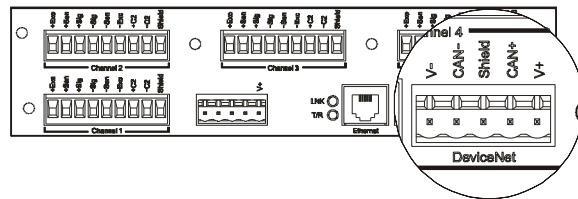



FIG. 3-15 DC POWER SUPPLY CONNECTION

- Connect your positive and negative DC voltage lines to the Phoenix connector that plugs into the DeviceNet Connector. (See Fig. 3-15)
- Plug the connector into the DeviceNet Connector at the rear panel.

**NOTE:** Use DC power source when you have the -DC option and do not have the DeviceNet Option. The DeviceNet option has its own DC power source.



### Load Point Connections

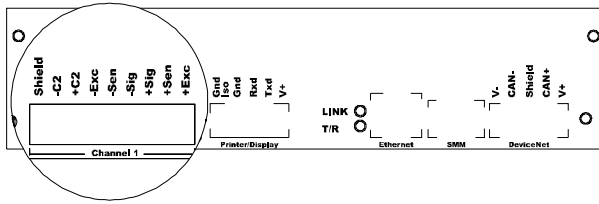

**FIG. 3-16 REAR PANEL/LOAD POINT CONNECTIONS**

#### C2® Load Point Connection

Cable color Code for C2 Load Points (left to right facing the rear panel):

- Shield      Ground Wire
- C2-        Violet
- C2+        Grey
- EXC-      Black
- SEN-      Brown
- SIG-      White
- SIG+      Green
- SEN+      BLUE
- EXC+      RED

- Step 1. Remove the factory installed jumper from the terminal block if you are connecting an 8 wire cable from the junction box.
- Step 2. Connect the cable (Recommended load cell cable: Hardy Instruments Prt. # 6020-0001) wires to the J9 terminal block according to the cable color chart. (See Fig. 3-16)

*NOTE: To purchase Hardy Load Cell cable, contact your local Hardy Representative or Distributor.*

- Step 3. Plug the terminal block into the Channel 1 connector on the rear panel.

#### Non-C2 Load Point Connection

Cable color Code for Non-C2 Load Points:

- Shield      Ground Wire
- C2-        Not Used\*
- C2+        Not Used\*
- EXC-      Black
- SEN-      Brown
- SIG-      White
- SIG+      Green
- SEN+      Blue
- EXC+      Red


*NOTE: \*If you are using an IT Summing Box you need to connect the IT Summing Box Communication to C2- and C2+.*

- Step 1. Remove the factory installed jumper from the terminal block if you have 6 wire load cell cable that includes sense wires from the load cell or junction box.
- Step 2. Connect the cable (Recommended load cell cable: Hardy Instruments Prt. # 6020-0001) wires to the J9 terminal block according to the Non-C2 cable color chart.
- Step 3. Plug the terminal block into the Channel 1 (J9) connector on the rear panel.

#### LVDT and Half Bridge Load Cells/Sensors

Please contact Hardy Technical Support for installation instructions.

#### Junction Box Wiring

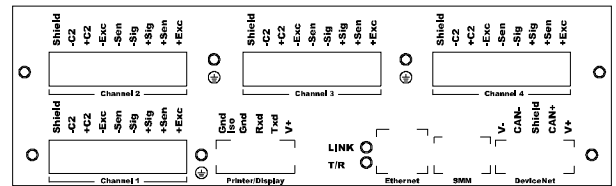

**FIG. 3-17 JUNCTION BOX CONNECTIONS**

- Step 4. Connect the cable wires directly to the terminal blocks according to the C2 or Non-C2 cable color charts.
- Step 5. Plug the terminal blocks into Channels 1 thru 4 connectors on the rear panel. Write down which load cell is connected to Channel 1, Channel 2, Channel 3, Channel 4 for future reference.

*NOTE: If you have one load point you must plug it into Channel 1. If you have more than one load point you must make sure that you plug one of the load points into Channel 1.*

- Step 6. If you only have 3 load cells, do not use Channel 4.

### Installation of Secure Memory Module (SMM) (See Fig. 3-18)

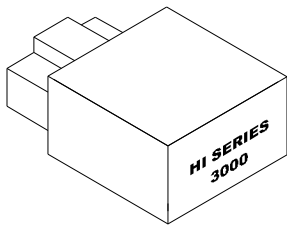


FIG. 3-18 SECURE MEMORY MODULE (SMM)

Step 7. Slide the module with the notch up into the module housing at the rear panel. (See Figs. 3-19 & 20)

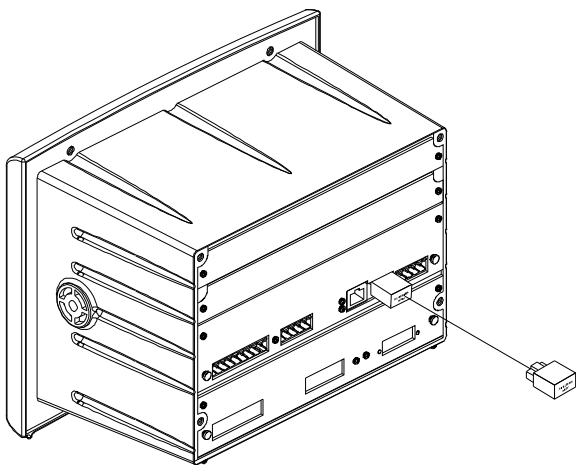


FIG. 3-19 INSTALLING THE SECURE MEMORY MODULE

Step 8. Press the module in until it stops. Do not force the module, it should slide in easily.  
Step 9. To remove the module pull the module straight out of the housing. (See Fig. 3-19)

### Transferring a Secure Memory Module

**NOTE:** Make sure that when you move an SMM to another instrument that you know what type of instrument that will receive the SMM. For example if you accidentally place a Dispenser into a previously configured Filler, the Filler changes into a Dispenser and vice versa. Make sure that you know the type of instrument the SMM was taken from.

**CAUTION: Do NOT REMOVE AN SMM WITH THE POWER ON. ALWAYS DISCONNECT THE POWER CABLE FROM THE INSTRUMENT BEFORE REMOVING OR INSTALLING THE SECURE MEMORY MODULE.**

- Step 1. Disconnect the power cable from the Instrument.
- Step 2. Remove the Secure Memory Module from the instrument.
- Step 3. Install the Secure Memory Module into the new instrument.
- Step 4. Power up the new instrument.

### NTEP Option Installation

**NOTE:** After installing the NTEP option you can no longer enter negative Tare values.

**NOTE:** The NTEP Option pertains to the Gross Weight displayed on the Front Panel of the Instrument ONLY.

**NOTE:** The NTEP Option requires HI 3030 Firmware version 2.8.00.00 or above.

- Step 1. Check to see which firmware version is currently installed on your instrument by doing the following:
  - From the front panel press the Text/9 button. The Test and Data Menu appears with the cursor in front of the “Device Data List”. (See Fig. 3-20)

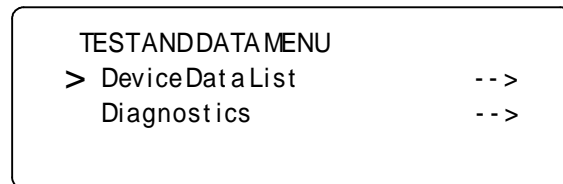


FIG. 3-20 TEST AND DATA MENU/SELECTING DEVICE DATA LIST

- Press the Enter button. The Test Data List appears.
- Press the down arrow button until the cursor is in front of “Version:” The current Firmware version is listed here. (See Fig. 3-21)

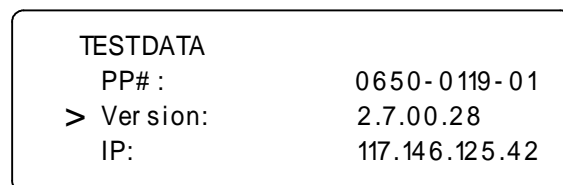


FIG. 3-21 TEST DATA/VIEWING VERSION NUMBER


- From the HI 3030 Web Page click on “Operation”. (See Fig. 3-22) The Operation page appears. (See Fig. 3-23)

option requires that the instrument be returned to the factory.

**WARNING: ONCE THE NTEP SEAL AND LABEL ARE PLACED ON THE HI 3030 THEY CANNOT BE BROKEN. BREAKING THE NTEP SEAL VOIDS THE NTEP CERTIFICATION.**




**FIG. 3-22 HI 3030 WEB PAGE/SELECTING OPERATION**

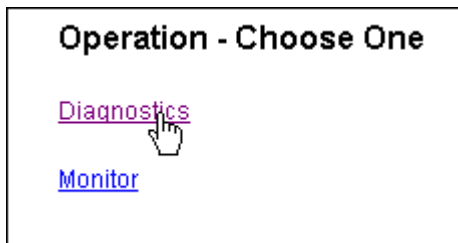

**FIG. 3-23 OPERATION PAGE/SELECTING DIAGNOSTICS**

- Click on “Diagnostics”. The Operation-Diagnostics page appears. (See Fig. 3-24)

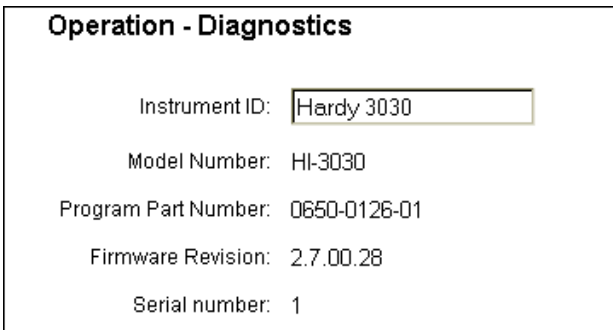

**FIG. 3-24 OPERATION - DIAGNOSTICS/FIRMWARE REVISION NUMBER 2.7.00.28**

Step 2. Contact your local Hardy Representative or Hardy Instruments Service Center to arrange for the installation of the NTEP option. Installation of the NTEP



## CHAPTER 4: CONFIGURATION

### About Chapter 4

Chapter 4 contains step-by-step instructions for configuring the Hardy Instruments, HI 3030 Weight Controller. The procedures include complete instructions for configuring the Weight Controller from the Front Panel, Remote I/O (optional) ControlNet (optional), DeviceNet (Optional) and Web Browser. We highly recommend reading the procedures before configuring the Weight Controller. Being familiar with the configuration procedures insures that the Controller will provide trouble free service.

### Getting Started

Before operating the Hardy HI 3030 Weight Controller, check to make sure the following procedures have been performed:

- Power and Load Point cables properly installed.
- Communication cables properly installed.
- Calibration Performed.

All the features of the Weight Controller operate the same no matter what the interface. First let's get familiar with configuring the HI 3030 from the front panel of the instrument. (See Fig. 4-1)

### Help

#### About Help

As you move through the setup/configuration menus you may on occasion need assistance. If you need help, do the following:

- Step 1. Use the up and down arrows to move the cursor in front of the Menu Item you want help on.
- Step 2. Click the Help button either on the front Panel and a Help Dialog appears. The help dialog tells you what the Menu Item is used for or other descriptive information to help you enter the right parameters for the current menu item.
- Step 3. Push the Exit button to return to the current menu.

### Description of the Front Panel

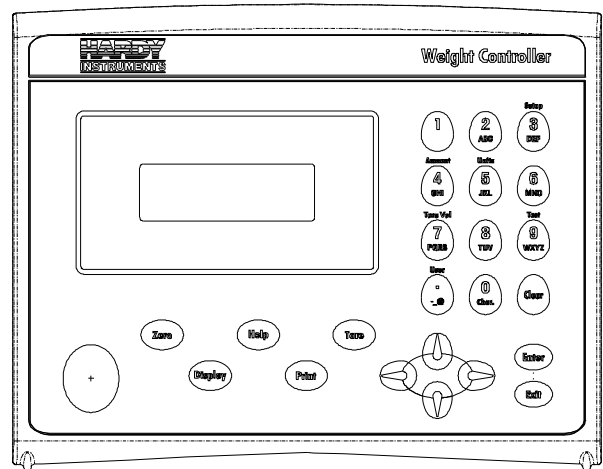


FIG. 4-1 FRONT PANEL

### Front Panel Display

The Front Panel Display is a 4 line x 20 Alphanumeric character LCD. The screen displays all the menus for Configuring, Calibrating and Operating the HI 3030 Weight Controller.

### Button Functions

#### Tare Button

Tares the selected scale. The Tare button sets the Tare Weight equal to the Gross Weight and makes the Net Weight equal to 0. When you are in Net Mode (i.e. a channel displays NET in the Summary display, you will see the weight change to 0.00. If you are in Gross mode you will not see anything happen, but the Net weight is changed to 0.00. Press the right or left arrow buttons to verify that the Net weight is 0.00.

#### Zero Button

Used in Gross mode to zero the selected scale to within the tolerance level.

- This function can be used as many times as desired as long as the total does not exceed the value entered as the zero tolerance.

#### Help Button

The Help button displays a Help message for the current Menu item (the Menu item in front of the cursor) that is dis-

played. In Standby the Help button does not display a Help message.


**Display Button**

The Display Button displays the Net, Gross and Tare weights for the scale that is connected to the Channel selected in the Main Menu. There 4 channels total.

**Print Button**

The Print Button when pressed prints the Gross, Net and Tare weights to an attached printer. If the Rate of Change option is activated the print button prints the ROC as well. If the Scoreboard is activated the Print Button does not function.

**Up/Down - Left/Right Buttons**

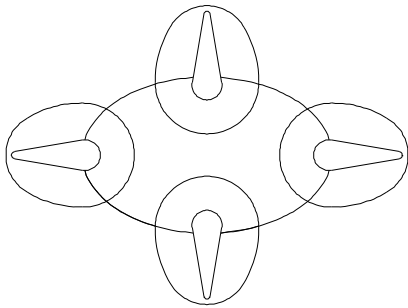

**FIG. 4-2 DIRECTIONAL BUTTONS**

The Up/Down arrow buttons move the cursor vertically allowing the user to scroll through each item of a menu. The Left/Right arrow buttons move the cursor horizontally left and right. The Left arrow button has an added backspace function. For example if there are Alpha/Numeric characters that appear in the display, as you press the left button it erases the characters. The Right arrow button moves the cursor to the right in the display and does not erase an alphanumeric entry. The Left/Right arrow buttons also move the cursor through a pick list. (See Fig. 4-2)

**Enter Button**

The Enter button enters the Alpha/Numeric value entered for a menu item in the display. The Enter button also enters the selections from a pick list. (See Fig. 4-3)

SETUP MENU	CHANNEL 1
This channel is	ON
> Unit of Measure	kg
Decimal Point	2

**FIG. 4-3 LIST SELECTION/ENTER BUTTON**

For example, when selecting units from a pick list, use the left and right arrows to move the cursor in front of the unit you want and press the Enter button.

**Exit Button**

Takes you back to the previous menu.

**Clear Button**

The Clear button clears the total Alphanumeric Entry and repositions the cursor for the first entry.

**1 Button**

Enters the integer 1 in a display.

**2/ABC Button**

Enters the integer 2 in the display. Also enters the characters A, B, C. Pushing the button once enters the integer 2.

*NOTE: For numeric entries only: Push the button and the number on the button is entered.*

*NOTE: For Alphanumeric entries only: Pushing the button once, the first letter on the button is entered in uppercase, A, D, G, and so on. Push the button a second time, the second letter is entered in uppercase, B, E, H, K and so on. Push the button a third time, the third letter is entered in uppercase, C, F, I, L, and so on. Push the button a fourth time, the fourth letter is entered in uppercase, S, Z. Push the button a fifth time the first letter is entered in lowercase, a, d, g, and so on. After you go through the lowercase letters, you can push the button again for the number. You need to push the buttons rapidly. If you delay too long the instrument will accept the alphanumeric character and move the cursor to the left preparing for the next alphanumeric entry. This is true for all the Alphanumeric buttons. If this occurs use the left arrow button to erase the current entry and enter another.*

### Setup/3/DEF Button

This enables you to access the configuration and setup menus. Also enters the number 3 and the letters D, E, F.

### Amount/4/GHI

Enables you to make quick set point changes. Also enters the number 4 and the letters C, H, I.

### Units/5/JKL Button

Enables you to change the units of measure (Lbs/Kg/oz/g) while in the standby mode of operation. Also enters the integer 5 and the letters J, K, L.

### 6/MNO Button

Enters the integer 6 and the letters M, N, O.

### Tare Val/7/PQRS Button

Enables you to set the Tare Value. Also enters the integer 7 and letters P, Q, R, S.

*NOTE: From Firmware Version 2.8.00.00 and above you can no longer enter negative tare values.*

### 8/TUV Button

Enters the integer 8 and the letters T, U, V.

### Test/9/WXYZ Button

Enables you to enter the Self-Test and IT modes. Also enters the inter 9 and letters W, X, Y, Z.

### User././\_/@ Button

Enables you to enter or change the 3 digit user code while in the standby mode. Also enters the period (.), underscore (\_) and @ symbols.

### 0/Char. Button

Enters the integer 0 in the display. When you push the button the second time a set of characters appears in the display.

- Step 1. Using the up and down arrow buttons move the cursor in front of the character you want to display.
- Step 2. Press the Enter Button to select the character.
- Step 3. Press the Exit Button to return to the display. The character should now appear next to the cursor.

## Starting Up for the First Time

When the HI 3030 Weight Controller powers up after delivery from the factory, a Summary display appears with the

correct number of channels for the installed Channel card in your instrument.

- Step 1. The First display is the Summary Display with either one, two or four channels (depending on the installed option card) displaying the weight in Gross mode. (See Fig. 4-4, 4-5, 4-6)
- Step 2. To change from Gross to Net mode press either the right or left arrow buttons until NET appears.

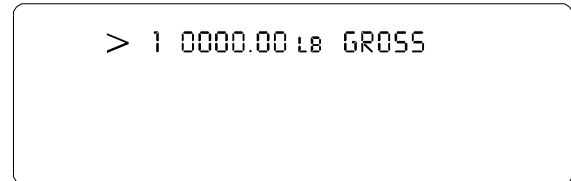


FIG. 4-4 SUMMARY DISPLAY/1 CHANNEL

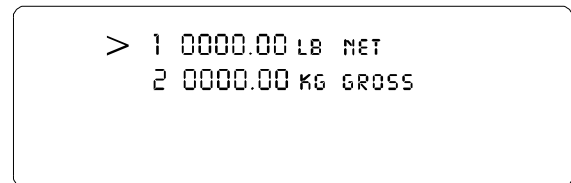


FIG. 4-5 SUMMARY DISPLAY/2 CHANNEL

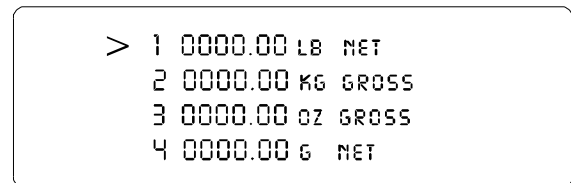


FIG. 4-6 SUMMARY DISPLAY/4 CHANNELS

- Step 3. To select a channel, press the up or down buttons to move the cursor in front of the channel you want. (See Fig. 4-7)
- Step 4. Press either the Display or the Enter button. The Single Channel display appears for the selected channel.


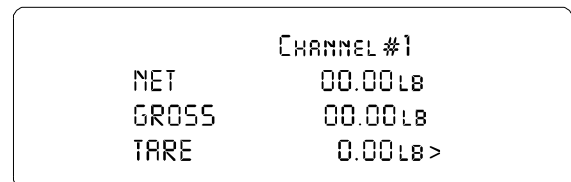


FIG. 4-7 SINGLE CHANNEL SELECTION DISPLAY

Step 5. You will notice an arrow at the end of the TARE line. (See Fig. 4-7)

*NOTE: Tare weight must be > 0 and < scale capacity. From Firmware Version 2.8.00.00 and above you can no longer enter negative tare values.*


Step 6. To change the Tare Weight, press the Enter button. The Tare menu appears. (See Fig. 4-8)

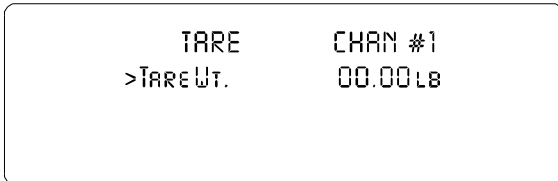

**FIG. 4-8 TARE MENU**

Step 7. To change the Tare weight:

- Press the Clear button.
- Use the Alpha Numeric pad to enter the new Tare weight.
- Press the Enter button to set the entry.
- A brief “Entry Accepted” displays. (See Fig. 4-9)

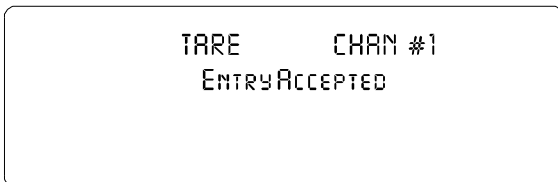

**FIG. 4-9 TARE MENU/ENTRY ACCEPTED**


Step 8. Press the Exit button to return to the Single Channel Display.

Step 9. Press the Exit button again to return to the Summary Display.

## Weight Controller Configuration From the Front Panel


The Weight Controller Configuration process sets up the instrument to operate as a scale. This includes setting WEVERSAVER®, Scale Capacity, Units of Measure, Motion tolerance and other instrument parameters required for your process. Here is where the permanent parameters are entered. All the parameters configured except the communications parameters, (IP Address etc.) are stored in the Secure Memory Module (SMM).

Step 1. Press the up or down arrows until the cursor is in front of the Channel you want to configure. (See Fig. 4-10)

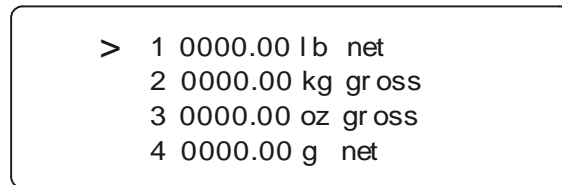


**FIG. 4-10 SUMMARY DISPLAY/SELECTING CHANNEL**

Step 2. Press the Setup/3 button. The Configuration Menu appears. (See Fig. 4-11)

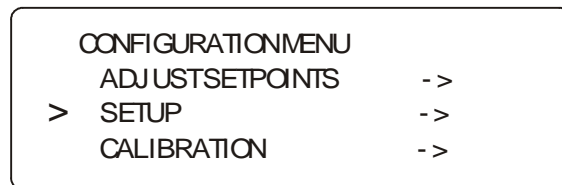

**FIG. 4-11 CONFIGURATION MENU/SELECTING SETUP**

Step 3. Press the Enter button. The Setup Menu Appears. (See Fig. 4-12)

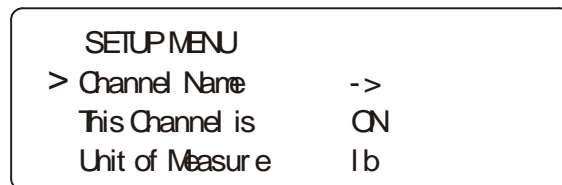


**FIG. 4-12 SETUP MENU/SELECTING CHANNEL NAME**

Step 4. Press the Enter button. The Channel Name # menu appears. Use the alphanumeric buttons to enter a descriptive name for the channel you selected. (See Fig. 4-13)

**PARAMETER: CHANNEL NAME**  
**RANGE: NONE**  
**DEFAULT: CHANNEL #1**




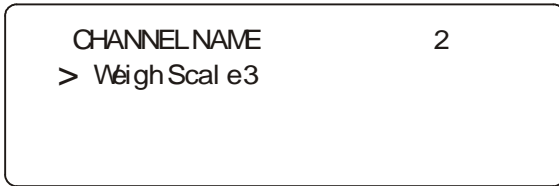

**FIG. 4-13 CHANNEL NAME/ENTERING CHANNEL NAME**

- Step 5. Press the Enter button to save the setting.
- Step 6. Press Enter to return to the Setup Menu.
- Step 7. Press the down arrow until the cursor is in front of “This Channel is”. (See Fig. 4-14)

**PARAMETER:THIS CHANNEL IS**  
**RANGE: ON/OFF**  
**DEFAULT: ON**

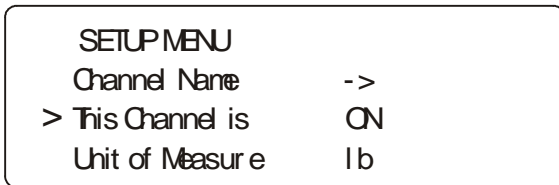

**FIG. 4-14 SETUP MENU/TURNING ON A CHANNEL**

- Step 8. Press the right or left arrow to toggle between ON and OFF.
- Step 9. Press the Enter button to save the setting.
- Step 10. Press the down arrow until the cursor is in front of Unit of Measure

**Unit of Measure Parameters**

**About Unit of Measure**

The Unit of Measure Parameter sets the scale to either English or Metric units. The Selections are:


- Pounds (lb)
- Ounces (oz)
- Kilograms (kg)
- Grams (g)

*NOTE: Changing the units of measure converts all parameter settings to the selected units except the Setpoint Values.*

**PARAMETER:UNIT OF MEASURE**

**RANGE: LB, KG, OZ, G**  
**DEFAULT: LB**

- Step 1. Press the down arrow button until the cursor is in front of Unit of Measure. (See Fig. 4-15)

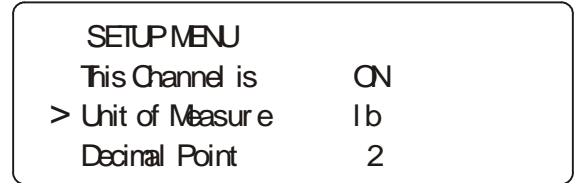

**FIG. 4-15 SETUP MENU/UNIT OF MEASURE**

- Step 2. Press the right or left arrow buttons to make your selection.
- Step 3. Press the Enter button to save the setting.


**Decimal Point Parameter**

**About the Decimal Point Parameter**

The Decimal Point Parameter is set to determine the resolution you want for a fill/dispense. Here you set the location of the decimal point for the weight resolution. The higher the number the farther to the left the decimal point moves and the higher the resolution of the scale. It is important to note that setting the resolution does effect the overall accuracy of the instrument. Increasing the number of decimal points increases the overall accuracy of the instrument.

**PARAMETER:DECIMAL POINT**  
**RANGE: 0-6**  
**DEFAULT: 2**

- Step 1. Press the down arrow button until the cursor is in front of Decimal Point. (See Fig. 4-16)

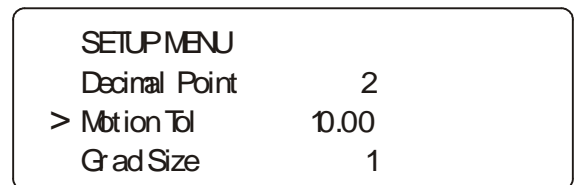

**FIG. 4-16 SETUP MENU/DECIMAL POINT**

- Step 2. Press the right or left arrow buttons to make your selection.
- Step 3. Press the Enter button to set the entry.

**Motion Tolerance Parameter**

**About Motion Tolerance**

Motion is the amount of allowable deviation between consecutive readings before a weighment is accepted as being complete. Setting Motion Tolerance establishes the amount of deviation you can allow in your particular fill/dispense process. The base motion number can be calculated by using the following formula:

$$\text{Base Motion Number} = (\text{Total Load Cell Capacity}/10,000) \times 3$$


*NOTE: Motion Tolerance must be greater than or equal to the Graduation Sizes. Our recommendation is three (3) graduation sizes.*

**PARAMETER:MOTION TOLERANCE**

**RANGE: .000001 - 999999**

**DEFAULT: 10**

Step 1. Press the down arrow button until the cursor is in front of Motion Tol (Tolerance). (See Fig. 4-17)

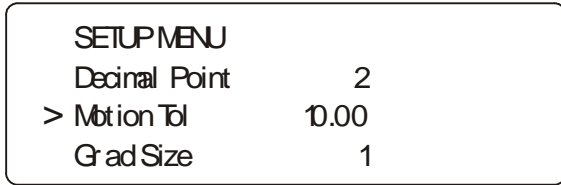

**FIG. 4-17 SETUP MENU/MOTION TOLERANCE**

- Step 2. Press the Clear button to clear the current entry.
- Step 3. Use the alphanumeric key pad to enter the new tolerance value.
- Step 4. Press the Enter button to set the entry.

**Graduation Size Parameter**

**About the Graduation Size Parameter**

The Graduation Size is the Minimum increment displayed by the instrument. The Base Graduation Number can be calculated by dividing the Total Load Cell Capacity by 10,000. For example:


- With two (2) decimal points selected, the graduation size 10 will display increments of .10 engineering units. With two (2) decimal points selected, the graduation size 50 will display increments of .50 engineering units.

**PARAMETER:GRAD SIZE**

**RANGE: 1, 2, 5, 10, 20, 50, 100, 200, 500, 1000**

**DEFAULT: 1**

Step 1. Press the down arrow button until the cursor is in front of Grad Size. (See Fig. 4-18)

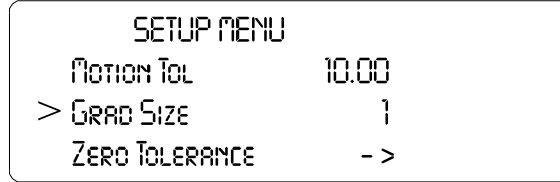

**FIG. 4-18 SETUP MENU/GRADUATION SIZE**

- Step 2. Press the right or left arrow buttons to make your selection.
- Step 3. Press the Enter button to set the entry.

**Zero Tolerance Parameter**

The Zero Tolerance parameter sets the weight units from zero that will be accepted as zero by the instrument. You can also turn on Auto Zero tolerance and set the Auto Zero Tolerance parameter and time. The Auto Zero Tolerance time setting sets the time it should take to Auto Zero the scale.

**NOTE**

*The amount of weight zeroed off is cumulative. The zero command will fail if the current gross weight plus any previously zeroed amount exceeds the zero tolerance.*

**Auto Zero Tolerance Parameter**

If ON, Auto Zero automatically zeros the empty scale to gross zero. However, it does not always automatically zero the scale. Auto zero tracking allows for small changes to be zero'd off, but not larger changes, even when they are within the auto zero tolerance.

**NOTE**

*The amount of weight zeroed off is cumulative. The zero command will fail if the current gross weight plus any previously zeroed amount exceeds the zero tolerance.*

**PARAMETER:ZERO TOLERANCE**

**RANGE: .000001-999999**

**DEFAULT: 10.0**

*NOTE: CWM mode range is 0-4% of scale capacity.*

**PARAMETER: AUTO ZERO TOLERANCE**

**RANGE: OFF/ON**

**DEFAULT: OFF**

**Zero Reminder Parameter**


The Zero Reminder when turned ON, when you zero the instrument asks you if you are sure you want to zero the instrument.

**PARAMETER: ZERO REMINDER**

**RANGE: ON/OFF**


**DEFAULT: OFF**

Step 1. Press the down button until the cursor is in front of Zero Tolerance. (See Fig. 4-19)

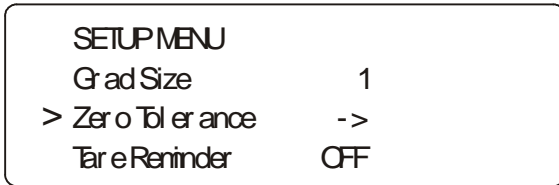

**FIG. 4-19 SETUP MENU/SELECTING ZERO TOLERANCE**

Step 2. Press the Enter button. The Zero Tolerance Menu appears with the cursor in front of Zero Tolerance. (See Fig. 4-20)

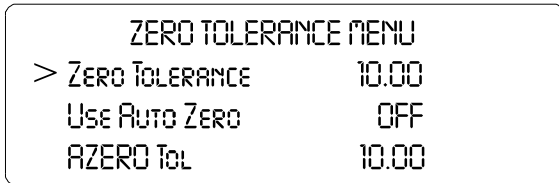


**FIG. 4-20 ZERO TOLERANCE MENU/ZERO TOLERANCE**

Step 3. Press the Clear button to clear the current value.  
Step 4. Use the alphanumeric key pad to enter the new Zero Tolerance value.


*NOTE: CWM mode: If tolerance is set greater than 4% of scale capacity, the value will be truncated.*

Step 5. Press the Enter button to set the entry.  
Step 6. Press the down arrow button until the cursor is in front of Use Auto Zero. (See Fig. 4-21)

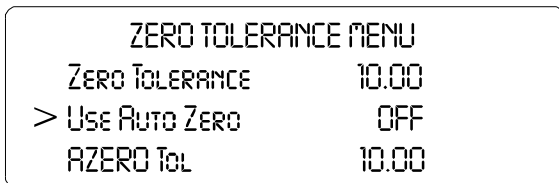

**FIG. 4-21 ZERO TOLERANCE MENU/USE AUTO ZERO**

Step 7. Press the right or left arrow buttons to toggle between OFF or ON.  
Step 8. Press the Enter button to set the entry.  
Step 9. Press the down arrow button until the cursor is in front of AZERO Tol. (See Fig. 4-22)

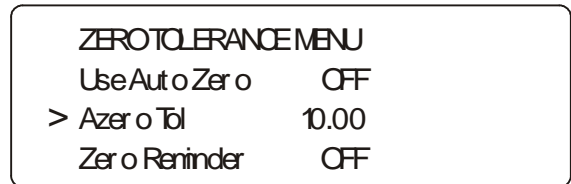


**FIG. 4-22 ZERO TOLERANCE MENU/AUTO ZERO TOLERANCE**

Step 10. Press the Clear button to clear the current value.  
Step 11. Use the alphanumeric key pad to enter the new Auto Zero Tolerance value.

*NOTE: CWM mode: If tolerance is set greater than 4% of scale capacity, the value will be truncated.*

Step 12. Press the Enter button to set the entry.  
Step 13. Press the down arrow button until the cursor is in front of Zero Reminder. (See Fig. 4-23)

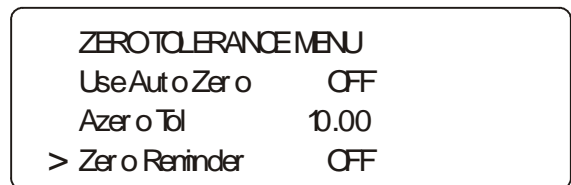

**FIG. 4-23 ZERO TOLERANCE MENU/ZERO REMINDER**

Step 14. Press right or left button to toggle between ON and OFF.  
Step 15. Press the Enter button to set the entry.

- When you press the Zero button a message appears asking you if you want to zero the instrument. (See Fig. 4-24) Follow the instructions listed in the message.

Are you sure you  
want to ZERO Scale  
Yes press Enter Key  
NO press Clear Key

**FIG. 4-24 ZERO REMINDER MESSAGE**

- Step 16. Press the Exit button to return to the SETUP MENU.  
Step 17. Press the Down Arrow button until the cursor is in front of "Tare Reminder".

**Tare Reminder Parameter**

**About the Tare Reminder Parameter**

The Tare Reminder when turned ON and you press the Tare button, a message appears asking if you are sure that you want to Tare the instrument.

**PARAMETER: TARE REMINDER**  
**RANGE: ON/OFF**  
**DEFAULT: OFF**

- Step 1. Press the right or left arrow buttons to toggle between ON and OFF.
- When you press the Tare button a message appears asking if you are sure you want to Tare the instrument. (See Fig. 4-25) Follow the instruction in the message.

Are you sure you  
want to TARE Scale  
Yes press Enter Key  
NO press Clear Key

**FIG. 4-25 TARE REMINDER MESSAGE**

- Step 2. Press the Enter button to set the entry.  
Step 3. Press the Exit button to return to the Setup Menu.  
Step 4. Press the down arrow until the cursor is in front of "Averages".

**Averages Parameter**

**About the Averages Parameter**

This setting is to aid in ignoring the effects of material impact. If material is not entering or exiting the scale evenly, weight fluctuations can be seen. Applications requiring very

quick weight readings should reduce this setting to its minimum. If the weight is unstable due to material impacting, increase the averages. This sets the number of weight readings that will be used to compute the displayed weight. The average is a sliding average so that a new average is available for display at every reading.

The Weight Controller does 55 updates per second which translates to an update approximately every 20 milliseconds. If you average enough weight readings the weight loss or gain remains smooth. If you average the weight too much you can cause over filling. Here is an example of 5 averages reading 5 Engineering Units (EU):

20ms	20ms	20ms	20ms	20ms
0	0	0	0	5
0	0	0	5	5
0	0	5	5	5
0	5	5	5	5
5	5	5	5	5
1	2	3	4	5 = 5 EU in 100ms

**TABLE 4-1: 5 AVERAGES READING 5 EU**

**PARAMETER: AVERAGES**  
**RANGE: 1-250**  
**DEFAULT: 10**

- Step 1. Press the Down arrow until the cursor is in front of Averages. (See Fig. 4-26)

SETUP MENU    CHAN1  
Tare Reminder    OFF  
> Averages        10  
Scale Cap        125.00

**FIG. 4-26 SETUP MENU/AVERAGES**

- Step 2. Press the right or left arrow buttons to increase or decrease the number of averages.  
Step 3. Press the Enter button to set the entry.  
Step 4. Press the down arrow button until the cursor is in front of "Scale Cap".

## Scale Capacity Parameter

### About the Scale Capacity Parameter

If this value is exceeded by 5% an HI indication appears on the front display. Communications to and from optional devices are not effected. This value is the nominal operating capacity of the scale. (It is recommended that you use the default parameter)

**PARAMETER:SCALE CAP**  
**RANGE: .000001-999999**  
**DEFAULT: 999999**

Step 1. Press the Down arrow button until the cursor is in front of Scale Cap. (See Fig. 4-27)

SETUP MENU	CHAN1
Averages	10
> Scale Cap	125.00
WAVERSAVER	100 Hz

**FIG. 4-27 SETUP MENU/SCALE CAPACITY**

- Step 2. Press the Clear button to clear the current entry.  
Step 3. Use the alphanumeric key pad to enter the new Scale Capacity value.  
Step 4. Press the Enter button to set the entry.

## The WAVERSAVER® Parameter

### About the WAVERSAVER Parameter

Typically, mechanical noise (from other machinery in a plant environment) is present in forces larger than the weight forces trying to be detected. The Weight Controller is fitted with WAVERSAVER® technology which eliminates the effects of vibratory forces present in all industrial weight control and measurement applications. By eliminating the factor of vibratory forces the Weight Controller is capable of identifying the actual weight data. WAVERSAVER® enables the Weight Controller to distinguish between actual weight data and mechanical noise, both of which are typically transferred to the Weight Controller by the load cell signal.

WAVERSAVER® can be configured to ignore noise with frequencies as low as 0.25 Hz. One of four higher additional cut off frequencies may be selected to provide a faster instrument response time. The function is user selectable and can be turned off.

**PARAMETER:WAVERSAVER®**  
**RANGE: .25 HZ, .50 HZ, 1.0 HZ, 3.50 HZ, 7.50 HZ, OFF**

**DEFAULT: 1.00 HZ**

Step 1. Press the Down arrow button until the cursor is in front of WAVERSAVER®. (See Fig. 4-28)

SETUP MENU	CHAN1
Scale Cap	125.00
> WAVERSAVER	100 Hz
Operator ID:	

**FIG. 4-28 SETUP MENU/WAVERSAVER**

- Step 2. Press the right or left arrow buttons to select the setting or turn WAVERSAVER off.  
Step 3. Press the Enter button to set the entry.  
Step 4. Press the Down arrow button until the cursor is in front of "Operator ID". (See Fig. 4-29)

## Operator ID

### About Operator ID

The Operator ID is the ID of the user who is going to operate the Weight Controller or service the instrument. Select three letters or numbers or any combination of the two that adequately identifies the user. We have provided some examples below for your assistance. The Operator ID is used in connection with the security level of the user.

SETUP MENU	CHAN1
WAVERSAVER	100 Hz
> Operator ID:	
Instrument ID	->

**FIG. 4-29 SETUP MENU/OPERATOR ID**

- Step 1. Use the alphanumeric key pad to enter your Operator ID or press the Clear button to clear the previous entry and use the alphanumeric key pad to enter you Operator ID.  
Step 2. A Operator ID is three (3) characters long and can consist of alphanumeric characters.

Some examples of Operator IDs:

- Joe
- 312
- J15
- JD7

Step 3. Press the Enter button to set the entry.

Step 4. Press the Down arrow button until the cursor is in front of Instrument ID.

### Instrument ID

#### About Instrument ID

The Instrument ID parameter is used to provide specific identification for a Weight Controller. This is extremely important when using several Weight Controllers in a process. A unique Instrument ID allows you to identify one instrument from another.

**PARAMETER:INSTRUMENT ID**

**RANGE: 19 CHARACTERS**

**DEFAULT: HARDY 3030**

Step 1. Press the down arrow until the cursor is in front of Instrument ID. (See Fig. 4-30)

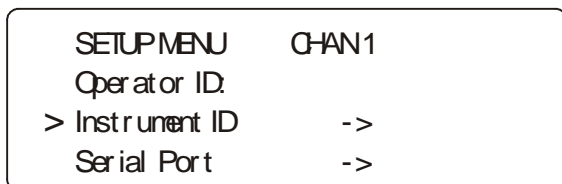


FIG. 4-30 INSTRUMENT ID PARAMETER

Step 2. Press the Enter button. The Instrument ID Menu appears. (See Fig. 4-31)

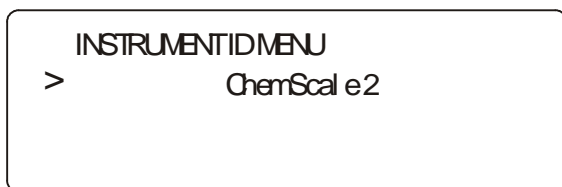


FIG. 4-31 INSTRUMENT ID MENU/CHEM 3 FILLER

- Step 3. Press the Clear button to clear the current entry.
- Step 4. Use the alphanumeric buttons to enter a new Instrument ID. It is important to be as descriptive as you can in 19 characters. In our example we identified the instrument as the Chemical 2 scale. That is the 2nd Chemical scale in a process.
- Step 5. Press the Enter button to set the entry.
- Step 6. Press the Exit button to return to the SETUP MENU.
- Step 7. Press the down arrow until the cursor is in front of Serial Port. (See Fig. 4-32)

### Serial Port Parameters

#### About the Serial Port Setup Parameters

The Serial Port Parameters are set to operate the Printer or Scoreboard which can print out or display on a Scoreboard the Gross, Net and Tare with a Rate of Change Option.

*NOTE: If Scoreboard is configured the Print button does not function.*

**PARAMETER:SERIAL PORT**

**RANGE: PRINTER - SCOREBOARD**

**DEFAULT: PRINTER**

**PARAMETER:BAUD RATE**

**RANGE: 300, 1200, 2400, 4800, 9600, 19200**

**DEFAULT: 9600**

**PARAMETER:PARITY**

**RANGE: NONE, ODD, EVEN**

**DEFAULT: NONE**

**PARAMETER:DATA BITS**

**RANGE: 7 OR 8**

**DEFAULT: 8**

**PARAMETER:AUTO PRINT**

**RANGE: ON/OFF**

**DEFAULT: OFF**

Step 1. Press the down arrow until the cursor is in front of Serial Port. (See Fig. 4-32)



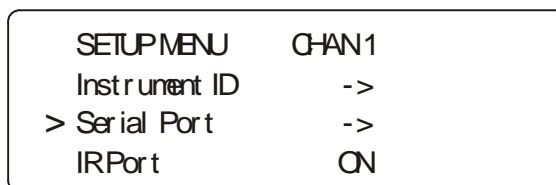


FIG. 4-32 SETUP MENU/SERIAL PORT

Step 2. Press the Enter button. The Serial Port Menu appears with the cursor in front of Serial Scoreboard or Serial Printer. (See Figs. 4-33 and 34)

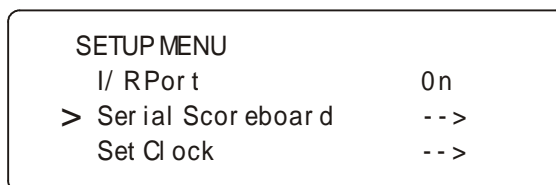

**FIG. 4-33 SERIAL PORT MENU/SCOREBOARD SETUP**

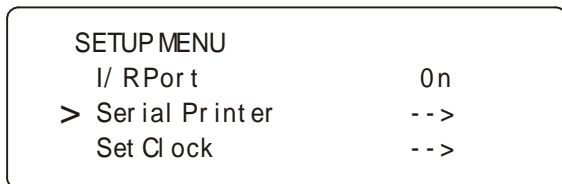

**FIG. 4-34 SERIAL PORT MENU/PRINTER SETUP**


- Step 3. Press the right or left arrow to toggle between Printer and Scoreboard.
- Step 4. Press the Enter button. The Port Setup Menu appears. (See Fig. 4-35)



**FIG. 4-35 PORT SETUP MENU/BAUD RATE**

- Step 5. Press the right or left arrow buttons to select the Baud Rate. The Selections are:
  - 300
  - 1200
  - 2400
  - 4800
  - 9600
  - 19200

- Step 6. Press the Enter button to set the entry.
- Step 7. Press the down arrow button until the cursor is in front of Parity. (See Fig. 4-36)

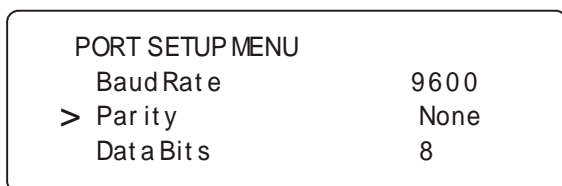

**FIG. 4-36 PRINTER PORT MENU/PARITY**

- Step 8. Press the right or left arrow buttons to select Parity. The Selections are:
  - NONE

- ODD
- EVEN

- Step 9. Press the down arrow until the cursor is in front of Data Bits. (See Fig. 4-37)



**FIG. 4-37 PRINTER PORT MENU/DATA BITS**

- Step 10. Press the right or left arrow buttons to select the Data Bits you want. The Selections are:
  - 8
  - 7

- Step 11. Press the enter button to set the entry.
- Step 12. Press the Exit button two (2) times to return to the SETUP MENU.

**Tare Limit Parameter**

**About the Tare Limit Parameter**

The Tare Limit Parameter limits the amount of automatic tare. Tare is the artificial zeroing of the weight hopper so that a new weight can be displayed. Also, the action of adjusting out the known weight of the container from the total indicated weight, so that the indicator reads net weight directly.

**PARAMETER:TARE LIMIT**  
**RANGE: .000001-999999**  
**DEFAULT: 999999**

- Step 1. Press the down arrow until the cursor is in front of Tare Limit. (See Fig. 4-38)



**FIG. 4-38 SETUP MENU/TARE LIMIT**

- Step 2. Press the Clear button to clear the current entry.
- Step 3. Use the alphanumeric key pad to enter the new Tare Limit value.
- Step 4. Press the Enter button to set the entry.

Step 5. Press the Down arrow button until the cursor is in front of "IR Port".

**Set Clock Parameter**

**About Setting the Clock**

You set the Hour, Minutes, Month, Day and Year parameters here. These settings are the time stamps for the alarms.

**PARAMETER:HOURS**  
**RANGE: hh (01-24)**  
**DEFAULT: NONE**

**PARAMETER:MINUTES**  
**RANGE: mm (01-60)**  
**DEFAULT: NONE**


**PARAMETER:MONTH**  
**RANGE: Jan. thru Dec.**  
**DEFAULT: NONE**

**PARAMETER:DAY**  
**RANGE: dd (01-31)**  
**DEFAULT: NONE**

**PARAMETER:YEAR**  
**RANGE: yyyy (2001, 2002, 2003)**  
**DEFAULT: NONE**


**PARAMETER:TIMEZONE**  
**RANGE: -12 TO +12**  
**DEFAULT: -8**

Step 1. Press the Down arrow button until the cursor is in front of Set Clock. (See Fig. 4-39)

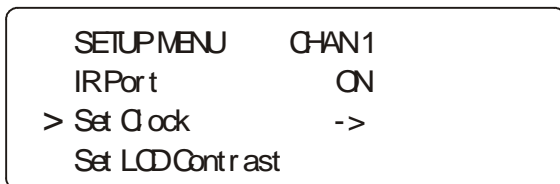

**FIG. 4-39 SETUP MENU/SET CLOCK**

Step 2. Press the Enter button. The Clock Setup Menu appears with the cursor in front of Set Hours. (See Fig. 4-40)

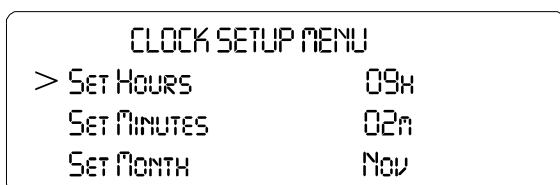


**FIG. 4-40 CLOCK SETUP MENU/SET HOURS**

- Step 3. Press the right or left arrow buttons to change the Hours setting.
- Step 4. Press the Enter button to set the entry.
- Step 5. Press the Down arrow button until the cursor is in front of Set Minutes.
- Step 6. Press the right or left arrow buttons to change the Minutes setting.
- Step 7. Press the Enter button to set the entry.
- Step 8. Press the Down arrow button until the cursor is in front of Set Month. (See Fig. 4-41)



**FIG. 4-41 CLOCK SETUP MENU/SET MONTH**

- Step 9. Press the right or left arrow buttons to change the Month setting.
- Step 10. Press the Enter button to set the entry.
- Step 11. Press the Down arrow button until the cursor is in front of Set Day.
- Step 12. Press the right or left arrow buttons to change the Day setting.
- Step 13. Press the Enter button to set the entry.
- Step 14. Press the Down arrow button until the cursor is in front of Set Year.
- Step 15. Press the right or left arrow buttons to change the Year setting.
- Step 16. Press the Down arrow button until the cursor is in front of Timezone. (See Fig.4-42)

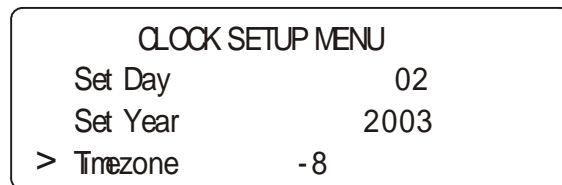

**FIG. 4-42 CLOCK SETUP MENU/SET GMT**

**About Timezones (Greenwich Mean Time)**

There are 25 integer World Time Zones from -12 through 0 (GMT) to +12. Each one is 15° of longitude as measured East and West from the Prime Meridian of the World which is at Greenwich, England. Some countries have adopted non-standard time zones, usually a 30 minute offset.



Each Time Zone is measured relative to Greenwich, England. Civilian designations are typically three letter abbreviations (e.g. EST) for most time zones. Below is a list of the abbreviated time zones with the GMT time adjustment. You will see the time zone ranges in the e-mail header.

GMT	Civilian Time Zones	Cities
<b>GMT</b>	GMT: Greenwich Mean UT: Universal UTC: Universal Co-ordinated WET: Western Europe	London, England Dublin, Ireland Edinburgh, Scotland Reykjavik, Iceland Casablanca, Morocco
<b>EAST OF GREENWICH</b>		
<b>+1</b>	CET: Central Europe	Paris, France Berlin, Germany Amsterdam, Holland Brussels, Belgium Vienna, Austria Madrid, Spain Rome, Italy Bern, Switzerland Oslo, Norway
<b>+2</b>	EET: Eastern Europe	Athens, Greece Helsinki, Finland Istanbul, Turkey Jerusalem, Israel Harare, Zimbabwe
<b>+3</b>	BT: Baghdad	Kuwait Nairobi, Kenya Riyadh, Saudi Arabia Moscow, Russia
<b>+3:30</b>		Tehran, Iran
<b>+4</b>		Abu Dhabi, UAE Muscat Tbilisi Volgograd Kabul
<b>+4:30</b>		Afghanistan
<b>+5</b>		
<b>+5:30</b>		India
<b>+6</b>		
<b>+6:30</b>		Cocos Islands
<b>+7</b>		
<b>+8</b>	CCT: China Coast	Shanghai, China Hong Kong, China Beijing, China
<b>+9</b>	JST: Japan Standard	Tokyo, Japan Osaka, Japan Taipei, Taiwan
<b>+9:30</b>	Australian Central Standard	Darwin, Australia Adelaide, Australia

**TABLE 4-2: GREENWICH TIME ZONES (GMT)**

GMT	Civilian Time Zones	Cities
<b>+10</b>	GST: Guam Standard	
<b>+10:30</b>		Lord Howe Island
<b>+11</b>		
<b>+11:30</b>		Norfolk Island
<b>+12</b>	IDLE: International Date Line East NZST: New Zealand Standard	Wellington, NZ Fiji Marshall Islands
<b>+13</b>		Rawaki Island
<b>+14</b>		Line Islands
<b>WEST OF GREENWICH</b>		
<b>-1</b>	WAT: West Africa	Azores Cape Verde Islands
<b>-2</b>	AT: Azores	
<b>-3</b>		Brasilia, Brazil Buenos Aires, Argentina Georgetown, Guyana
<b>-3:30</b>		Newfoundland
<b>-4</b>	AST: Atlantic Standard	Caracas, Venezuela La Paz
<b>-5</b>	EST: Eastern Standard	Bogota, Colombia Lima, Peru New York, NY, USA
<b>-6</b>	CST: Central Standard	Chicago, Illinois, USA Mexico City, Mexico Saskatchewan, Canada
<b>-7</b>	MST: Mountain Standard	Phoenix, Arizona Denver, Colorado
<b>-8</b>	Pacific Standard	Seattle, Washington Portland, Oregon San Francisco, CA
<b>-9</b>	YST: Yukon Standard	
<b>-10</b>	AHST: Alaska-Hawaii Standard CAT: Central Alaska HST: Hawaii Standard	Anchorage, Alaska Honolulu, Hawaii
<b>-11</b>	NT: Nome	Nome, Alaska
<b>-12</b>	IDLW: International Date Line West	

**TABLE 4-2: GREENWICH TIME ZONES (GMT)**

- Step 17. Check Table 4-2 for the time zone you are in.
- Step 18. Press the right or left arrow until the correct time zone appears. For example Pacific Standard Time is -8.
- Step 19. Press the Enter button to set the entry.
- Step 20. Press the Exit button to return to the SETUP MENU.
- Step 21. Press the Down arrow until the cursor is in front of Set LCD Contrast.

## Set LCD Contrast Parameter

### About the Set LCD Contrast Parameter

The Set LCD Contrast Parameter is used to increase or decrease the contrast on the display. Press the right arrow button to increase the contrast. Press the left arrow to decrease the contrast.

**PARAMETER:SET LCD CONTRAST**

**RANGE: NONE**

**DEFAULT: NONE**

- Step 1. Press the left or right arrow button to increase or decrease the contrast.
- Step 2. Press the Down arrow button until the cursor is in front of Devicenet.

## Ethernet Parameters

### About the Ethernet Parameters

All Weight Controllers are designed with a selectable 10/100 base T Ethernet connection which links your PC to an embedded server in the instrument. You can connect to an instrument via the Internet, Intranet, Extranet, or VPN (Virtual Private Network). Your computer must have an ethernet card and cable with an RJ45 connector to connect to the instrument. Once connected you can, monitor, map and configure any of the instruments from your web browser from any location in your plant or enterprise. Help Dialogs are also available to assist when performing setup or troubleshooting of an instrument. In addition the browser connects you to the Hardy Web Site which connects the user to a full range of customer service and support. File downloads from your control room are a snap. No more hauling devices to download files to an instrument. Should you want to download a file or monitor the instrument from your laptop at the site, simply connect a short cable from the lap top to the Ethernet connect at the rear panel of the instrument to transfer files, monitor or configure the instrument. No matter where you are, if you are connected to our instrument you can configure and troubleshoot the HI 3030 Weight Controller. Furthermore if the packet output is too high simply set the packet output to a lower setting.

### About IP Addresses

An IP address consists of 32 bits. It is composed of two parts:

- The Network Number
- The Host Number

By convention, the address is expressed as four decimal numbers separated by periods, such as "200.1.2.3" representing the decimal value of each of the four bytes. Valid addresses thus range from 0.0.0.0 to 255.255.255.255, a total of about 4.3 billion addresses.

It is recommended that you leave the Mask, Gate and DNS settings alone. Contact your Network Administrator if you need to set these parameters.

**PARAMETER:ETHERNET**

**RANGE: 0.0.0.0 - 255.255.255.255**


**DEFAULT: 192.168.110.1**

- Step 1. Press the Down arrow button until the cursor is in front of Ethernet. (See Fig. 4-43)



**FIG. 4-43 SETUP MENU/ETHERNET**

- Step 2. Press the Enter button. The Ethernet Menu appears with the cursor in front of the IP Address. (See Fig. 4-44)

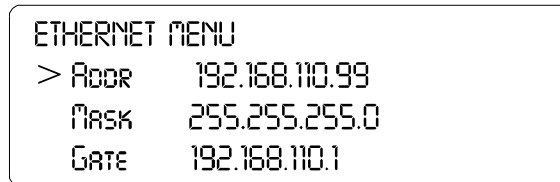

**FIG. 4-44 ETHERNET MENU/IP ADDRESS WITH DEFAULT IP ADDRESS**

- Step 3. Press the Clear button to clear the address.

*NOTE: Figure 4-44 has the Default IP address. You must change this address when starting the instrument for the first time.*

- Step 4. Use the alphanumeric key pad to enter the new address. Remember there must be a period between each part of the address. (e.g. 186.245.263.12)
- Step 5. This is the only parameter you need to change. If you need to change the other parameters, contact your Network Administrator for assistance.
- Step 6. Press the Enter button to set the entry.
- Step 7. Press the Exit button to return to the SETUP MENU.


**PARAMETER:HARDYLINK**

**RANGE: 1/SEC, 11/SEC, 55/SEC**

**DEFAULT: 55/SEC**


The Hardy Link Parameter enables you to set the UDP packet output from the HI 3030 so that the controller does not overburden your network with data packets. If you find that the packet output is slowing your Ethernet Network, simply set the output to 1/sec or 11/sec whichever meets your needs.

Step 1. From the Ethernet Sub-menu press on the down arrow until the cursor is in front of Hardy-Link. (See Fig. 4-45)

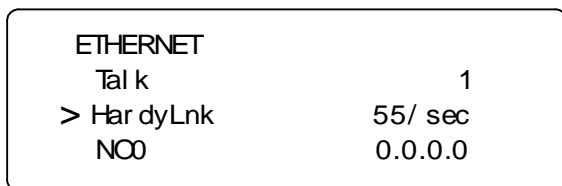

**FIG. 4-45 HARDY-LINK PARAMETER/SELECTING 11/SEC OUTPUT**

Step 2. Press on the left or right arrow button until the output you want appears. In our example we selected 11/sec. (See Fig. 4-46)

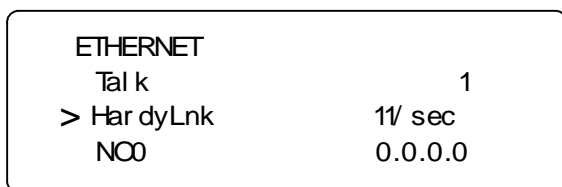

**FIG. 4-46 HARDY-LINK/SAVING PACKET OUTPUT**

Step 3. Click on the Enter button to save the selection.  
Step 4. Press the Exit button to return to the Standby Display.

### Option Cards Configuration

Option Card Configuration Procedures can be found in the HI 3000 Series User's Guide. Configuration Procedures for the Option Cards are common for all HI 3000 Series Products. However, the Analog Option Output Card configuration is contained in this chapter.

#### Analog Option Card Configuration

*NOTE: You cannot configure the Analog Option Card from the front the panel.*

#### PARAMETER:ANALOG CHANNEL CONFIGURATION

**RANGE: 0-5 V, 0-10 V, 4-20 MILLIMAPS, 0-20 MILLIAMPS**  
**DEFAULT: 0-10 V, LO - 0, HI - 100**

### Configuring the Analog Option Card from the Web Page


Step 1. From Weight Controller Home Page click on Configuration. (See Fig. 4-47) The Configuration page appears. (See Fig. 4-48)



**FIG. 4-47 WEIGHT CONTROLLER HOME PAGE/ SELECTING CONFIGURATION**


**FIG. 4-48 CONFIGURATION PAGE/SELECTING OPTIONS**

Step 2. Click on Options. The Options page appears. (See Fig. 4-49)

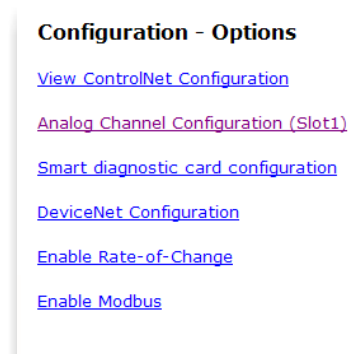


**FIG. 4-49 CONFIGURATION/OPTIONS/SELECTING ANALOG CHANNEL CONFIGURATION**

Step 3. Click Analog Channel Configuration to display the Analog Channel Configuration page. (See Fig. 4-50)

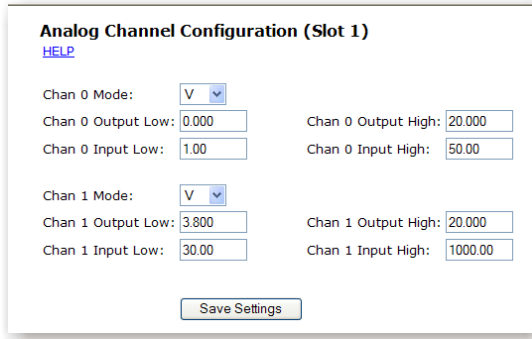

**FIG. 4-50 ANALOG CHANNEL CONFIGURATION PAGE**

 Step 4. Click on the Chan # Mode pull down list and select either volts (V) and milliamps (mA).




*NOTE: Don't be confused about the Channels. On this page you are configuring analog for the Analog board channels not the instrument channel (channels 1-4).*

Step 5. In the Input and Output high and low text fields you want to change, (See Fig. 4-51) type in the values to use for your application.

Step 6. Click Save Settings to save the configuration.

Step 7. Use the same procedure to configure other Channels.

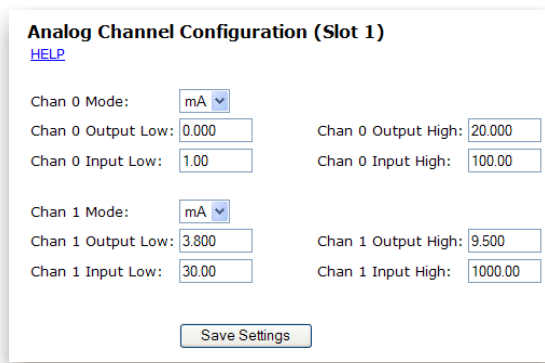


**FIG. 4-51 ANALOG CHANNEL CONFIGURATION (SLOT 1) SAVING SETTINGS**

Step 8. Should you have two analog cards installed in the Option Slots 0 and 1, to configure the other Analog card, repeat the above process starting from the Options page.

### Configuring the Analog Option Card from the Front Panel

Step 1. From the Configuration Options screen, select Analog I/O Slot # ON and press the Enter button. (See Fig. 4-52)

 

**FIG. 4-52 SELECTING ANALOG I/O SLOT #**

Step 2. On the Analog I/O Slot # screen, select the Slot # Channel # option to configure and press Enter. (See Fig. 4-53 left side)

 


**FIG. 4-53 CHOOSING SLOT, CHANNEL, AND MODE**

Step 3. The cursor will appear in front of Mode. Use the right and left arrows to toggle between volts (V) and milliamps (mA), then press Enter to select your choice. (See Fig. 4-53 right side)

Step 4. Use the up and down arrows to position the cursor in front of the Input or Output high or low value you want to change. (See Fig. 4-54 left and right)

Step 5. To change the selected value, use the number and decimal point keys to enter a new value, then press Enter to save the new value.



**FIG. 4-54 SETTING THE HIGH AND LOW VALUES**

Step 6. Should you have two analog cards installed in the Option Slots 0 and 1, to configure the other Analog card, repeat the above process starting from the Options page.

### Mapping the Output


Currently, mapping for the analog card can only be done from the WEB interface.

Step 1. Outputs (e.g. Gross, Net, Rate-of-Change) must be mapped to the Analog Output table. From the Weight Controller Home Page click Configuration to open the Configuration menu. (See Fig. 4-55)




**FIG. 4-55 CONFIGURATION MENU**

Step 2. Click Mapping Setup to open the Mapping Setup 1/ page. (See Fig. 4-56)

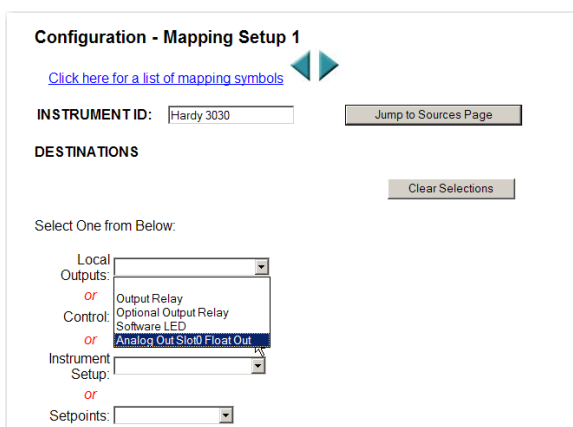

**FIG. 4-56 CONFIGURATION/MAPPING SETUP 1/ SELECTING DESTINATION/ANALOG OUT SLOT 0**

Step 3. Click Analog Out Slot 0 as the destination to open the screen below. (See Fig. 4-57)

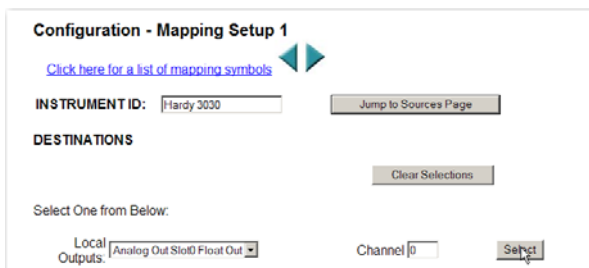


**FIG. 4-57 MAPPING SETUP 1/SELECTING ANALOG OUTPUT CHANNEL**

**NOTE:** Do not confuse the Analog Output Slot 0 or Slot 1 Channels 0 and 1 with the Instrument channels 1-4. The channel selection for the preceding step is for the Analog Output Slot, not the instrument channel.


Select the instrument channel you want on the Mapping Setup Page 2 (Sources).

Step 4. Click on the Select button to select the analog output channel # destination. The destination appears to the left of the equals sign in the Current Mappings text field. In this case the destination symbol is HFO85. (See Fig. 4-58)

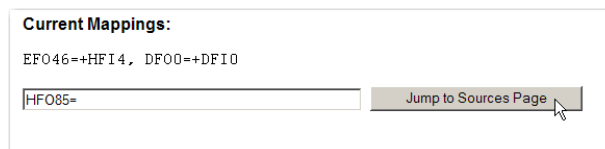


**FIG. 4-58 CURRENT MAPPINGS/PRESSING JUMP TO SOURCE PAGE**

Step 5. For more information about mapping symbols, click the mapping symbols link at the top of the page (See Fig. 4-59) to view the Mapping Symbols Dictionary. (See Fig. 4-60)

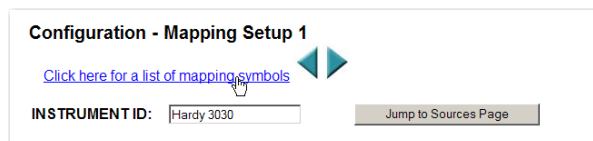


**FIG. 4-59 MAPPING SETUP 1/OPENING LIST OF MAPPING SYMBOLS**

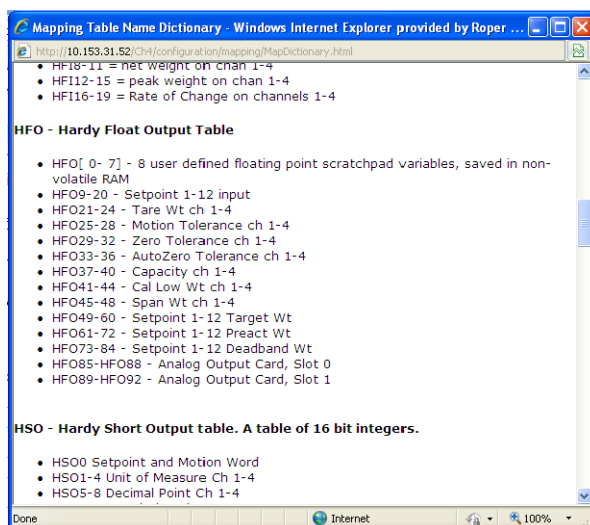

**FIG. 4-60 DICTIONARY OF MAPPING SYMBOLS**


Step 6. Scroll the list until you find the HFO - Hardy Float Output Table/Analog Output Card Slot 0 (HFO085).

Step 7. After selecting the destination, you need to select a source. Click the Jump to Sources Page button (See Fig. 4-58) to display the Mapping Setup 2 (Sources) page. (See Fig. 4-61)

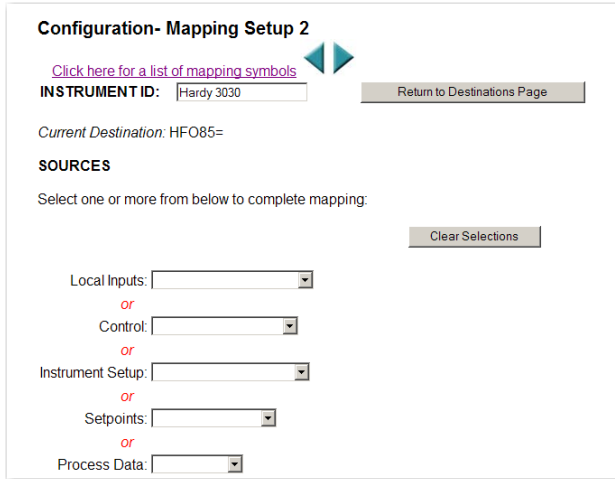


**FIG. 4-61 CONFIGURATION/MAPPING SETUP 2 PAGE**

Step 8. You can select almost any source from this page. Select Gross Wt. from the Process Data pull down list. (See Fig. 4-62)

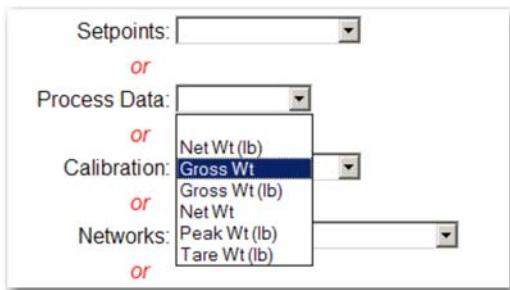

**FIG. 4-62 MAPPING/SELECTING SOURCE/GROSS WT**


Step 9. The Channel selection text field appears to the right. Enter the instrument channel (1-4) you want for the source. (See Fig. 4-63) Our example uses channel 1.

 

**FIG. 4-63 PROCESS DATA/GROSS WT/CHANNEL 1**


**NOTE:** This channel selection is for the instrument channel not the analog output slot channel.

Step 10. When you click Select, the source symbol (Gross Wt = HF14) is displayed in the Mappings field to the right of the equals symbol. (See Fig. 4-64)

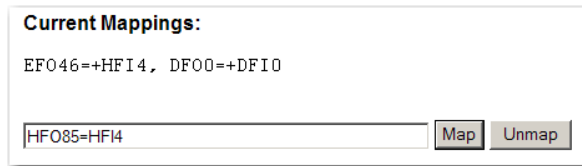

**FIG. 4-64 DESTINATION AND SOURCE COMPLETE**

Step 11. Click Map to complete the mapping process. The map appears in the Current Mappings list. (See Fig. 4-65) The Gross Weight is assigned to the Analog Output table for analog slot 0, channel 1.

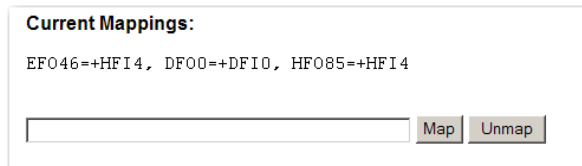

**FIG. 4-65 GROSS WT MAPPED TO THE ANALOG OUTPUT TABLE SLOT 0**

Step 12. To map to the other Analog Output tables repeat the steps above for each channel.

## Weight Controller Configuration From the Web Page

Step 1. From the Weight Controller Home Page, click on Configuration. (See Fig. 4-66) The Configuration Page appears. (See fig. 4-67)



**FIG. 4-66 WEIGHT CONTROLLER HOME PAGE/ SELECTING CONFIGURATION**


**FIG. 4-67 CONFIGURATION PAGE/SELECTING INSTRUMENT SETUP**

Step 2. Click on Instrument Setup. The Configuration-Instrument Setup Page appears. (See Fig. 4-68)



**FIG. 4-68 CONFIGURATION - INSTRUMENT SETUP WEIGHT CONTROLLER PAGE**

Step 3. To select a channel, click on the Channel pull down menu. (See Fig. 4-69)

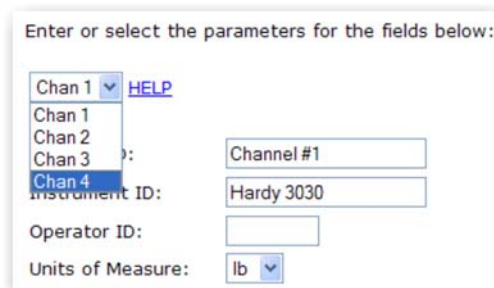

**FIG. 4-69 CONFIGURATION - INSTRUMENT SETUP WEIGHT CONTROLLER PAGE/SELECTING CHANNEL**


Step 4. Click on the channel you want to configure. Our example shows channel 4.

Step 5. To create or change a Channel ID, double click in the text field next to Channel ID. (See Fig. 4-70)

Step 6. Type in the Channel ID you want for this channel. In our example we used "Packer 1".

Step 7. To create or change an Instrument ID, double click in the text field next to Instrument ID.

Step 8. Type in the Instrument ID you want for this instrument. In our example we used "Chem Scale 3".

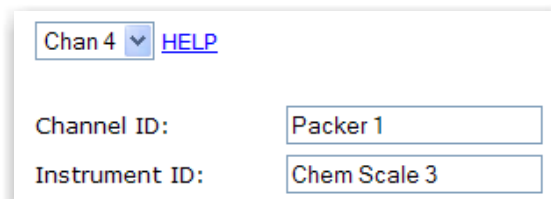


**FIG. 4-70 CONFIGURATION - INSTRUMENT SETUP WEIGHT CONTROLLER PAGE/SETTING PARAMETERS**

Step 9. To create or change an Operator ID, double click in the text field next to Operator.

Step 10. Type in the User ID. Remember you only have three characters so be brief. We used "JD" (John Doe).

Step 11. To select the Unit of measure, click on the Unit of Measure pull down menu. (See Fig. 4-71)

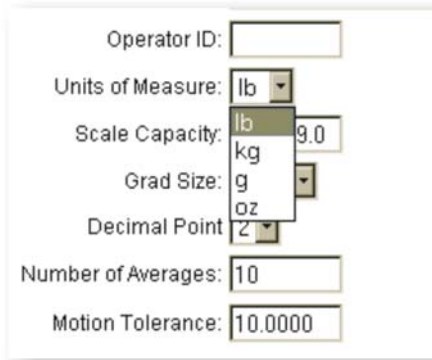


**FIG. 4-71 CONFIGURATION - INSTRUMENT SETUP WEIGHT CONTROLLER PAGE/SELECTING UNIT OF MEASURE**

- Step 12. Click on the Unit of measure you want for this channel.
- Step 13. To Set the Scale Capacity, double click in the text field next to Scale Capacity.
- Step 14. Type in the Scale Capacity of the device attached to this channel.

*NOTE: Make sure you set the scale capacity correctly. Setting it too low might lead to the material on the scale exceeding this Channel's Scale Capacity value. When the Scale Capacity value is exceeded, there will be no weight visible on the display (namely a series of \*\*\*\*\*). Setting it too high might create problems in your weigh process.*


- Step 15. To set the Grad (Graduation) Size, click on the Grad Size pull down menu. (See Fig. 4-72)

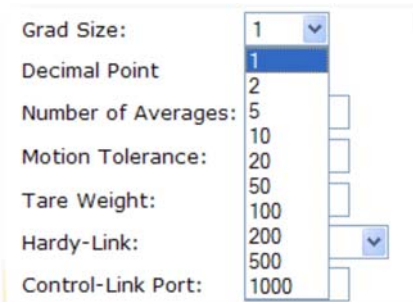

**FIG. 4-72 CONFIGURATION - INSTRUMENT SETUP WEIGHT CONTROLLER PAGE/SELECTING GRAD SIZE**

- Step 16. Click on the Grad Size you want for the device connected to this channel.

- Step 17. To set the Decimal point, click on the Decimal Point pull down menu. (See Fig. 4-73)

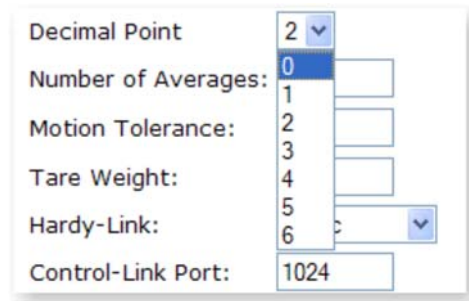

**FIG. 4-73 CONFIGURATION - INSTRUMENT SETUP WEIGHT CONTROLLER PAGE/SELECTING DECIMAL POINT**

- Step 18. To set the Number of Averages, double click in the text field next to Number of Averages.
- Step 19. Type in the number of averages for the device connected to this channel.
- Step 20. To set the Motion Tolerance, double click in the text field next to Motion Tolerance.
- Step 21. Type in the Motion tolerance for the scale that is connected to this channel.
- Step 22. To set the Tare Weight, double click in the text field next to Tare Weight. (See Fig. 74)



**FIG. 4-74 SETTING THE TARE WEIGHT**

- Step 23. Type in the Tare weight for the scale that is connected to this channel.
- Step 24. To set the Hardy-Link packet output click on the Hardy-Link pull down list. (See Fig. 4-75)



**FIG. 4-75 HARDY-LINK PARAMETER/SELECTING 1/SEC OUTPUT**



Step 25. Click on the output you want. In our example we selected 1/sec. (See Fig. 4-76)



**FIG. 4-76 HARDY-LINK/SAVING PACKET OUTPUT**

**PARAMETER:CONTROL-LINK PORT**  
**RANGE: 1024-1055**  
**DEFAULT: 1024**

This parameter sets the Control-Link Port that packets are sent and by the HI 3030. The instruments listens and transmits from this port. It is important to remember that after setting the Control-Link Port parameter you will have to cycle power to make the change from one port setting to another.

Step 26. To set the Control-Link Port, double click in the Control-Link Port text field. (See Fig. 77)



**FIG. 4-77 CONTROL-LINK PORT/SETTING PORT 1024**


Step 27. Type in the port you want for the scale that is connected to this channel.

*NOTE: After configuring the Control-Link Port you have to cycle power to make the change.*

**PARAMETER:CERTIFICATION**  
**RANGE: NONE, 10000 D (US NTEP), AND 3000 D (CANADA)**  
**DEFAULT: NONE**

The Certification pull-down selection list allows you to select the Certification to apply. If you select US NTEP or Canada, you can no longer tare a negative gross weight. Also selecting either of these parameters sets the instrument to meet the certification standard, but it does not generate certification. To get an NTEP or Canada certification, you will need to request for the appropriate agency to come and certify the instrument.

Step 28. Select the certification type from the pull-down list pull down list. (See Fig. 4-78)

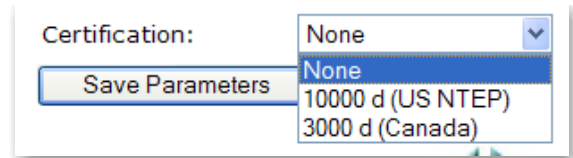

**FIG. 4-78 SELECTING CERTIFICATION**


Step 29. Click on the mode you want. In our case we selected 10000 D (US NTEP). (See Fig. 79)



**FIG. 4-79 NTEP MODE/SELECTING ON**

Step 30. Click on the Save Parameters button to save the settings.


Step 31. To Configure the Serial Port, Click twice on the right arrow. The Serial Port Configuration page appears. (See Fig. 80)

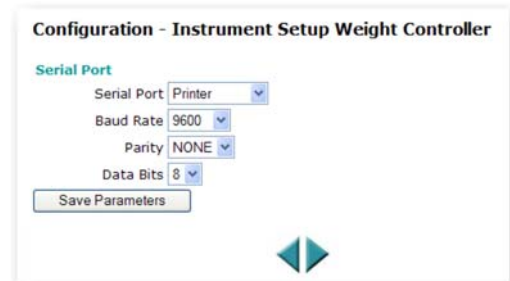

**FIG. 4-80 SERIAL PORT CONFIGURATION**


Step 32. Click on the Serial Port pull down menu. Click on either Printer or Scoreboard, depending on what the serial port is connected to. Keep in mind when you select Scoreboard the Printer does not function. (See Fig. 4-81)

*NOTE: For cable installation and pin out for the Serial Connection please see the HI 3000 Installation and Service manual, Cabling Section/Serial Port.*

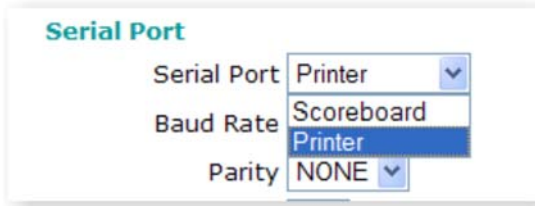


**FIG. 4-81 CONFIGURING SERIAL PORT/PRINTER - SCOREBOARD**

- Step 33. Click on the Baud Rate pull down menu.
- Step 34. Click on the Baud Rate your printer or scoreboard requires. (See Fig. 4-82)

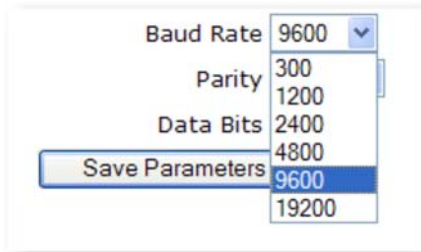


**FIG. 4-82 CONFIGURING SERIAL PORT/BAUD RATE**

- Step 35. Click on the Parity pull down menu.
- Step 36. Click on the Parity your printer or scoreboard requires. (See Fig. 4-83)

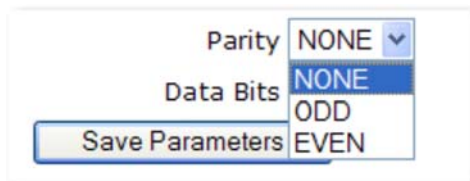

**FIG. 4-83 CONFIGURING SERIAL PORT/PARITY**

- Step 37. Click on the Data Bits pull down menu.
- Step 38. Click on 7 or 8 bits whichever you system requires. (See Fig. 4-84)

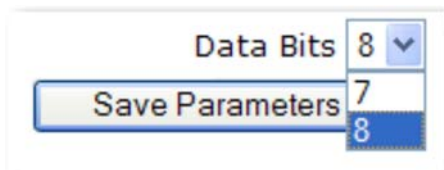


**FIG. 4-84 CONFIGURING SERIAL PORT/ SELECTING 7 OR 8**

- Step 39. Click on the Save Parameters button to save the settings.

*NOTE: You can click on the Save Parameters button anytime during this process. If you only change one parameter, click on the Save Parameters button. You must click on the Save Parameters button in order for the changes to occur.*

*NOTE: If you have changed the Control-Link Port Settings you need to cycle the power now.*

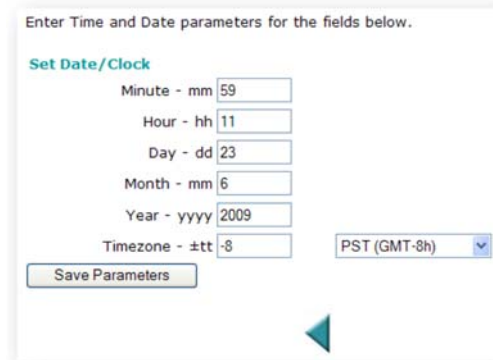

**FIG. 4-85 INSTRUMENT SETUP/SET DATE/SET CLOCK/SET TIMEZONE**

### Set Date/Clock Parameters

- Step 1. Double click in the Minute-mm field. Enter the current minutes. (See Fig. 4-85)
- Step 2. Double click in the Hour-hh field. Enter the current minutes.
- Step 3. Double click in the Day-dd field. Enter the current day.
- Step 4. Double click in the Month-mm field. Enter the current month.
- Step 5. Double click in the Year-yyyy field. Enter the Current year.
- Step 6. Double click in the Timezone field. Check Table 4-2 Civilian Time Zones, GMT on page 40 for the time zone you are in. Enter the correct Greenwich Mean Time value. Don't forget to enter the positive (+) or negative (-) sign. For our example we used the default time zone which is -8 or PST (Pacific Standard Time).
- Step 7. Click on the Save Parameters button to save the setting.

**The Instrument Configuration is complete**

## Options Configuration

### Option Cards Configuration

Option Card Configuration Procedures can be found in the HI 3000 Series Operation and Installation Manual. Configuration Procedures for the Option Cards are common for all HI 3000 Series Products.

### Rate of Change (-ROC) Option Configuration

#### ROC Configuration from the Front Panel

**PARAMETER: TIME MEASURE**

**RANGE: SEC, MIN, HRS**


**DEFAULT: SEC**

**PARAMETER: TIMEBASE**

**RANGE: 1-1800 SECONDS**


**DEFAULT: 1 SECOND**

- Step 1. From the Summary Display, press the up or down arrow buttons until the cursor is in front of the channel you want to configure for Rate of Change (ROC). (See Fig. 4-86)

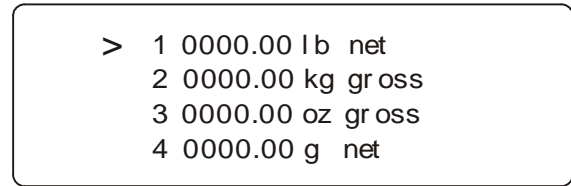


**FIG. 4-86 SELECTING CHANNEL**

- Step 2. Press the Setup/3 button.
- Step 3. The Configuration Menu appears. (See Fig. 4-87)

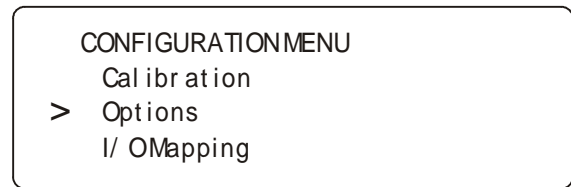


**FIG. 4-87 SELECTING OPTIONS**

- Step 4. Press the up or down arrow buttons to move the cursor in front of Options.
- Step 5. Press the Enter button. The Options Menu appears. (See Fig. 4-88)

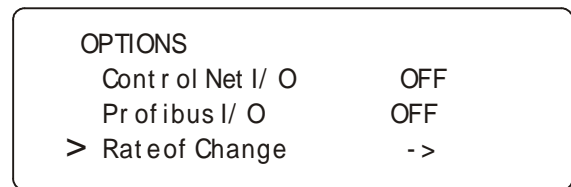

**FIG. 4-88 SELECTING RATE OF CHANGE**

- Step 6. Press the up or down arrow buttons until the cursor is in front of Rate of Change. (See Fig. 4-88)
- Step 7. Press the Enter button. The Rate of Change, Channel 1 Menu appears with the cursor in front of TimeMeasure. (See Fig. 4-89)

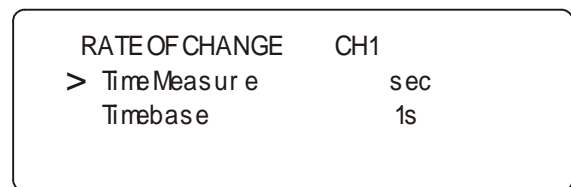

**FIG. 4-89 RATE OF CHANGE, CH1/SETTING TIME MEASURE**

- Step 8. To set the TimeMeasure, press the left or right arrow buttons to select either seconds, minutes or hours. In our example we selected seconds. (See Fig. 4-89)
- Step 9. Press the Enter button to set the entry.
- Step 10. Press the down arrow button until the cursor is in front of Timebase.
- Step 11. To set the Timebase, press the left or right arrow buttons to select the Timebase value. In our example we selected 1 second. (See Fig. 4-89)
- Step 12. Press the Enter button to set the entry.
- Step 13. Press the Exit button to return to the configuration Menu.
- Step 14. To operate the Rate of Change please see the HI 3030 User Guide/Rate of Change for instructions.
- Step 15. Tap on Enter to set the entry.
- Step 16. Tap on Exit to return to the Configuration Menu.

**ROC Configuration from the Browser**


- Step 1. From the HI 3030 Home Page, click on “Configuration”. (See Fig. 4-90) The Configuration page appears. (See Fig. 4-91)




**FIG. 4-90 HI 3030 HOME PAGE/SELECTING CONFIGURATION**

**FIG. 4-91 CONFIGURATION MENU/SELECTING OPTIONS**

- Step 2. Click on Options. The Configuration - Options page appears. (See Fig. 4-92)
- Step 3. Click on “Rate-of-Change Configuration”. (See Fig. 4-92) The Rate of Change page appears. (See Fig. 93)

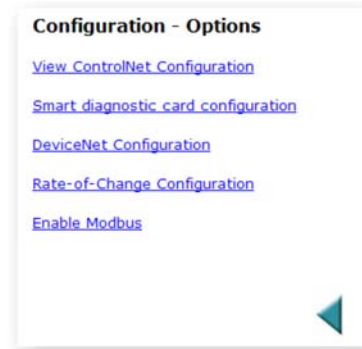


**FIG. 4-92 CONFIGURATION - OPTIONS/ SELECTING RATE-OF-CHANGE**

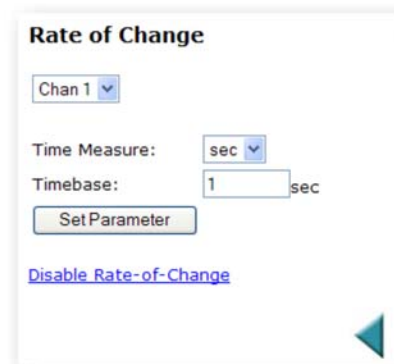

**FIG. 4-93 RATE OF CHANGE PAGE**

- Step 4. Click on the Channel pull down menu to select the channel Rate of Change you want to view. (See Fig. 93)
- Step 5. Click on the channel number.
- Step 6. To set the Time Measure click on the Time Measure pull down menu. (See Fig. 94)
- Step 7. Click on the time measure you want.

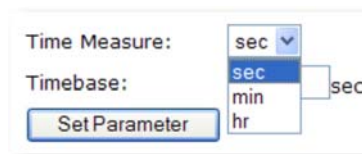

**FIG. 4-94 RATE OF CHANGE/SELECTING TIME MEASURE**

- Step 8. To set the Timebase, double click in the Timebase text field. Type in the number you want the time it takes to run a Rate of Change evaluation. (See Fig. 4-95)



**FIG. 4-95 RATE OF CHANGE/ENTERING THE TIMEBASE VALUE**

- Step 9. Click on the Set Parameter button to set the entry. (See Fig. 4-95)
- Step 10. Click on the back arrow to return to the HI 3030 Home Page.

**DeviceNet Parameters**


**About the DeviceNet Parameters**

DeviceNet is a low-level network designed to connect the Weight Controller to higher-level controllers such as PCs, PLCs or embedded controllers. The DeviceNet Network is an open, global industry-standard communication network designed to provide an interface through a single cable from a programmable controller or PC directly to all HI 3000 Series products as well as smart devices such as sensors, push buttons, motor starters, simple operator interfaces, drives and other weight modules. With DeviceNet the user can monitor or control multiple applications from one display and allows 3rd party I/O to be easily added to any system. You no longer have to hard-wire each device to an I/O module or I/O block. The network also provides access to the intelligence present in the instruments for superior diagnostics and troubleshooting to help increase system up time. The DeviceNet network lets you monitor your plant-floor devices from a central location and reconfigure them as your needs change or service them as required. You can, for example, configure the Weight Controller modules for different applications.

**PARAMETER:DEVICENET BAUD RATE**  
**RANGE: 125K, 250K, 500K**  
**DEFAULT: 125K**


**PARAMETER:DEVICENET NODE ADDRESS**  
**RANGE: 0-64**  
**DEFAULT: 0**

- Step 1. From the Options Menu press the Down arrow until the cursor is in front of DeviceNet. (See Fig. 4-96)

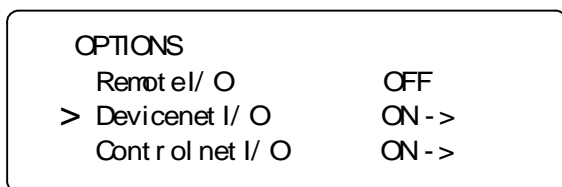

**FIG. 4-96 OPTIONS MENU/DEVICENET**

- Step 2. Press the Enter button. The DeviceNet Menu appears with cursor in front of Baud Rate. (See Fig. 4-97)

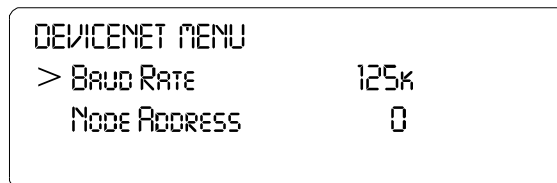


**FIG. 4-97 DEVICENET MENU/BAUD RATE**

- Step 3. Press the right or left arrow buttons to select the Baud Rate you want.

*NOTE: Check with your Network Administrator for the Baud Rate if you don't know the correct Baud Rate.*

- Step 4. Press the Enter button to set the entry.
- Step 5. Press the Down arrow until the cursor is in front of Node Address. (See Fig. 4-98)

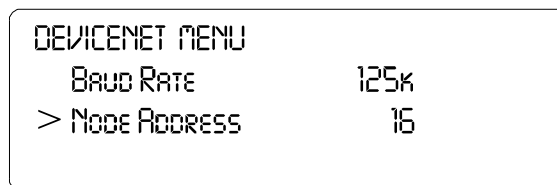

**FIG. 4-98 DEVICENET MENU/NODE ADDRESS**

- Step 6. Press the right or left arrow buttons to select the Node Address.
- Step 7. Press the Enter button to set the entry.
- Step 8. Press the Exit button to return to the OPTIONS MENU.
- Step 9. Press the Exit button to return to the Summary Display.



## CHAPTER 5: CALIBRATION

### About Chapter 5

Chapter 5 pertains to the calibration procedures for the HI 3030 Weight Controller. Alternatives to any procedures implied or explicitly contained in this chapter are not recommended. In order for the Weight Controller to work properly, it must be calibrated prior to operation. Be sure to follow all the procedures completely to insure that the weights read by the Weight Controller are accurate. It is very important that the user and service personnel be familiar with the procedures contained in this chapter, before installing or operating the HI 3030 Weight Controller.

### Getting Started

The HI 3030 Weight Controller can be calibrated two ways. The first is the Hardy C2<sup>®</sup> Second Generation calibration which requires no test weights. Hardy C2<sup>®</sup> Calibration is one of the Core Technologies. We will describe the C2 Calibration process in this chapter. The second calibration technique is called the traditional calibration which requires certified test weights. It is important to note that the procedures contained in this section either explicitly stated or implied should be followed to guarantee the performance of the instrument. Alternatives to the procedures listed here are not recommended.


Before you can calibrate the instrument you first need to check to see if the system is ready to be calibrated.

### Binding

Step 1. Due a visual check to see if the load cells have been installed so that nothing is binding the load cell or other parts of the weighing system. Make sure that nothing is draped over the scale or vessel such as a hose, electrical cord, tubes or other objects.

**CAUTION: BINDING ON A SCALE/VESSEL OR LOAD CELL DOES NOT ALLOW THE LOAD CELL FREE VERTICAL MOVEMENT AND MAY PREVENT THE INSTRUMENT FROM RETURNING TO THE ORIGINAL ZERO REFERENCE POINT.**

Step 2. Check to see that the load cell is mounted so that 100% of the load (Vessel with Contents) vertically passes through the load cell. (See Fig. 5-1)

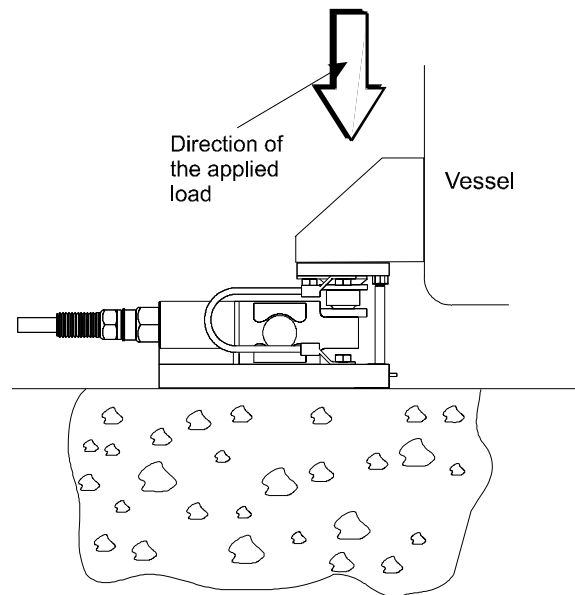

**FIG. 5-1 PROPERLY INSTALLED LOAD CELL WITH NO BINDING**


### Electrical Check Procedures

- Step 1. Check to see that there is power to the controller.
- a. If there is power to the controller The front panel display should be lit.
  - b. If the display appears with a value the unit is ready for calibration.
- Step 2. Check to see that all communication and power cables are securely fastened to the connectors on the rear panel.


### C2 Calibration From the Front Panel

- Step 1. Press the Setup/3 button. The Configuration Menu appears. (See Fig. 5-2)
- Step 2. Press the down arrow until the cursor is in front of CALIBRATION. (See Fig. 5-3)
- Step 3. Press the Enter button. The CALIBRATION Menu appears with the cursor in front of CAL TYPE C2. (See Fig. 5-3)


**NOTE:** *If the cursor is in front of CAL TYPE TRAD, press the left or right arrow buttons until CAL TYPE C2 appears.*

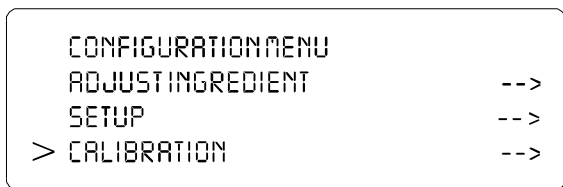

**FIG. 5-2 CONFIGURATION MENU/SELECTING SETUP**

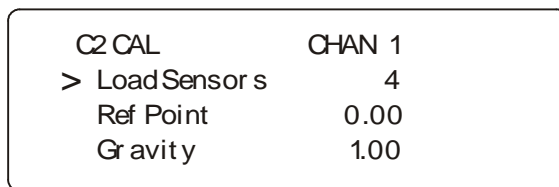

**FIG. 5-5 C2 CALIBRATION SUB-MENU**

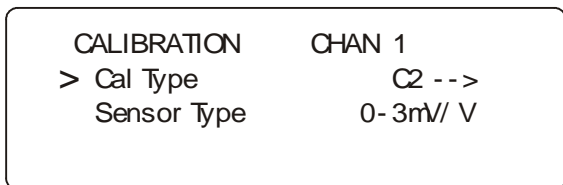


**FIG. 5-3 CALIBRATION MENU/C2 CAL**

**CAUTION: FOR HARDY ADVANTAGE AND ADVANTAGE LITE C2 LOAD CELLS YOU MUST SELECT 0-3mV/V ONLY. SELECTING OTHER SENSOR TYPES WILL CREATE INCORRECT WEIGHT READINGS.**

There are four (4) Sensor Type choices:

- 0-3mV/V - C2 Load Sensors Only
- ± 3mV/V - Non C2 Load Sensors
- 0-120mV/V - LVDT Type Load Sensors
- ± 120mV/V - LVDT Type Load Sensors

Step 4. Press the down arrow until the cursor is in front of Sensor Type.

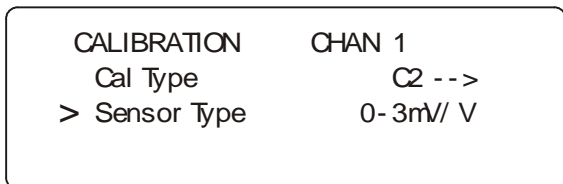

**FIG. 5-4 CALIBRATION/SENSOR TYPE**

Step 5. If the Sensor Type reads anything other than 0-3mV/V, use the left or right arrow to select 0-3mV/V.


Step 6. Press the Enter button. C2 CAL Sub-menu appears. (See Fig. 5-4)

Step 7. The Load Sensor number is a read only field. It tells you how many C2 load sensors are connected to the instrument. In our example there are 4 C2 load sensors connected to the instrument.

Step 8. Press the down arrow button to move the cursor in front of the Ref Point. (See Fig. 5-5)

- a. The Reference Point is the total live load that is currently on the scale.
- b. If you have nothing on the scale the Ref Point is 0. If you have 5 lbs live load on the scale the Ref Point is 5.

*NOTE: Normally the scale system is clean and ready to receive product. This step establishes the gross zero reference.*

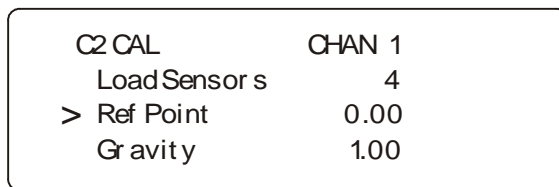

**FIG. 5-6 ENTERING THE REFERENCE POINT**

Step 9. Press the Clr (Clear) button to clear the entry.

Step 10. Use the alphanumeric key pad to enter the weight that is currently on the scale, typically zero (0.00).

Step 11. Press the down arrow button to move the cursor in front of Gravity. (See Fig. 5-7)

**About The Gravitation Correction Factor**

Objects weigh less (about 0.5%) at the equator then they weigh at each pole because the force of gravity is less at the equator then at the North or South Pole. This is due in part to the effect of the earth's rotation and the shape of the earth at the equator. Therefore objects at the equator are 21 Km further from the Earth's center than objects at the poles. For example if you weigh 100 pounds at the North Pole on a spring scale you weigh 99.65 pounds at the equator. Depending on the latitude of your location you would weigh somewhere in between. For those who need the gravity correction factor you can set it here. The



table below shows the gravitation correction factor. In various cities around the world. Mexico City (1.002102) is the lowest and Oslo (0.998726) and Helsinki (1.001405) are the highest.


**Table 1: Gravity Correction Factors**

CITY	GRAV. ACCEL	CITY	GRAV. ACCEL
Amsterdam	0.999369	Los Angeles	1.001028
Athens	1.000684	Madrid	1.000461
Auckland NZ	1.000782	Manila	1.000461
Bangkok	1.002392	Mexico City	1.002102
Brussels	0.999503	New York	1.000433
Buenos Aires	1.001004	Oslo	0.998726
Calcutta	1.00191	Ottawa	1.000007
Cape Town	1.00104	Paris	0.999048
Chicago	0.99922	Rio de Janeiro	1.001884
Copenhagen	0.999075	Rome	1.000326
Nicosia	1.00093	San Francisco	1.000702
Jakarta	1.002631	Singapore	0.99877
Frankfurt	0.999579	Sydney	1.00104
Istanbul	1.000406	Taipei	1.001741
Havana	1.001872	Tokyo	1.000886
Helsinki	1.001405	Vancouver BC	0.999653
Kuwait	1.001405	Washington DC	1.000601
Lisbon	1.000615	Wellington NZ	0.999399
London	0.999445	Zurich	0.999821

In general if your location is between the 45th parallel and the equator the gravity correction is greater than 1.0. Because the gravity is less at these attitudes you are adding, for example 1.006 for an error that is .06%. For locations between the 45th parallel and the North or South Pole your correction factor is less than 1.0, for example .9994 for an error that is -.06%.


**NOTE:** You must perform a C2 Calibration after setting the Gravity Correction factor or the correction factor won't work.

**NOTE:** If you do not want to set the Gravity Correction Factor go to Step 16.

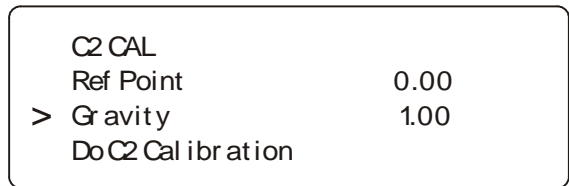

**FIG. 5-7 GRAVITY CORRECTION FACTOR**


Step 12. Press the Clear button to clear the entry. (See Fig. 5-8)

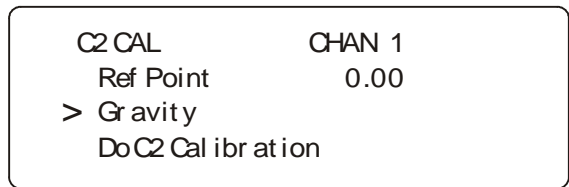

**FIG. 5-8 GRAVITY/CLEARING ENTRY**


Step 13. From the Gravity Correction Factors table select the city correction factor closest to your location.

Step 14. Use the keypad to enter the selected value. In our example we entered 1.002102 which is the correction factor for Mexico City. (See Fig. 5-9)

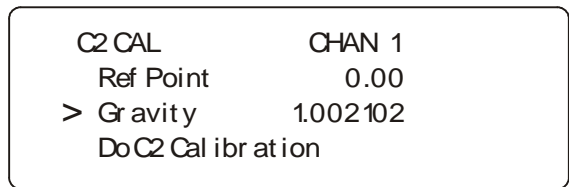

**FIG. 5-9 GRAVITY CORRECTION FACTOR/ MEXICO CITY**

- Step 15. Press the Enter button to save the setting.
- Step 16. Press the down arrow button to move the cursor in front of Do C2 Calibration. (See Fig. 5-10)
- Step 17. Wait 15 seconds for the scale to settle.
- Step 18. Press the Enter button to complete the Calibration.

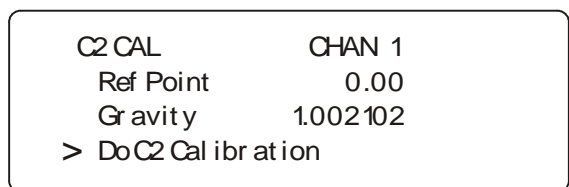

**FIG. 5-10 C2 CALIBRATION**

- Step 19. A “function OK” momentarily appears on the screen indicating the calibration was successful
- A message that says “function Error” means that the calibration was not successful. Check Chapter 7 - Troubleshooting of this manual for corrective action.
  - Another message may occur which is: Security Violation. This means that the User does not have the security level required to do a calibration.

- Step 20. Press the Exit button until you return to the Standby display.  
 Step 21. C2 calibration is complete.

### C2 Calibration From the Web Page

- Step 1. On the Weight Controller Home Page Click on Configuration. (See Fig. 5-11) The Configuration page appears. (See Fig. 5-12)

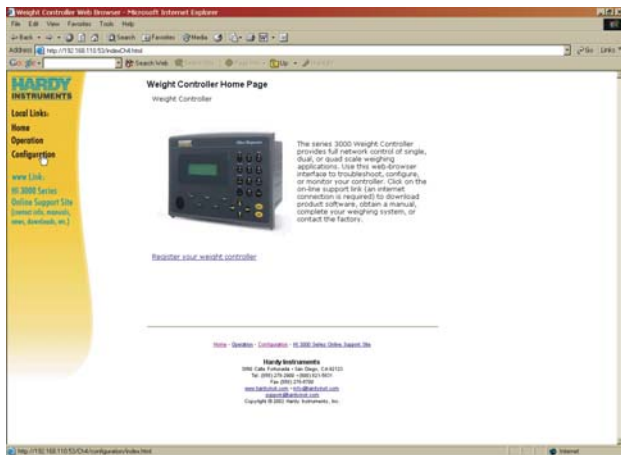


FIG. 5-11 CONFIGURATION MENU/SELECTING SETUP



FIG. 5-12 CONFIGURATION PAGE

- Step 2. Click on Calibration. The Calibration Sub-menu appears. (See Fig. 5-9)  
 Step 3. Click on the Channels pull down menu.  
 Step 4. Click on the Channel connected to the scale you want to calibrate.

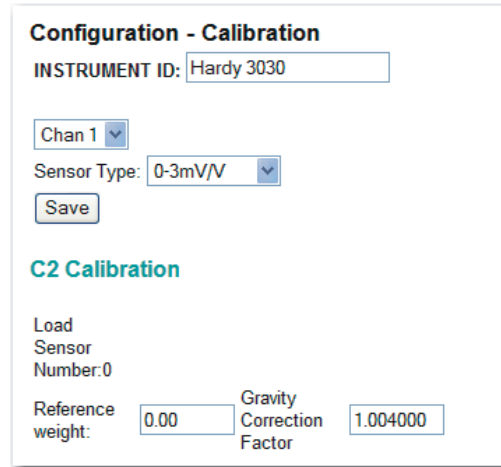


FIG. 5-13 C2 CALIBRATION SUB-MENU

- Step 5. Click on the Sensor Type pull down list. (See Fig. 5-14)

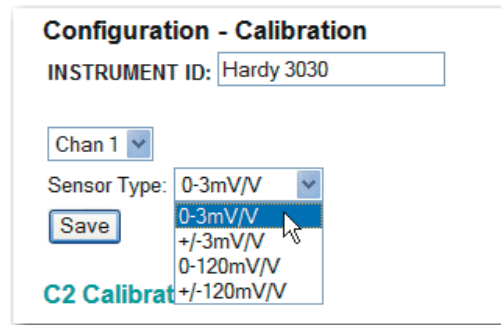



FIG. 5-14 CALIBRATION/SELECTING SENSOR TYPE

- Step 6. Click on 0-3mV/V for C2 (Hardy Advantage and Advantage Lite) load sensors.  
 Step 7. The Load Sensor number is a read only field. It tells you how many C2 load sensors are connected to the instrument. If this number does not coincide with the actual number of load sensors go to Chapter 7 - Troubleshooting.  
 Step 8. To enter the Reference Weight click in the Reference Weight field. (See Fig. 5-9)

*NOTE: The Reference Weight 0.000 is for demonstration purposes only. The recommended Reference Point should be 0.000.*

- a. The Reference Point is the total weight that is currently on the scale.
- b. If you have nothing on the scale the Ref Point is 0. If you have 5 lbs on the scale the Ref Point is 5.

- Step 9. Double click in the Reference weight text field.  
 Step 10. Use your keyboard to type in the new value. In our example we entered 0.00. (See Fig. 5-9)

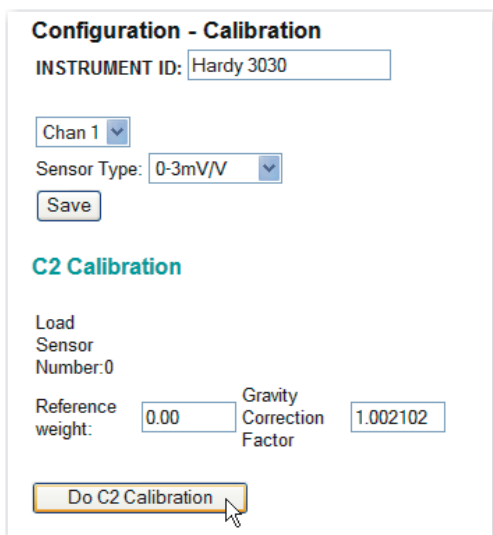

**FIG. 5-15 CALIBRATION/ENTERING REFERENCE WEIGHT**

- Step 11. If you do not want to enter a gravity correction factor go to Step 15.  
 Step 12. If there is a gravity correction factor entered and you do not want to use a correction factor do the following:
- Double click in the Gravity Correction Factor text field.
  - Enter 1.0, the value used for no correction factor.
  - Go to Step 15.
- Step 13. Go to the Gravity Correction Factors table on page 51. Select the correction factor of the city closest to your location.  
 Step 14. Type the correction factor in the Gravity Correction Factor text field. In our example we entered 1.002102 which is the correction factor for Mexico City. (See Fig. 5-15)  
 Step 15. Click on the Do C2 Calibration button.  
 Step 16. A page telling you that the C2 Calibration completed OK. (See Fig. 5-16)

## Cal completed OK

[Back](#)

**FIG. 5-16 CAL COMPLETED OK**


- Step 17. Click on "[Back](#)" to return to the Calibration page.  
 Step 18. Click on "Home" to return to the Weight Controller Home page.  
 Step 19. C2 calibration is complete.

## Traditional Calibration From the Front Panel

### About Traditional Calibration

Traditional Calibration is the method of calibration that uses test weights. We recommend that the test weights total 80 to 100% of the scale live load capacity.


- Step 1. Press the Setup/3 button. The Configuration Menu appears. (See Fig. 5-17)

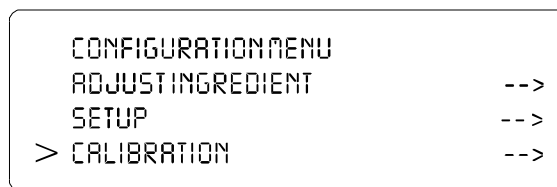

**FIG. 5-17 CONFIGURATION MENU/CALIBRATION**

- Step 2. Press the down arrow until the cursor is in front of CALIBRATION. (See Fig. 5-17)  
 Step 3. Press the Enter button. The CALIBRATION Menu appears with the C2 Cal Type. (See Fig. 5-18)

*NOTE: If the CALIBRATION MENU appears with Cal Type, TRAD go to Step 5.*

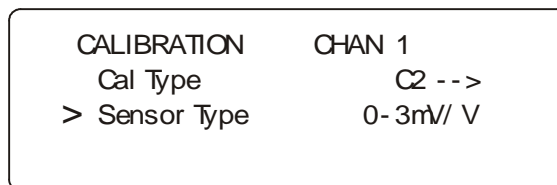

**FIG. 5-18 CALIBRATION MENU**

Step 4. Press the Right or Left arrow buttons to select Traditional Calibration. (See Fig. 5-19)

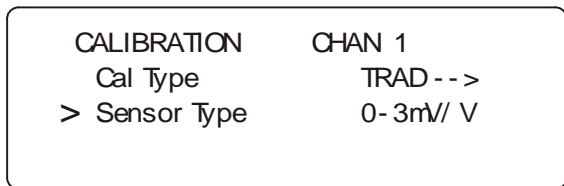


FIG. 5-19 CALIBRATION/TRADITIONAL

Step 5. Press the Enter Button. The Traditional Cal Menu appears with the cursor in front of Zero Value. (See Fig. 5-20)

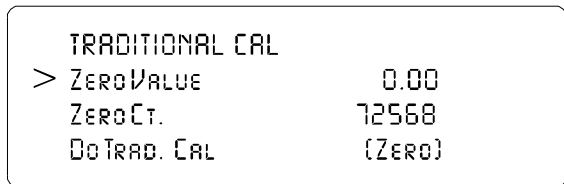


FIG. 5-20 TRADITIONAL CALIBRATION/ZERO VALUE

Step 6. Traditional Calibration requires a zero point and the physical placement of test weights on the scale. To Set the Zero Value:

- Remove all weight "live load" from the scale. The Zero Value should be 0.00.

**CAUTION: THE SCALE MUST BE EMPTY.**

- Wait 12 seconds or more.

*NOTE: Zero Ct. is read only and is used to Troubleshoot the instrument. The Zero Ct. is always smaller than the Span Ct.*

Step 7. Press the Down arrow button until the cursor is in front of the Do Trad Cal. (See Fig. 5-21)

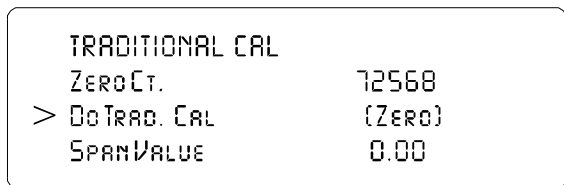


FIG. 5-21 DO TRADITIONAL CALIBRATION/ZERO

Step 8. Press the Enter button to do the Zero Calibration. If "Function OK" appears the Zero Calibration is complete. If an ERR number appears go to Chapter 7, Troubleshooting for more information.

Step 9. Press the Down arrow button until the cursor is in front of Span Value. (See Fig. 5-22) To Set the Span Value:

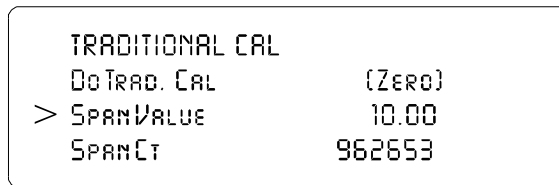


FIG. 5-22 TRADITIONAL CALIBRATION/SPAN VALUE

- Place a certified test weight on the scale.
- Use the alphanumeric key pad to enter the value of the test weight. (If a 10 lb. weight is used, enter 10).

*NOTE: Ideally the test weight used for the span should be the highest weight that will be measured in the application.*

- Wait 12 seconds or more.

Step 10. Press the Down arrow button until the cursor is in front of the Do Trad Cal. (See Fig. 5-23)

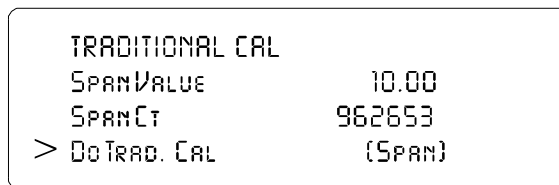


FIG. 5-23 TRADITIONAL CALIBRATION/SPAN

Step 11. Press the Enter button to do the Span Calibration. If "Function OK" appears the Span Calibration is complete. If an ERR number appears go to Chapter 7, Troubleshooting for more information.

Step 12. End of Calibration

### Traditional Calibration From the Web Page

Step 1. On the Weight Controller Home Page Click on Configuration. (See Fig. 5-24) The Configuration page appears. (See Fig. 5-25)



**FIG. 5-24 CONFIGURATION MENU/SELECTING SETUP**



**FIG. 5-25 CONFIGURATION PAGE**

- Step 2. Click on Calibration. The Calibration Sub-menu appears. (See Fig. 5-26)
- Step 3. If necessary select the Sensor Type for this application.

**Traditional Calibration**

**Traditional Calibration - Low Step**

Reference weight:

**Traditional Calibration - High Step**

Span Weight:

**FIG. 5-26 CALIBRATION SUB-MENU**

- Step 4. If the Traditional Calibration - Low Step Reference is any value other than 0.0000 go to Step 4 otherwise go to Step 10.
- Step 5. To clear the entry, move the cursor over the current Reference Weight which highlights the weight value.
- Step 6. Use your keyboard to type in the new 0.0000 (See Fig. 5-26)
- Step 7. Wait 12 seconds or more.
- Step 8. Click on the Do Cal Low button.
- Step 9. A page telling you that the Do Cal Low Calibration completed OK. (See Fig. 5-27)

**Cal completed OK**

[Back](#)

**FIG. 5-27 CAL LOW COMPLETED OK**

- Step 10. Click on “[Back](#)” to return to the Calibration page.
- Step 11. Place a certified test weight on the scale.
- Step 12. To enter the Span Weight click in the Span Weight field. (See Fig. 5-26)
- Step 13. To clear the entry, move the cursor over the current Span Weight which highlights the weight value.
- Step 14. Use you keyboard to type in the new value. In our example we entered 10.00. (See Fig. 5-26)
- Step 15. Wait 12 seconds or more.
- Step 16. Click on the Do Cal High button.
- Step 17. A page telling you that the Do Cal High Calibration completed OK. (See Fig. 5-28)

**Cal completed OK**

[Back](#)

**FIG. 5-28 CAL HIGH COMPLETED OK**

- Step 18. Click on “Home” to return to the Weight Controller Home page.
- Step 19. Traditional calibration is complete.



## CHAPTER 6: MAPPING

### About Mapping

Mapping is a simple process where you connect input (called a “Source”) to an output (called a “Destination”). The HI 3030 has four (4) output Relays and 5 Input Contacts. In addition you can map any of the parameters to the outputs and Inputs. The benefit of Mapping is that it requires no programming whatsoever. Simply select a Destination and a Source and your in business.

It is important to remember that the HI 3030 has four separate channels. You will have to set up your mapping for each channel. If you wanted all channels to Tare for example, you would have to select each channel and map Tare to an output relay.

### Mapping to an HI 3030 with a pre-2.3 Firmware Version

The HI 3030’s with versions of firmware prior to 2.3 have UDP packets that are sent out regularly which have data at fixed locations. Some of these words correspond to words contained in the 2.3+ version, Hardy Control-Link Table as shown below:

2.3 Word	Pre 2.3 Contents
0	setpoints & motion word
1&2	Net Wt 1, floating point
3&4	Net Wt 2, Floating Point
5&6	Net Wt 3, Floating Point
7&8	Net Wt 4, Floating Point
9	Packet Sequence Number

TABLE 6-1: HI 3030

Therefore a version 2.3+ HI 3030 can pick up Net Wt channel 2 from a pre-2.3 HI 3030 node, let’s say Node 2 from 2FI1. Net Weight 2 at 2FI3. Net Wt 3 at 2FI5, Net Weight 4 at 2FI7.

### Mapping to an Output Relay

In English we might say: “Connect the Setpoint Output to Relay Output #1.

- Relay Output #1 is the Destination.
- Setpoint Output is the Source.

In Assignment Statement form this mapping would look like this:

- Destination = Source or
- Output Relay #1 = Setpoint Output

Step 1. From the Filler/Dispenser Home Page click on Configuration. The Configuration Page appears. (See Figs. 6-1 and 6-2)

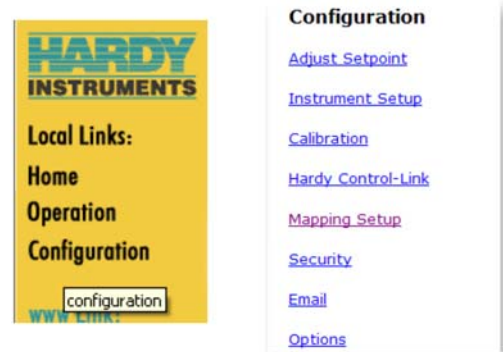


FIG. 6-1 SELECTING CONFIGURATION ON HOME PAGE

FIG. 6-2 SELECTING MAPPING SETUP

Step 2. Click Mapping Setup to display the Configuration Mapping Setup Page. The pull-down menus list all Destinations for the HI 3030. (See Fig. 6-3)

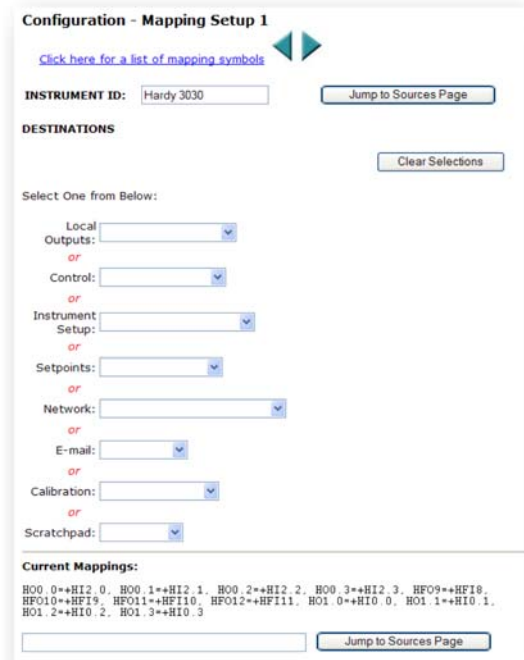


FIG. 6-3 CONFIGURATION MAPPING SETUP 1/ SELECTING A DESTINATION

Step 3. Let’s take a moment to take a look at this page.

- Local Outputs include the 4 Output Relays and a Software LED.

- Control includes parameters that control the instrument which includes the following which is only a partial list:
  1. Tare
  2. Zero
  3. C2<sup>®</sup> Calibrate
  4. Traditional Calibrate Low

*NOTE:* C2<sup>®</sup> is a registered trademark of Hardy Instruments Inc.

- Instrument Setup include parameters for setting up the instrument itself and includes the following which is only a partial list:
  1. WAVERSAVER<sup>®</sup>
  2. Grad Size
  3. Zero Tolerance
  4. Motion Tolerance

*NOTE:* WAVERSAVER<sup>®</sup> is a registered trademark of Hardy Instruments Inc.

- Setpoints includes setpoints for process control and includes the following which is only a partial list:
  1. Amount Required.
  2. Preact
  3. Dead Band
  4. Setpoint Weight Source
- Network includes the network outputs for Hardy Control Link, ControlNet, DeviceNet, Profibus etc. which is only a partial list.
  1. Hardy Control-Link Out
  2. Hardy Control-Link Int Out
  3. DeviceNet Text Out
  4. DeviceNet Int Out
- E-Mail includes E-Mail Outputs such as:
  1. Send E-Mail
  2. Custom Text
- Calibration includes calibration parameters:
  1. Do C2
  2. Span Weight
  3. Zero Weight
  4. Zero Counts

- Scratchpad which are empty registers you can do whatever you want with.


*NOTE:* The lists above do not include all the parameters. For a list of all the parameters and their addresses please see Appendix A.

- Step 4. Back to our example. We want to select Output Relay #1 as our destination. Click on the Local Outputs pull down menu. (See Fig. 6-4)
- Step 5. Click on Output Relay. After you click on Output Relay it is selected and a Number and a Select button appear to the right of the Local Outputs pull down menu. (See Fig. 6-4)
- Step 6. To select Output Relays from 1 - 4, double click in the text box and type in the Output Relay number you want. In our example we selected Output Relay #1. (See Fig. 6-4)



**FIG. 6-4 LOCAL OUTPUT/SELECTING OUTPUT RELAY #1**


- Step 7. Click on the Select button to the right of the Relay #1 text box. An address appears in the Current Mappings text box below. You will have to scroll down to see it. In our example we selected Output Relay #1 which has an address of: HO0.0. An equal “=” sign also appears.

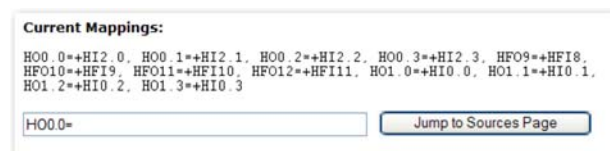

**FIG. 6-5 OUTPUT RELAY #1 ADDRESS HO0.0**

- Step 8. You have now selected the Destination.
- Step 9. Click on the Jump to Sources Page button to select the Source you want for this destination. (See Fig. 6-5) The Configuration, Mapping Setup 2 page appears. (See Fig. 6-6)



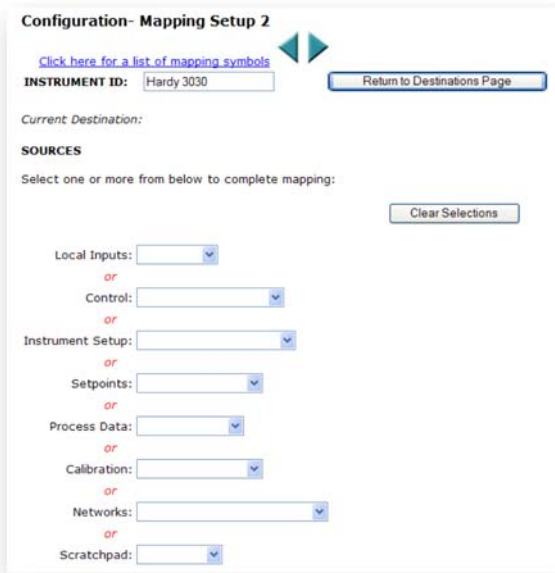

**FIG. 6-6 CONFIGURATION - MAPPING SETUP 2**

Step 10. Lets take a moment to look at this page.

- Local Inputs include the 5 input contact closures provided by the HI 3030.
- Control includes the following which is only a partial list:
  1. Setpoint Output
  2. Scale in Motion
  3. ADC Error
  4. Discharge
- Instrument Setup includes parameters for setting up the instrument itself and includes the following which is only a partial list:
  1. Zero Tolerance
  2. Decimal Point
  3. Setup Menu Security
  4. Firmware Revision
- Setpoints include the following which is only a partial list:
  1. Amount Required
  2. Preact
  3. Deadband
  4. Setpoint Weight Source
- Process Data includes all the process parameters and includes the following which is only a partial list:

1. Gross Weight
2. Net Weight
3. Peak Weight
4. Tare Weight

- Calibration includes calibration parameters:

1. Zero Weight
2. Span Weight
3. Calibration Type


- Network includes the network outputs and inputs for Hardy Control Link, Control-Net, DeviceNet, Profibus etc. which is only a partial list.

1. Hardy Control-Link Short Int In
2. Hardy Control-Link Int Out
3. DeviceNet Text Out
4. DeviceNet Int In

- Scratchpad which are empty registers you can do whatever you want with.

*NOTE: The lists above do not include all the parameters. For a list of all the parameters and their addresses please see Appendix A.*

Step 11. Back to our example. We want to select Setpoint Output which is a control parameter. Click on the Control pull down menu. (See Fig. 6-7)

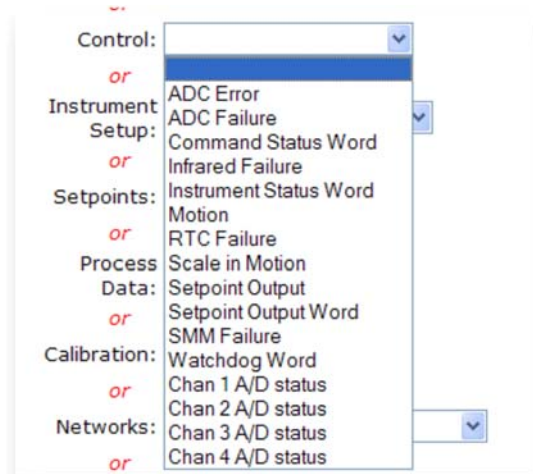

**FIG. 6-7 CONTROL PULL DOWN MENU/ SELECTING SETPOINT OUTPUT**

Step 12. Click on “Setpoint Output.” A Select button appears to the right of the Control pulldown menu. (See Fig. 6-8)

Step 13. Double Click in the Setpoints text field and type in the Setpoint number you want. The range is 1-12. In our example we selected Setpoint #1.




**FIG. 6-8 CONTROL PULL-DOWN MENU/ENTERING SETPOINT OUTPUT**

Step 14. Click on the Select button to select Setpoint Output #1 as the Source.

Step 15. The Assignment Statement is complete. You will now see in the Current Mappings text box:  
HO0.0=HI2.0

Step 16. Click on the Map button. You have now mapped Setpoint Output #1 to Output Relay #1. Notice that the new mapping is included in the list of current mappings. (See Fig. 6-9)

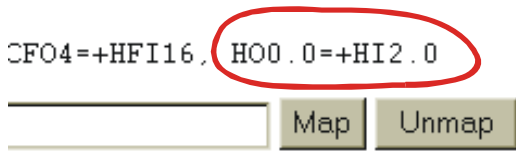


**FIG. 6-9 MAPPED SETPOINT OUTPUT #1 TO OUTPUT RELAY #1**

**Example #2 Mapping an Input**

There are 5 contact closure inputs designed into the HI 3030. You want to map Input Contact #4 to Tare. Our Assignment Statement is:

- Destination = Source
- Tare (HO1.0) = Input #4 (HI0.3)


Step 1. On the Configuration - Mapping Setup 1 Page click on the Control pull down menu. (See Fig. 6-10)

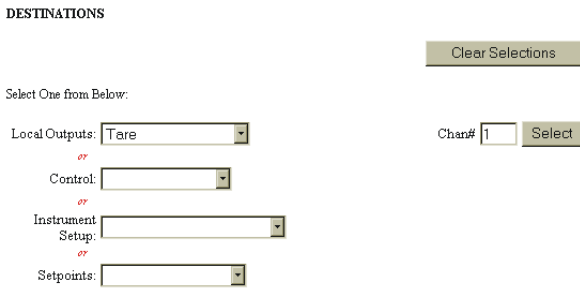

**FIG. 6-10 DESTINATION/TARE**

Step 2. Click on Tare. A Select button appears. (See Fig. 6-10)

Step 3. Click on the Select button. (See Fig. 6-10) The Destination address appears. (See Fig. 6-11)

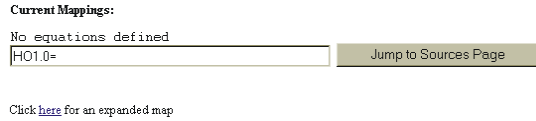

**FIG. 6-11 TARE (HO1.1) SELECTED AS A DESTINATION**

Step 4. Click on the “Jump to Sources Page” button. The Configuration - Mapping Setup 2 page appears. (See Fig. 6-12)



**FIG. 6-12 CONFIGURATION - MAPPING SETUP #2 PAGE/SELECTING LOCAL INPUT #4 AS THE SOURCE**

Step 5. Click on the Local Inputs pull down menu. Click on Local Inputs. An Input# text box appears with a Select button to the right. (See Fig. 6-12)

Step 6. Double Click in the Input# text box and type in the number 4.

Step 7. Click on the Select button.

Step 8. The Mapping Assignment Statement is complete. (See Fig. 6-13) Tare (HO1.0) = Input contact #4 (HI0.3)



**FIG. 6-13 COMPLETED ASSIGNMENT STATEMENT**

Step 9. Click on the Map button. The Input Contact #4 is now mapped to Tare. (See Fig. 6-14)



**FIG. 6-14 INPUT CONTACT #4 MAPPED TO TARE**  
Mapping Multiple Sources

Now that you know how to map a single source to a destination we can move onto multiple sources mapping. Lets say you want to energize or de-energize Output Relay #3 if you have two scales. Whenever Scale #1 finishes weighing you want to energize a visual signal such as a light indicating to the operator that Scale #1 is finished, remove the weight. The same for Scale #2. You want one Output Relay to energize or de-energize if either one of two conditions exist. Lets map the multiple sources to Output Relay #3.

Our Assignment Statement looks like this:

$$\text{Destination} = \text{Source 1} + \text{Source 2}$$

$$\text{Output Relay \#3} = \text{Scale \#1} + \text{Scale \#2}$$


In this Assignment Statement we use a boolean operator. “+” which in boolean Assignment Statements mean “or”. This means that if either of the scales is finished weighing, Relay #3 will be energized or de-energized, depending on what you want the relay to do. Here’s the process:

- Step 1. From the Configuration - Mapping Setup #1 page, click on the Local Output pull down menu and select Output Relay. (See Fig. 6-15)
- Step 2. In the Relay# text field type number 3.



**FIG. 6-15 MAPPING SETUP #1 PAGE/SELECTING OUTPUT RELAY #3**

- Step 3. Click on the Select button to select the Destination - Output Relay #3.

 


**FIG. 6-16 OUTPUT RELAY #3 (HO0.2) ENTERED IN THE ASSIGNMENT STATEMENT AS A DESTINATION**

- Step 4. Click on the “Jump to Sources Page” button. (See Fig. 6-16) The Mapping Setup #2 Page appears. (See Fig. 6-17)



**FIG. 6-17 ALARMS/SELECTING OVERFILL ALARM**

- Step 5. Click on the Setpoints pull down menu. Select Setpoints Wt Source. (See Fig. 6-17)
- Step 6. Double Click in the Setpoint# field and enter the number of the Setpoint Weight Source you want. The range is from 1 - 12. In our example we selected #1 for Scale #1.
- Step 7. Click on the Select button to the right of the Alarms pull down menu. (See Fig. 6-17) The Setpoint #1 address appears in the Assignment Statement to the right of the equals sign which means it is a Source. (See Fig. 6-18)

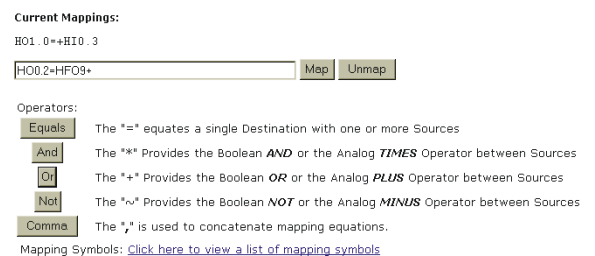

**FIG. 6-18 SETPOINT #1 (HFO.9) ENTERED IN THE MAPPING ASSIGNMENT STATEMENT**

- Step 8. To add another Source to the Assignment Statement and make it a Boolean “or” Statement, click on the “Or” button below the Assignment Statement. A “+” plus sign appears to the right of the Setpoint #1 Address. (See Fig. 6-18)
- Step 9. Click on the Setpoints pull down menu. (See Fig. 6-19)
- Step 10. Select Setpoint Wt Source #2.



**FIG. 6-19 SETPOINTS/SELECTING SETPOINT WT SOURCE #2**

Step 11. Click on the Select button to the right of the Setpoints# field to add the “Setpoint Wt Source #2” to the Assignment Statement. (See Fig. 6-20)



**FIG. 6-20 SETPOINT WT SOURCE #1 (HF010) ADDED AS THE SECOND SOURCE TO THE ASSIGNMENT STATEMENT**

Step 12. Click on the Map button to save the mapping. The multiple source map appears in the Current Mappings listing. (See Fig. 6-21)



**FIG. 6-21 MULTIPLE SOURCE MAP**

Step 13. You have now mapped multiple sources to a single destination.

**Simple Network Mapping**

**Mapping to a Network Output**


If you want to send data to a PLC from the HI 3030 you need to map the data to a network output. Here is the process:

Step 1. From the Configuration - Mapping Setup #1 page, click on the Network pull down menu and select DeviceNet Boolean Out. (See Fig. 6-22)



**FIG. 6-22 NETWORK/SELECTING DEVICENET BOOLEAN OUT**

- Step 2. Double click in the Word text box and type in the number 2.
- Step 3. Double click in the Bit text box and type in the number 3.
- Step 4. Click on the Select button to set the Destination. The “DeviceNet Boolean Out” address appears on the left side of the Assignment Statement. (See Fig. 6-23)

 

**FIG. 6-23 DEVICENET BOOLEAN OUT (DO2.3) SET AS DESTINATION**


*NOTE: The DeviceNet Boolean Out address DO2.3 means the following. DO = DeviceNet Out. 2.3 = Word 2, Bit 3.*

Step 5. Click on the “Jump to Sources Page” button. The Configuration - Mapping #2 page appears.




**FIG. 6-24 PROCESS DATA/SELECTING GROSS WEIGHT CHANNEL 1**

- Step 6. Click on the Process Data pull down menu. (See Fig. 6-24)
- Step 7. Click on Gross Wt. (See Fig. 6-24)
- Step 8. Click in the text field next Chan and enter the channel you want. In our example we selected Channel #1.
- Step 9. Click on the Select button to enter Gross Wt, Channel #1 as the source of the Assignment Statement.
- Step 10. The Gross Wt address appears on the right side of the Assignment Statement. (See Fig. 6-25)

 

**FIG. 6-25 ASSIGNMENT STATEMENT MAPPING GROSS WEIGHT, CHANNEL #1 (HF14) TO DEVICENET INT OUT (DO2.3)**

Step 11. The Gross Weight is now available to the PLC via the DeviceNet Scanner. (See Fig. 6-26)

 

**FIG. 6-26 SIMPLE NETWORK MAP/GROSS WEIGHT TO DEVICENET BOOLEAN OUT**

**Mapping a Network Input to a Local Output**

If you want a PLC to send instructions to an HI 3030 you will have to map the local Output to a network input. Here is the process:


*NOTE: Keep in mind that the network input on the HI 3030 will now be the source for the PLC output. This enables the PLC to send instructions to the network input on the HI 3030 and in turn to the HI 3030 output.*

Step 1. From the Configuration - Mapping Setup #1 page, click on the Local Outputs pull down menu and select Output Relay. (See Fig. 6-27)



**FIG. 6-27 LOCAL OUTPUT/SELECTING OUTPUT RELAY #2**

Step 2. Double click in the Relay# field and type the number 2.  
Step 3. Click on the Select button to select Output Relay #2 as the Destination for the left side of the Assignment Statement. (See Fig. 6-28)

 


**FIG. 6-28 OUTPUT RELAY #2 (H00.1) SET AS DESTINATION**

Step 4. Click on the “Jump to Sources Page” button. The Configuration - Mapping #2 page appears.  
Step 5. Click on the Networks pull down menu. (See Fig. 6-29)




**FIG. 6-29 NETWORK/SELECTING DEVICENET BOOLEAN IN**

Step 6. Click on “DeviceNet Boolean In” to select it as the Source for the Assignment Statement. (See Fig. 6-29)  
Step 7. Click in the Word text box and type in the number “2”.  
Step 8. Click in the Bit text box and type in the number “2”  
Step 9. Click on the Select button to save the source.

 

**FIG. 6-30 ASSIGNMENT STATEMENT MAPPING DEVICENET INT IN (DIO2) TO OUTPUT RELAY #2 (H00.1)**

Step 10. Now whatever is sent to Devicenet Boolean In from the Network will be sent to Output Relay #2.

 

**FIG. 6-31 DEVICENET BOOLEAN IN CONNECTED TO OUTPUT RELAY #2 OUT**

## More Advanced Mapping

This section is for those who have some or a lot of experience Addressing I/O (mapping) or for those who want more information as to how the mapping works locally and on the network. We go into much more detail as to how the mapping works and include instructions for Boolean, Analog, Mixed and Special Command mapping procedures.

Mapping is similar to Addressing I/O's in a PLC except there are no predefined mappings in the HI 3000 Series Instruments and you are not mapping the physical location of an I/O module terminal to a bit location in the processor, you are actually mapping values or states in memory to another memory location. This difference is important to understand and will be explained later in this chapter. In order to understand Mapping we first need to define some of the terms and understand the structure of an Assignment Statement.

In short mapping is nothing more than assigning data from an address (Source) to another address (Destination) to be used by the controller in ways that meet your process requirements. Since the HI 3030 does not have any predefined Addressed I/O you are free to Address I/O in any fashion that meets your needs.

### Glossary of Mapping Terms

**Assignment Statement** - The assignment statement is an order to the computer to change the value stored in the variable (Memory Address) on the left-hand side of the assignment operator (i.e. the = sign). For example:  $i = a + b$ , means get the value stored in "a" and add it to the value stored in "b" and store the sum value at memory address "i". The left hand side of the operator sign (=) is the address where you want the values on the right hand side of the operator sign (=) to be stored.

**Destination** - This is the destination memory address to which data will be moved. Left Hand Side

**I/O Interface** - The section of the instrument that communicates with the "outside world".

**Input Contact** - Inputs interface selector switches, push buttons, limit switches and other sensors to the HI 3030. Each input has an address associated with it which describes the physical location that the input device is connected to.

**Input Image Table** - A data table containing addressed memory where the states of the input devices and parameter values are stored. The state of each input device is transferred to the input image table from the input point during the I/O scan.

**Local Mapping** - This is mapping within an HI 3030 Filler/Dispenser module, primarily mapping internal memory loca-

tions of parameter values or device states to locations in the local Input Image Table or Output Image Table.

**Network Mapping** - This is mapping between the master and slave devices in the case of a DeviceNet, ControlNet, RIO or Profibus network. Hardy Control Link network mapping is mapping between nodes on the network.

*NOTE: It is important to understand that you cannot perform mapping functions on one HI 3000 Series Instrument from another HI 3000 Series instrument. You must map the memory locations in each instrument separately. More will be said about this later.*

**Node Number** - This is the physical address of a device in a network.

**Output Relay** - Outputs interface indicators, motor starters, solenoids, and other actuators from the HI 3030. Each output has an address associated with it. The address describes the physical location that the output device is connected to.

**Output Image Table** - The data table containing addressed memory where the desired state of the output devices and parameter values are stored. The desired state or parameter value of each output is transferred from the output image file to the output point during the I/O scan.

**Source** - This is the memory address of the data you want to move to the destination. Right Hand Side


### Rules for Hardy Control Link Mapping

Some rules for Hardy Link Basic Mapping:

- Input Contacts (5 total) can only be a Source.
- Output Relays can be a Source and a Destination.

## Local Input

Inputs interface with selector switches, push buttons, limit switches and other sensors connected to the HI 3030. When the firmware is initiated it assigns the physical input contact to a memory address (Remember Inputs can only be a Source when mapping. (See Source definition in the Glossary of Mapping Terms)

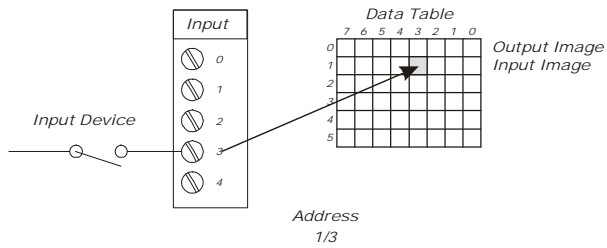


**FIG. 6-32 INPUT FUNCTION**

- Each input has an address associated with it.
- The address describes the physical location that the input device is connected to.
- The address also describes the Input Image Table location where the STATE of the input device is stored.
- The state of each input is transferred to the Input Image File from the input point during the I/O scan every 1/55th of a second. (See Fig. 6-1)
- When you are mapping an Input to some other Destination you are assigning the value in the Input Image Table (for that Input) to an Address in the Output Image Table.
- For example: **OK TO FILL = Contact closure input #5** means assign the state (Open (0) or Closed (1)) of Contact #5, contained in the Contact Closure input #5 memory address, in the Input Image Table and move it to the OK TO FILL address in the Output Image Table. (See Fig. #6-1)

### Local Output

Outputs interface with indicators, motor starters, solenoids, and other actuators connected to the HI 3030. Remember Outputs can be a Destination and a Source. (See Destination definition in the Glossary of Mapping Terms)

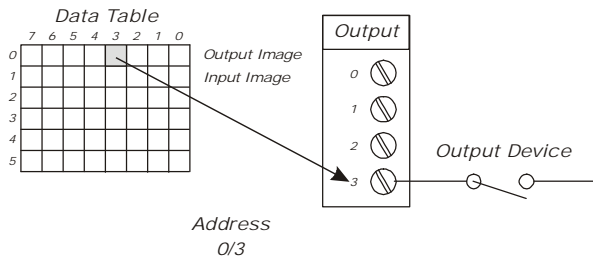

**FIG. 6-33 OUTPUT FUNCTION**

- Each output has an address associated with it.

- This address describes the physical location that the output device is connected to.
- This address also describes the data table location where the desired state of the output device is stored.
- The desired state of each output is transferred from the output image table to the output point during the I/O Scan every 1/55th of a second. (See Fig. 6-2)
- For Example: **Relay out #3 = FAST FILL** means assign the desired state (Open (0) or Closed (1)) located at the Fast Fill Address in the input image table and move it to the Relay out #3 address in the Output Image Table. (See Fig. 6-33)

### Volatile and Non-Volatile Memory

It is important to understand that the data stored in the Output and Input Image Tables is stored in volatile memory. This means, when you power off you lose the data. The Addressing I/O (Mapping) is saved in non-volatile memory and is not lost when you power off.

### A Definition of Mapping

Mapping (Addressing I/O) is the same as using an Assignment Statement. The Destination is located on the left hand side of the equals (=) sign and is a memory address (variable). The Source is the data located on the right hand side of the equals (=) sign at a memory address. So when you refer to the right hand side of the Assignment Statement you are referring to the data only and not the address even though the address is listed.

- Memory Address (Variable) = Data (Values, states)

The equals (=) sign assigns the data on the right side of the Assignment Statement to the Memory Address on the left side of the Assignment Statement.

This is exactly what you are doing when you map a source to a destination.

The things that can be mapped are organized into Input Image Tables and Output Image Tables, which are arrays of variables (i.e. memory locations of a certain size based on the type assigned to the variable) with addresses where data is stored.

A table is called an “output” image table if the items in the table are permitted to be on the left hand side of an Assignment Statement. The Output variables are also further identified by the first two letters of the variable:

- HO - Hardy Output Image Table
- DO - DeviceNet Output Image Table

- RO - RIO Output Image Table
- CO - ControlNet Output Image Table or Profibus Output Image Table.

**NOTE:** You won't use ControlNet and Profibus at the same time so they can both use the same tables.

If the items in the table are only permitted on the right hand side of an Assignment Statement, we call it an "input" image table:

- HI - Hardy Input Image Table
- DI - DeviceNet Input Image Table
- RI - RIO Input Image Table
- CI - ControlNet Input Image Table or Profibus Output Image Table.

For example, the digital inputs on the Filler/Dispenser are found in an input image table, as are the items in the DeviceNet input image table.

The HI 3030 scans through the I/O image tables 55 times a second and reads any values that are contained in the tables. If there is nothing stored in the tables the controller does nothing with it. If there are state values or other values stored in the tables, the firmware processes the data and outputs it to an output device or the screen.

### Local Mapping Example

#### Local Mapping Output

You hardwired a Valve Actuator to Output Relay #1. When the Filling process gets an OK to Fill the Filler changes the Fast Fill value (which is stored in the Input Image Table) from 0 to 1 which means, close the output relay to begin a fast fill. You need to map the Fast Fill to Output Relay #1.

The Destination is Output Relay #1 a State value that is located in the Output Image Table at Address HO0.0.


The source is the Fast Fill value that is stored in the Fast Fill memory address (HI2.1) in the Input Image Table. Do not confuse the value with the address.

So now you have a Destination Address to which you can assign the Source value.

My Assignment Statement is:

**HO0.0 = HI2.1**

**Output Relay = Fast Fill**

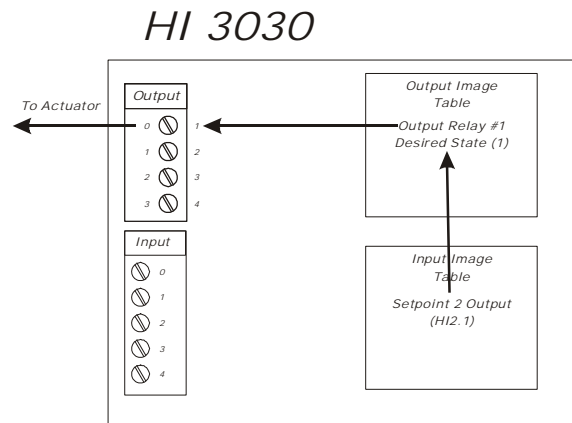

**HO0.0 = HI2.1**

### Local Mapping - HI 3030

**FIG. 6-34 MAPPING SETPOINT 2 OUTPUT TO OUTPUT RELAY #1**

As the instrument scans the Input Image Table it sees the new state value (close = 1) for Setpoint 2 Output which was set by the instrument's firmware. It takes the new state value (1) and sends it to the Output Relay #1 address on the Output Image Table and sets the desired state for the relay to 1 which simultaneously closes the relay that opens the actuator for a valve to begin a Setpoint 2 Output.

### Network Input

PLC's also have Input Image Tables and Output Image Tables. The HI 3030 is a node in a total network and you assign the HI 3030 Filler/Dispenser a node address so the Network scanner can identify the instrument.

**WARNING: YOU CANNOT ASSIGN THE SAME ADDRESS TO TWO DIFFERENT NODES. THE PLC CANNOT DETERMINE WHICH NODE IT IS COMMUNICATING WITH. THIS CAN RESULT IN PROPERTY DAMAGE OR PERSONAL INJURY.**

The Network scanner, scans each node's Output Image Table to read the values that are located there. If there are values in the nodes' Output Image Table it reads the values to the PLC's Input Image Table which makes the data available to the PLC for processing.

Here again you can assign the data in the node's output image table to an address in the PLC input image Table. So if you want the net weight to be displayed in the PLC's output (screen) you have already assigned the Net Weight value located in the Input Image Table to the Output Image Table. The PLC Scanner reads the Net Weight value in the nodes' Output Image Table and moves the value to a word location




in the Input Image Table on the PLC. The Input Image Table Net Weight value is then output let's say to the PLC screen.

Table and writes the values to another nodes' Input Image Table. Once the value is in the node's Input Image Table it becomes a source and can be mapped to any destination in the HI 3030. (See Fig. 6-35)


### Network Output

When the Network Scanner writes values to the nodes it does this by taking the data located in the PLC Output Image

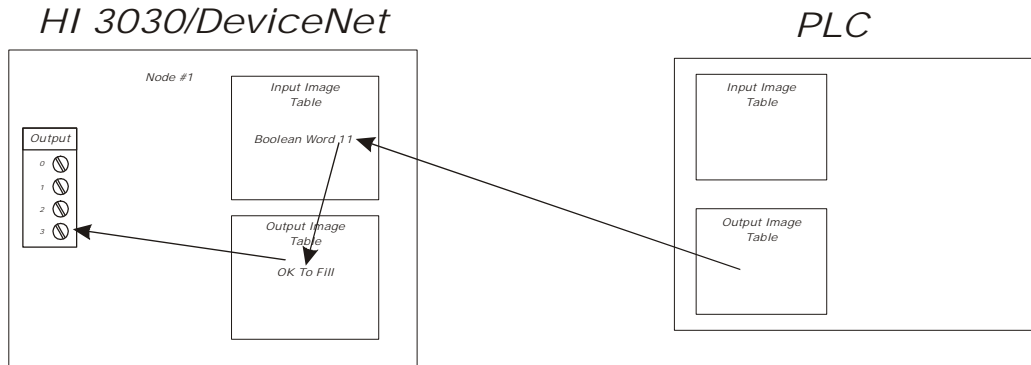

*Mapping to OK to Fill on HI 3030*

**FIG. 6-35 DEVICENET OUTPUT**

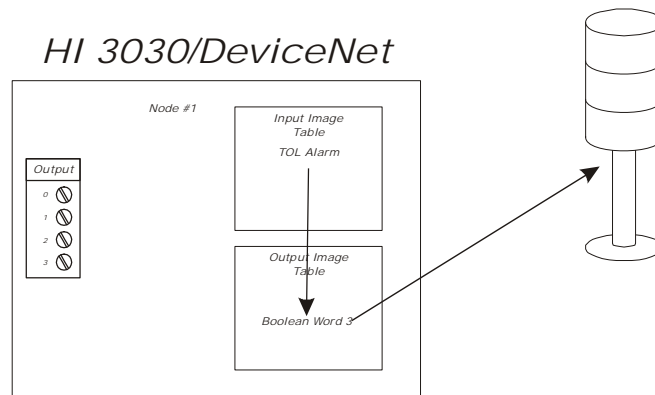

*Mapping to the DeviceNet Light Bar*

**FIG. 6-36 DEVICENET OUTPUT**

### Hardy Control Link Network Mapping

If an HI 3030 Node #1 does not have any Output Relays available, you can select another node's Output Relay. HI 3030, Node #2 has an output relay available. This requires that you first map Node #1 and Node #2 separately so that the input contact in Node #1 can be mapped directly to the Output Relay in Node #2. (See Fig. 6-37)


Control-Link. For complete instructions to setup communications between instruments go to the HI 3000 Installation and Operation manual, Hardy Control-Link Ethernet Network, Setting Node Addresses for HI 3000 Series Instruments from the Browser.

Step 11. You need to set up communication between Node #1 and Node #2. You can do this by going to the HI 3030 Web Page, select Configuration, select Hardy

Step 12. At node #2 you need to map the Output Relay #3 state value, in the Output Image Table to the Hardy Boolean In address in the Input Image Table. (See Fig. 6-6 Green Arrows)

Step 13. At node #1 you need map Input Contact #1 in the Input Image Table to Hardy Boolean Out in the Output Image Table. (See Fig. 6-37 Red Arrows)  
 Step 14. Now that you have set up the local mapping for Node #1 and Node #2 and Node #1 is communicat-

ing with Node #2 you can map the Input Contact at Node #1 directly to the Output Relay at Node #2. (See Fig. 6-37 Black Arrow)

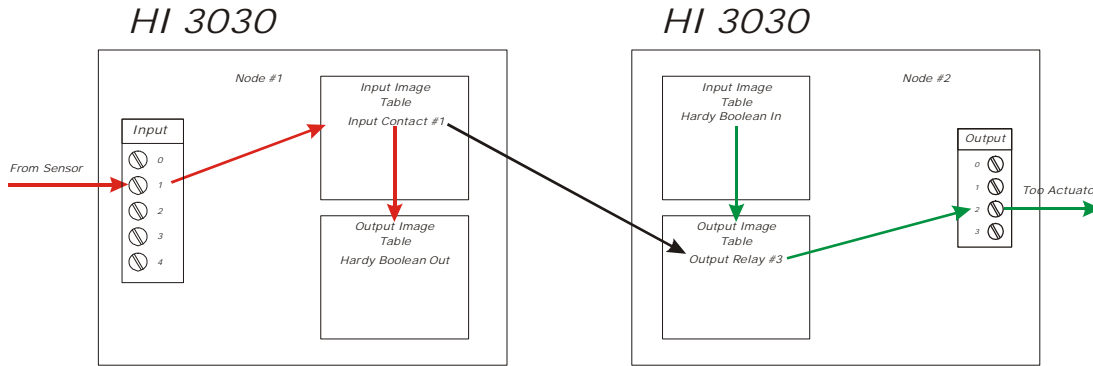

Mapping an Input to an Output Relay on Another HI 3030

FIG. 6-37 HARDY CONTROL LINK NETWORK MAPPING

**Boolean Mapping**

A Boolean variable is a variable that can have the value 0 (FALSE) or 1 (TRUE). In the HI 3030 Filler/Dispenser there are 3 boolean operations supported:

- AND - The symbol for “AND” in a Boolean Assignment Statement is “\*”.
- OR - The symbol for “OR” in a Boolean Assignment Statement is “+”.
- NOT - the symbol for “NOT” in a Boolean Assignment Statement is “~”.

The Boolean image tables are arrays of short (2 byte) integers. An individual Boolean variable in the image table is located by its word offset and its bit offset. Boolean image tables are given 2 letter names as follows:

- DI is the DeviceNet input image table.
- DO is the DeviceNet output image table.
- HI is the Hardy input image table.
- HO is the Hardy output image table.
- RI is RIO input image table.
- RO is RIO output image table.

The RIO input and output images tables are mapped to physical external devices using RSLogix. DeviceNet and ControlNet input and output image tables are mapped to physical external devices using Rockwell Software’s RS NetWorx. The Hardy input and output image tables have pre-defined meanings for certain bits within the tables.

*NOTE: Make sure you use RS NetWorx for DeviceNet and RS NetWorx for ControlNet. They are two different applications.*

A Boolean variable is addressed with the syntax below:

[tablename][word offset].[bit offset]

Example:

DIO.3 is bit #3 in the DeviceNet input table, word #0.

**Analog Mapping**

An analog variable is one that can have many different values. The HI 3030 Weight Controller supports float, 16 bit integer, and 32 bit integer analog variable types. There are three (3) analog operations supported. The symbols are the same as the Boolean operations, but with different meanings.

- Multiply - The symbol for “Multiply” is “\*”.
- Add - The symbol for “Add” is “+”.
- Negate - the symbol for “Negate” is “~”.

Analog tables are given 3 letter names as follows:

DFI, DFO, DSI, DSO, DII, DIO all refer to DeviceNet tables, where the item is a float, a short integer, or a 32 bit integer depending on the first letter in the table name. HFI is a table of Hardy defined floating point numbers.

An analog variable is address with the syntax below:

[tablename][offset]

Example:

- DFO2=HFIO
- Explanation - DeviceNet Float Output Word 2 = Gross Weight

The offset is an offset in words in the case of the DeviceNet tables. The offsets in Hardy tables have various predefined meanings.

- HFIO - is Gross Weight
- HFI1 - is Net Weight
- . . . other offsets to be determined.

When an analog equation is evaluated, all terms get converted to float. The final result is then converted to the type of the LHS (Left Hand Side).

### Mixed Mapping

It is permissible to have analog variables appear in Boolean equations and to have Boolean variables in analog equations. (We call a mixed equation “Boolean” if its LHS is a Boolean term, and “Analog” if its LHS is an analog term) The interpretation is the following:

A Boolean variable in an analog equation is converted to 1.0 or 0.0.

An Analog variable in a Boolean equation is TRUE if it is greater than zero (0) and FALSE if it is less than or equal zero (0).

Example:

- DO1.0=HF10
- Explanation - DeviceNet Output Word 1, Bit 0 = Gross Weight

### Special (Command) Mapping

Command Interface consists of:

- 16 bit words
- Word 0 Command #
- Word 1 Parameter ID
- Words 2&3 Data.

The commands defined are the following:

WRITEINTEGER, command number 0x1000  
The WRITEINTEGER command is used to set the value of integer valued parameters.  
Command data:  
2 bytes: PARAMETER NUMBER: the number (PARAMID) of the parameter to write.

4 bytes: PARAMETER VALUE: what to set the parameter to.

Data returned by the HI 3030: 8 bytes, echoing the WRITEINTEGER command.

WRITEFLOAT, command number 0x1001  
The WRITEFLOAT command is used to set the value of float valued parameters.

Command data:  
2 bytes: PARAMETER NUMBER: the number (PARAMID) of the parameter to write.  
4 bytes: PARAMETER VALUE: what to set the parameter to.

Data returned by the HI 3030: 8 bytes, echoing the WRITEFLOAT command.

WRITESTRING, command number 0x1002  
The WRITESTRING command can be used to set the value of any parameter.

Command data:  
2 bytes: PARAMETER NUMBER: the number (PARAMID) of the parameter to write.  
Variable number of bytes: a zero terminated ASCII string, giving the value to set the parameter to.

Data returned by the HI 3030: 8 bytes, echoing the first 8 bytes of the WRITESTRING command.

READINTEGER 0x2000  
READFLOAT 0x2001  
These commands are used to read the value of integer or float parameters.

Command data:  
2 bytes: PARAMETER NUMBER: the number (PARAMID) of the parameter to read.

Data returned by the HI 3030: 8 bytes. The first 4 bytes echo the command, and the next 4 contain the value of the parameter.

Setting up the command interface in mapping:

Use an equation of the form  
 $CMD0 = (in\_table) * (out\_table)$   
In\_table is an input table, defining where the command is written.  
Out\_table defines where the reply data is written.

Example:

$$CMD0 = DSIO * DOO0$$

This equation says the command will be written to the DeviceNet input table, at word offset 0, and the reply data is written to the DeviceNet output table, at word offset zero.

It is legal to omit the Out\_table.

Example:

**CMD0=DSI3**

This equation says that the command will be written to the DeviceNet input table, at word offset 3, but no reply data will be written.

Command (CMD) Interface can be used different tables, or multiple locations in one table. Example:

**CMD0=DSI0\*DSO0+RSI0\*RSO0+RSI8\*RSO8**

Which says a command can show up in DeviceNet input table word 0; Return in DeviceNet Out Table Word 0 or RIO input table word 0; Return in RIO out table word 0 or RIO input table word 8; return RIO out table word 8.

Input and output do not need to start at the same word:

Example: **CMO0=DSI0\*DSO4**

Command in DeviceNet input word 0; return DeviceNet out word 4

**Command Interface**

**Parameter Numbers, Code Explanations, Valid Ranges and Default Settings**

**CAUTION: THESE VALUES AND EXPLANATIONS CAN CHANGE. ALWAYS CHECK ON THE HARDY WEB SITE FOR THE NEWEST COMMAND INTERFACE LIST BEFORE USING THE COMMAND INTERFACE.**

*NOTE: Data is handled based on the method used writing data to the unit. If data is written using the Command Interface (See Below) the data is interpreted based on the displayed units. However, if data is directly mapped into the unit, the unit assumes lbs (pounds) and converts the entered data to the displayed units.*

*NOTE: The default parameter values are marked by DEF and bold type.*

Parameter Number (Hexadecimal)	Code Explanation	Valid Range
0001	Operator ID	Max. 3 characters
0002	Instrument ID	Max. 19 characters
0004 = Chan 1 0404 = Chan 2 0804 = Chan 3 0C04 = Chan 4	WAVERSAVER®	0 = None 1 = 7.50 Hz 2 = 3.50 Hz <b>3 = 1.0 Hz (Def)</b> 4 = .50 Hz 5 = .25 Hz
0005 = Chan 1 0405 = Chan 2 0805 = Chan 3 0C05 = Chan 4	Number of Averages	1-250 <b>DEF = 10</b>
0006 = Chan 1 0406 = Chan 2 0806 = Chan 3 0C06 = Chan 4	Zero Tolerance	0.000001-999999 <b>DEF = 10</b>
0007 = Chan 1 0407 = Chan 2 0807 = Chan 3 0C07 = Chan 4	Units of Measure	0 = lb, 1 = Kg, 2 = g 3 = oz <b>DEF = 0</b>
0008 = Chan 1 0408 = Chan 2 0808 = Chan 3 0C08 = Chan 4	Decimal Point	0-5 <b>DEF = 2</b>
000A = Chan 1 040A = Chan 2 080A = Chan 3 0C0A = Chan 4	Grad Size	<b>0=1 (DEF)</b> , 1=2, 2=5, 3=10, 4=20, 5=50, 6=100, 7=200, 8=500, 9=1000
000D = Chan 1 040D = Chan 2 080D = Chan 3 0C0D = Chan 4	Motion Tolerance	0.000001-999999 <b>DEF=10.00</b>
000E = Chan 1 040E = Chan 2 080E = Chan 3 0C0E = Chan 4	Auto-Zero Tolerance	0.000001-999999 <b>DEF=10.00</b>
000F = Chan 1 040F = Chan 2 080F = Chan 3 0C0F = Chan 4	Capacity	0.000001-999999 <b>DEF=999999.0</b>
0010	Infrared Enable	<b>1 = ON (DEF)</b> , 0 = OFF
002A	Printer Baud Rate	0 = 300 1 = 1200 2 = 2400 3 = 4800 <b>4 = 9600 (DEF)</b> 5 = 19200

**TABLE 6-2: PARAMETER NUMBER, CODE EXPLANATION, VALID RANGES AND DEFAULTS**

Parameter Number (Hexadecimal)	Code Explanation	Valid Range
002B	Printer Parity	<b>0 = None (DEF)</b> 1 = Odd 2 = Even
002C	Printer Data Bits	0 = 7 bits <b>1 = 8 bits (DEF)</b>
002D	Setpoint Menu Security (Write Only)	<b>0 (DEF)</b>
002E	Setup Menu Security (Write Only)	<b>0 (DEF)</b>
002F	Calibration Menu Security	<b>0 (DEF)</b>
0030	Options Menu Security	<b>0 (DEF)</b>
0031	Mapping Menu Security	<b>0 (DEF)</b>
0033	Local Clear Security	<b>0 (DEF)</b>
0034	Medium Level Password	<b>0 (DEF)</b>
0035	High Level Password	<b>0 (DEF)</b>
0036	DeviceNet Baud Rate	<b>0 = 125kbps (DEF)</b> 1 = 250kbps 2 = 500kbps
0037	DeviceNet Node Address	0-63 <b>DEF=0</b>
003F	RIO Baud Rate	<b>0 = 57kbps (DEF)</b> 1 = 115kbps 2 = 230kbps
0040	RIO Rack Address	0-59 <b>DEF=2</b>
0041	RIO Rack Size	<b>0 = 1/4 (DEF)</b> 1 = 1/2 2 = 3/4 3 = 4/4
0042	RIO Quarter #	<b>0 = 1st (DEF)</b> 1 = 2nd 2 = 3rd 3 = 4th
0043	RIO Last Quarter	1 = YES <b>0 = NO (DEF)</b>
0044	ControlNet Address	1-99 <b>DEF=1</b>
0045	Main Active	1=ON 0=OFF
0046	Mail Server	<b>“mailserver” (DEF)</b>

**TABLE 6-2: PARAMETER NUMBER, CODE EXPLANATION, VALID RANGES AND DEFAULTS**

Parameter Number (Hexadecimal)	Code Explanation	Valid Range
0047	Mail User ID	<b>“user” (DEF)</b>
0048	Mail From Address	<b>“HI3000” (DEF)</b>
0049	Mail To Address	{ {“”, 0}, {“”, 0}, {“”, 0} } <b>(DEF)</b>
004B	Mail To Config	
004C	Channel Name	Max. 19 characters <b>DEF=Channel 1</b>
044C	Channel Name	Max. 19 characters <b>DEF=Channel 2</b>
084C	Channel Name	Max. 19 characters <b>DEF=Channel 3</b>
0C4C	Channel Name	Max. 19 characters <b>DEF=Channel 4</b>
0105 (Write Only)	Parameter Instance	
0200 = Chan 1	Reference Weight Cal LO or C2	0.000001-999999 <b>DEF=0</b>
0600 = Chan 2	Reference Weight Cal LO or C2	0.000001-999999 <b>DEF=0</b>
0A00 = Chan 3	Reference Weight Cal LO or C2	0.000001-999999 <b>DEF=0</b>
0E00 = Chan 4	Reference Weight Cal LO or C2	0.000001-999999 <b>DEF=0</b>
0201 = Chan 1	Span Weight	0.000001-999999 <b>DEF=1000.0000</b>
02F0 (Write Only)	Parameter Map	
02F2	Mapped Float	
0601 = Chan 2	Span Weight	0.000001-999999 <b>DEF=1000.0000</b>
0A01 = Chan 3	Span Weight	0.000001-999999 <b>DEF=1000.0000</b>
0E01 = Chan 4	Span Weight	0.000001-999999 <b>DEF=1000.0000</b>
0204 = Chan 1 (Read Only)	Cal Type	<b>Not Cal’d (DEF)</b> 1 = C2 0 = Traditional Hard Calibration

**TABLE 6-2: PARAMETER NUMBER, CODE EXPLANATION, VALID RANGES AND DEFAULTS**

Parameter Number (Hexadecimal)	Code Explanation	Valid Range
0604 = Chan 2 (Read Only)	Cal Type	<b>Not Cal'd (DEF)</b> 1 = C2 0 = Traditional Hard Calibration
0A04 = Chan 3 (Read Only)	Cal Type	<b>Not Cal'd (DEF)</b> 1 = C2 0 = Traditional Hard Calibration
0E04 = Chan 4 (Read Only)	Cal Type	<b>Not Cal'd (DEF)</b> 1 = C2 0 = Traditional Hard Calibration
0280 (Read Only)	Serial Number	53
0281 (Read Only)	Model Number	<b>HI 3030 (DEF)</b>
0282 (Read Only)	Program Part Number	0650-0xxx-01
0283 (Read Only)	Firmware Revision	X.X.XX
0320 = Setpt 1 0720 = Setpt 2 0B20 = Setpt 3 0F20 = Setpt 4 1320 = Setpt 5 1720 = Setpt 6 1B20 = Setpt 7 1F20 = Setpt 8 2320 = Setpt 9 2720 = Setpt 10 2B20 = Setpt 11 2F20 = Setpt 12	Setpoint Amount Req'd	.000001 - 999999 Positive or Negative values <b>DEF=0.000000</b>
0321 = Setpt 1 0721 = Setpt 2 0B21 = Setpt 3 0F21 = Setpt 4 1321 = Setpt 5 1721 = Setpt 6 1B21 = Setpt 7 1F21 = Setpt 8 2321 = Setpt 9 2721 = Setpt 10 2B21 = Setpt 11 2F21 = Setpt 12	Preact	.000001 - 999999 Positive or Negative values <b>DEF=1.000000</b>


**TABLE 6-2: PARAMETER NUMBER, CODE EXPLANATION, VALID RANGES AND DEFAULTS**

Parameter Number (Hexadecimal)	Code Explanation	Valid Range
0322 = Setpt 1 0722 = Setpt 2 0B22 = Setpt 3 0F22 = Setpt 4 1322 = Setpt 5 1722 = Setpt 6 1B22 = Setpt 7 1F22 = Setpt 8 2322 = Setpt 9 2722 = Setpt 10 2B22 = Setpt 11 2F22 = Setpt 12	Deadband	.000001 - 999999 Positive or Negative values <b>DEF=1.000000</b>

**TABLE 6-2: PARAMETER NUMBER, CODE EXPLANATION, VALID RANGES AND DEFAULTS**

**Getting the Parameter Information on the Web Browser**

Step 1. From the Weight Controller Home Page, click Operation to display tThe Operation Page (See Fig. 6-38).

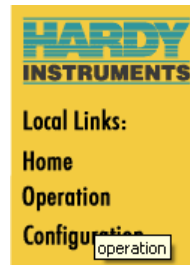

**Operation - Choose One**


- [Diagnostics](#)
- [Monitor](#)

**FIG. 6-38 WEIGHT CONTROLLER HOME PAGE/ SELECTING OPERATION**

**FIG. 6-39 OPERATION PAGE / SELECTING DIAGNOSTICS**


Step 2. Click on Diagnostics. (See Fig. 6-38) The Diagnostics Page appears. (See Fig. 6-39)

Step 3. Click on Parameters to display a complete list of the Parameters with settings. (See Fig. 6-40)

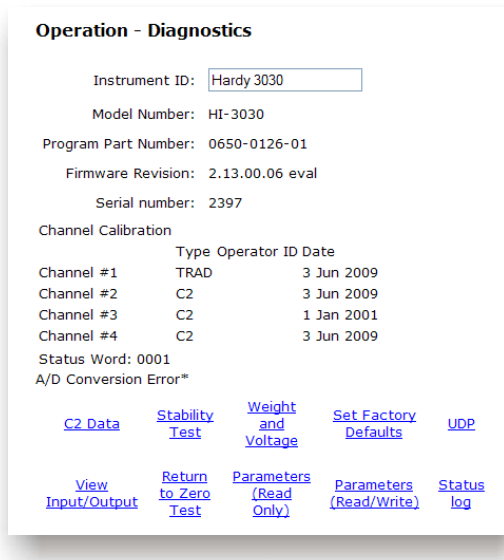

**FIG. 6-40 DIAGNOSTICS PAGE/SELECTING PARAMETERS**

**Operation - Diagnostics  
Parameter Dump**

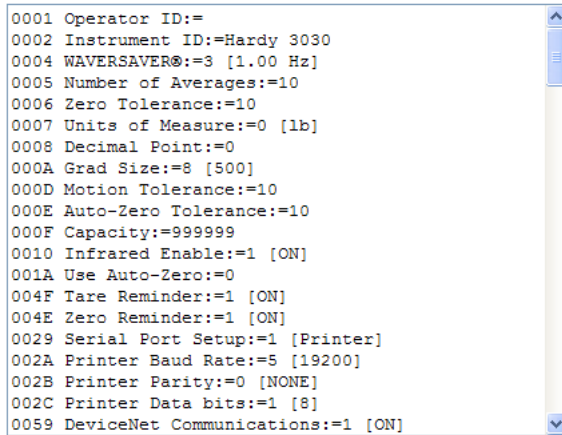


**FIG. 6-41 LIST OF PARAMETER SETTINGS**

Step 4. To print a hard copy, click on the printer icon in your browser or highlight all the parameters and cut and paste to your word processor, then print and save the list.

**Mapping from the Front Panel**


*NOTE: Mapping from the Front Panel is for the instrument only. To do network mapping you will need to go to the Mapping Setup page on the HI 3030 web site.*

- Step 1. Press the Setup/3/DEF button once. The Configuration Menu appears with the cursor in front of “ADJUST SETPOINTS” (Default).
- Step 2. Press the down or up arrow buttons to move the cursor in front of I/O Mapping. (See Fig. 6-41)

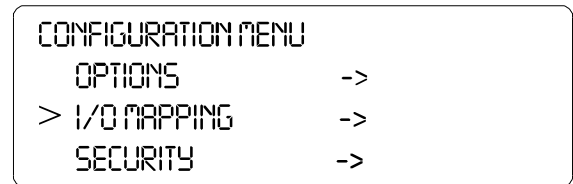


**FIG. 6-42 CONFIGURATION MENU/I/O MAPPING**

- Step 3. Press the Enter button. The Basic I/O Mapping Menu appears. (See Fig. 6-43) The List you see is a list of Destinations. You need to map the Source to the Destination (Tare Scale 2)
- Step 4. Press the down arrow button until the cursor is in front of “Tare Scale 2” appears. (See Fig. 6-42)
- Step 5. Press the Enter button to map the Source.

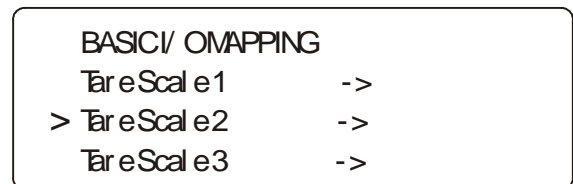


**FIG. 6-43 BASIC I/O MAPPING/TARE SCALE 2**

Step 6. You see that the “Tare Scale 2” is Not Mapped. (See Fig. 6-43)

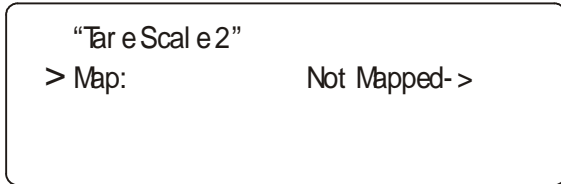


**FIG. 6-44 TARE SCALE 2/NOT MAPPED**

Step 7. Press the Enter button. (See Fig. 6-44) The ITEM SELECTION Menu appears. (See Fig. 6-44)

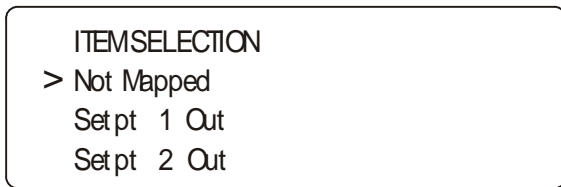


**FIG. 6-45 ITEM SELECTION MENU**

- Step 8. Press the down arrow button to move the cursor in front of the Item you want to map to Tare Scale 2. In our example we want to map Input 1 to Tare Scale 2.
- Step 9. Press the up or down arrow buttons to select the Input you want to map to. In our example we want to map Input 1 to Tare Scale 2. We move the cursor in front of Input 1. (See Fig. 6-45)
- Step 10. Press the Enter button to set the entry.
- Step 11. Press the Exit button to return to the Tare Scale 2 menu. You see Input 1 has replaced Not Mapped. (See Fig. 6-46)

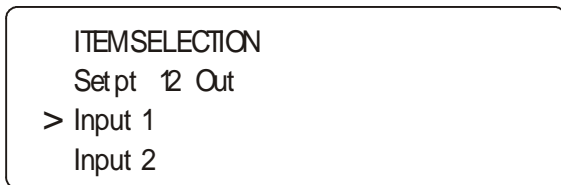


**FIG. 6-46 ITEM SELECTION/INPUT 1**

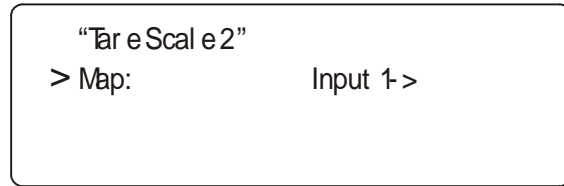

**FIG. 6-47 TARE SCALE 2/SOURCE MAPPED**

- Step 12. Press Exit to get back to the Basic I/O Mapping Menu. Notice that an asterisk has been added to the right arrow indicating that Tare Scale 2 is mapped to something. (See Fig. 6-47)
- Step 13. To Map other items repeat steps 1-13 for those items you want to map.

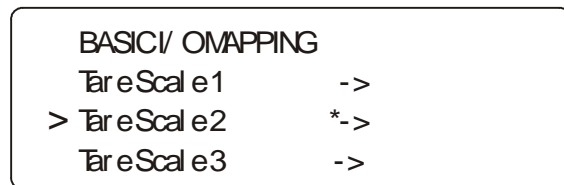


**FIG. 6-48 TARE SCALE 2 MAP INDICATION**

Step 14. To check what Items are mapped to which Input or What Outputs are mapped to which Item, just go to the Basic I/O Mapping Menu, select the Destination you want to see and press Enter. The mapped data is readily available.




**Unmapping Procedures**

- Step 1. To Unmap Items go to the Basic I/O Mapping Menu.
- Step 2. Press the up or down arrow buttons until the cursor is in front of the Item you want to unmap. In our example we used Tare Scale 2.
- Step 3. Press the Enter button. The Item “Tare Scale 2” Menu appears. (See fig. 6-48)
- Step 4. Press the down arrow until the cursor is in front of Item.
- Step 5. Press the Enter button.

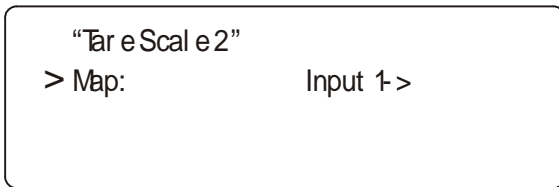


**FIG. 6-49 TARE SCALE 2/INPUT 1**

- Step 6. Press the up or down arrow buttons until the cursor is in front of Not Mapped. (See Fig. 6-49)

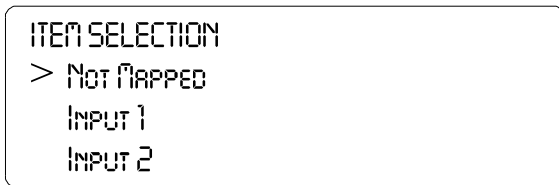


**FIG. 6-50 ITEM SELECTION/SELECTING NOT MAPPED**

- Step 7. Press the enter button to set the entry.
- Step 8. Press the Exit button to return to the Tare Scale 2 Menu. (See Fig. 6-50)

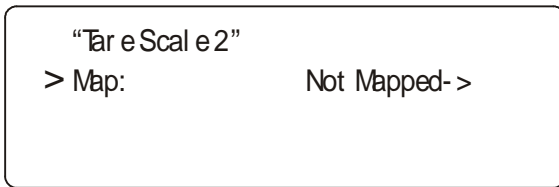


**FIG. 6-51 OK TO FILL MENU/ITEM UNMAPPED**

- Step 9. Press on the Exit button to return to the Basic I/O Mapping Menu appears. (See fig. 6-51) Notice that the asterisk no longer appears. This tells you that the item is unmapped. To unmap more items, repeat steps 1-8

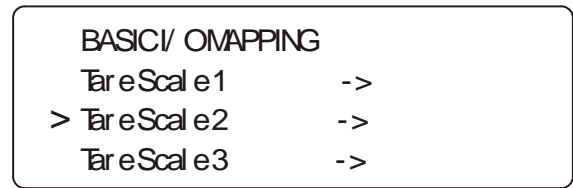

**FIG. 6-52 BASIC I/O MAPPING/TARE SCALE 2 UNMAPPED**

**Mapping a Hardy Control-Link Network to a ControlNet/DeviceNet/Profibus Network**

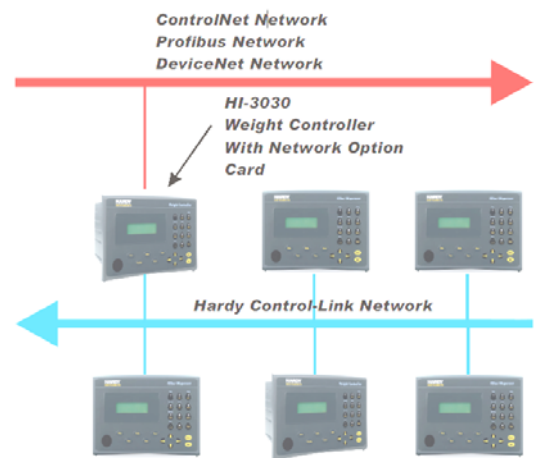

**FIG. 6-53 HARDY CONTROL-LINK NETWORK CONNECTED TO A CONTROLNET/DEVICENET/PROFIBUS NETWORK**

The Hardy HI 3000 Series of controllers are designed to save you money. To connect a Hardy Control-Link Network to a ControlNet/DeviceNet/Profibus Network simply purchase one of the Hardy HI 3000 Series Network Interface Option Cards and install it in the instrument that you want to directly connect to the other network. You can map to this instrument from all the other instruments on the Hardy Control-Link Network, rather than buy a separate network card for each instrument. (See Fig. 6-53)

- Step 1. Determine into which Instrument you want to install the Network option card.
- Step 2. Install the network card. See the HI 3000 Installation and Operation manual, Cabling and Installation Section.
- Step 3. Connect the network cables from the designated HI 3000 Series Instrument and begin mapping to that instrument from either the Hardy Control-Link Network or the ControlNet/DeviceNet/Profibus Network.

**IT Test**

Use the information below to run an IT test on a system with an IT JBOX, using the command interface.

A parameter number for the IT test is made of 4 parts:

- The most significant 2 bits are the SENSOR number (IT JBOX sensor number)
- The next 2 bits are the INSTANCE number, listed below
- The next 2 bits are the CHANNEL, 0-3 on a 4-channel instrument
- The next 10 bits are 0x390

IT\_GROSS\_INSTANCE 0

IT\_MILLIVOLT\_INSTANCE 1

IT\_MILIVOLT\_PER\_VOLT\_INSTANCE 2

IT\_ADC\_COUNTS\_INSTANCE 3

The bit layout of the 16 bit parameter ID:

b15 sn1	b14 sn0	b13 in1	b12 in0	b11 ch1	b10 ch0	b09 1	b08 1
b07 1	b06 0	b05 0	b04 1	b03 0	b02 0	b01 0	b00 0

**TABLE 6-3:**

To start the IT test, write anything (it doesn't matter what) to any parameter number associated with the A/D channel you want to test.

1st channel parameter = 0x0390

2nd channel parameter = 0x0790

3rd channel parameter = 0x0B90

4th channel parameter = 0x0F90

When the test is complete, a number is sent for each of the four sensor positions in the IT JBOX. They are:

- gross weight (float)
- millivolts (float)
- millivolts per volt (float)
- A/D counts (4 byte integer)

Example: To read the millivolts per volt of the second sensor on the 4th channel of a four-channel unit, use the parameter

- mv/v instance 2
- sensor # 1 (the first sensor number is 0, 2nd is 1)
- channel # 3
- lowest 10 bits 0x390

## CHAPTER 7: TROUBLESHOOTING

### About Chapter 7

Chapter 7 consists of all the procedures for troubleshooting the electrical, mechanical and firmware elements of the HI 3030 Weight Controller in the event of a malfunction.

Included in Chapter 7 is a comprehensive flow chart to provide a road map for troubleshooting an entire Weight Controller system, including load cells and cabling.

### Disassembly and Reassembly Notes and Cautions

- Always disconnect the power cord before disassembling.

**WARNING: FAILURE TO DISCONNECT THE POWER CORD BEFORE DISASSEMBLING MAY CAUSE PERSONAL INJURY AND/OR PROPERTY DAMAGE.**

- Make sure that any disassembly is done in a clean, well ventilated, properly controlled static environment.
- Always make sure that the assemblies and sub-assemblies are well supported and insulated when doing any repairs on the Weight Controller.
- Place small fasteners, connectors and electrical parts in closed containers so as not to lose parts during reassembly.
- Read all the disassembly instructions before any disassembly begins. Be sure that you are familiar with the procedures. If any of the instructions for disassembly are unclear, contact Hardy Instruments, Technical Support Department for additional information and assistance.
- Do not disconnect any electrical plug, connector or terminal unless an identification tag is present or one is attached. Always note where the connector or plug was attached to the electrical component or wiring harness.
- Always install complete hardware groups (Screws, Washers, Lock Washers, Spacers, Etc.) back to the original point of removal.
- Always replace broken or damaged modules or hardware immediately!
- Always check to be sure that no loose parts are sitting on printed circuit boards or electrical connectors or wires when disassembling or reassembling.
- Always protect printed circuit boards from electrostatic discharge (ESD). Always use approved ESD wrist straps and anti-static pads.

- Always perform a final inspection after completing any reassembly to be sure that all fasteners are tight, all connectors are secure and there are no loose parts on any of the printed circuit boards in the Weight Controller.
- Always follow proper safety procedures when working on or around the Weight Controller.

### Error Messages

!A/D Failure Error! - Internal Electronics Error, Retry.

!A/D Convert Error! - Load Cells input out of range.

!Motion Error! - Check Settings and Retry

!Trad Cal Error! - Error occurred during calibration, re-calibrate.

!C2 Cal Error! - Error occurred during calibration, re-calibrate.

!Too Lo Error! - Verify that the load cell signal level is 0-15 mV. Verify that there is enough weight on the scale. Perform Span than go back and Zero.

!Too Hi Error! - Verify that the load cell signal level is 0-15mV. Verify that there is enough weight on the scale. Perform Span than go back and Zero.

!No C2 Sensor! - Instrument did not detect a C2 Load Sensor

!CAL Failed! - Too few counts between Zero and Span.

!C2 Caps Unequal! - Different load cell capacities (For example 50 lbs capacity load cell and 100 lbs capacity load cell on one system. Make the load cells even be removing the uneven load cell and replacing it with a load cell that is equal to the others capacity.


!HI/LO Too Close! - Zero and Span are not more than 1,000 counts from each other or there is no change or negative change. Reset either so the counts are more than 1,000 counts of each other.

!Function Error! - Pressed a function button and the Function did not work. Try again. Cycle power.


!Not Allowed! - Value entered is outside the range allowed. Try another value.

!Security Violation! - User signed in with a password that does not allow performance of a certain function or entry to certain menus. Security level of the user identified in the User ID, too low for the menu or function.

## General Troubleshooting Flow Chart Index

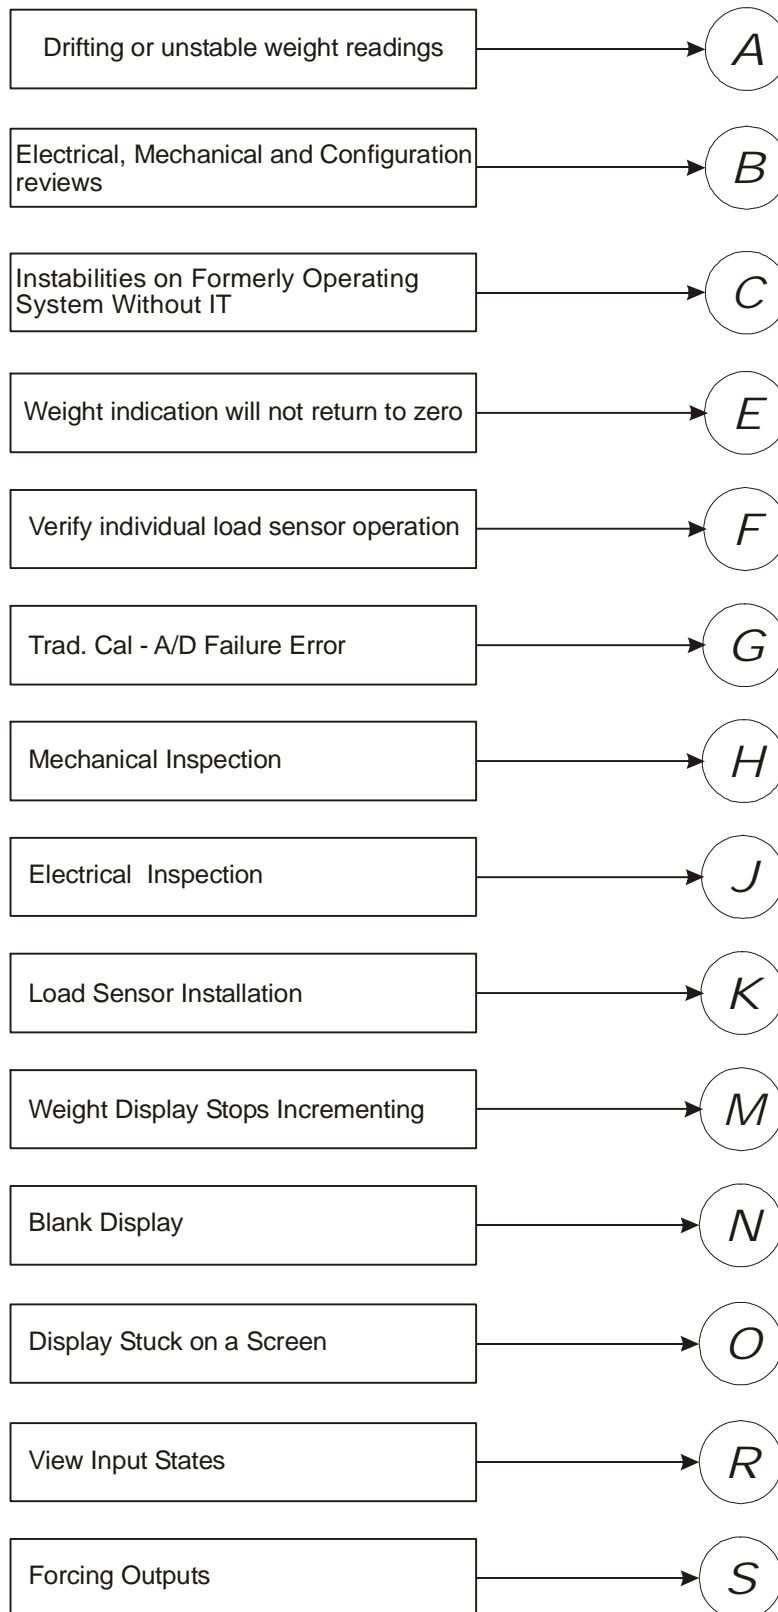


### A - Stability Test

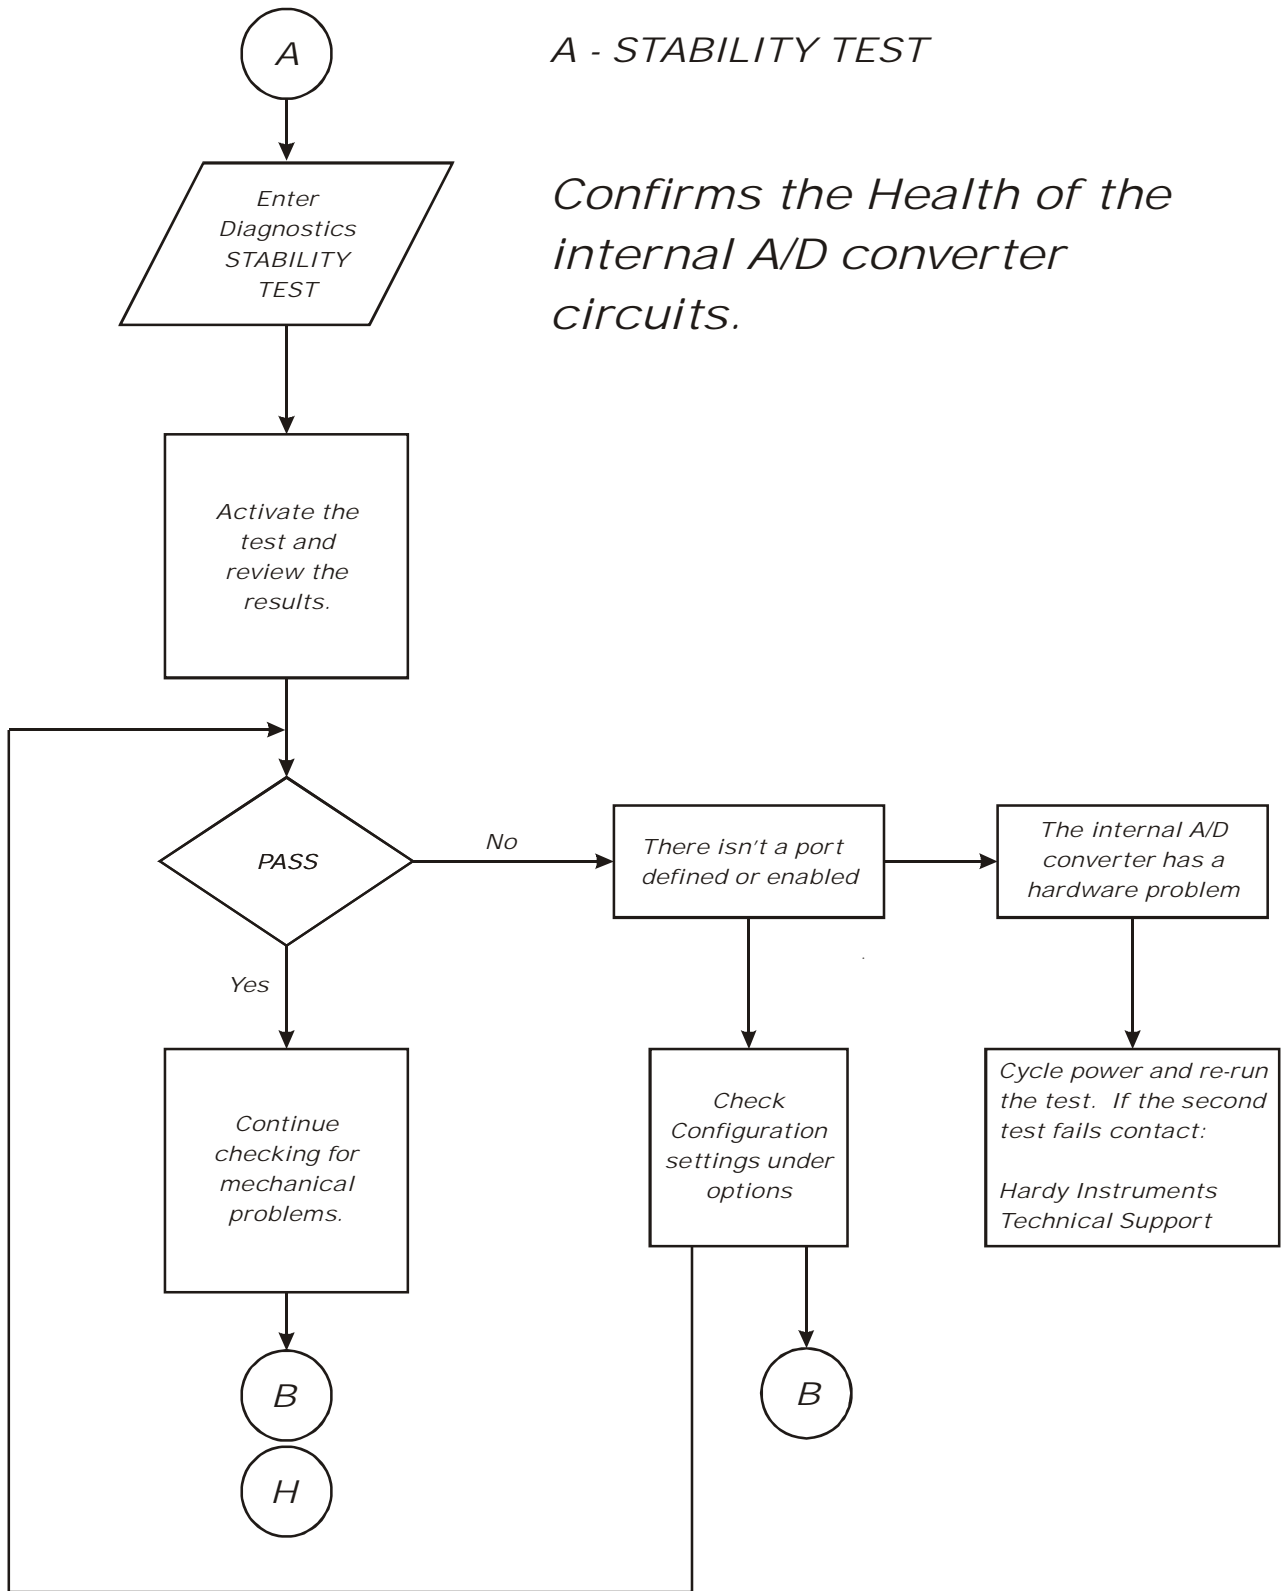


### A - STABILITY TEST

*Confirms the Health of the internal A/D converter circuits.*


**B - Guidelines for Instabilities on Formerly Operating Systems**

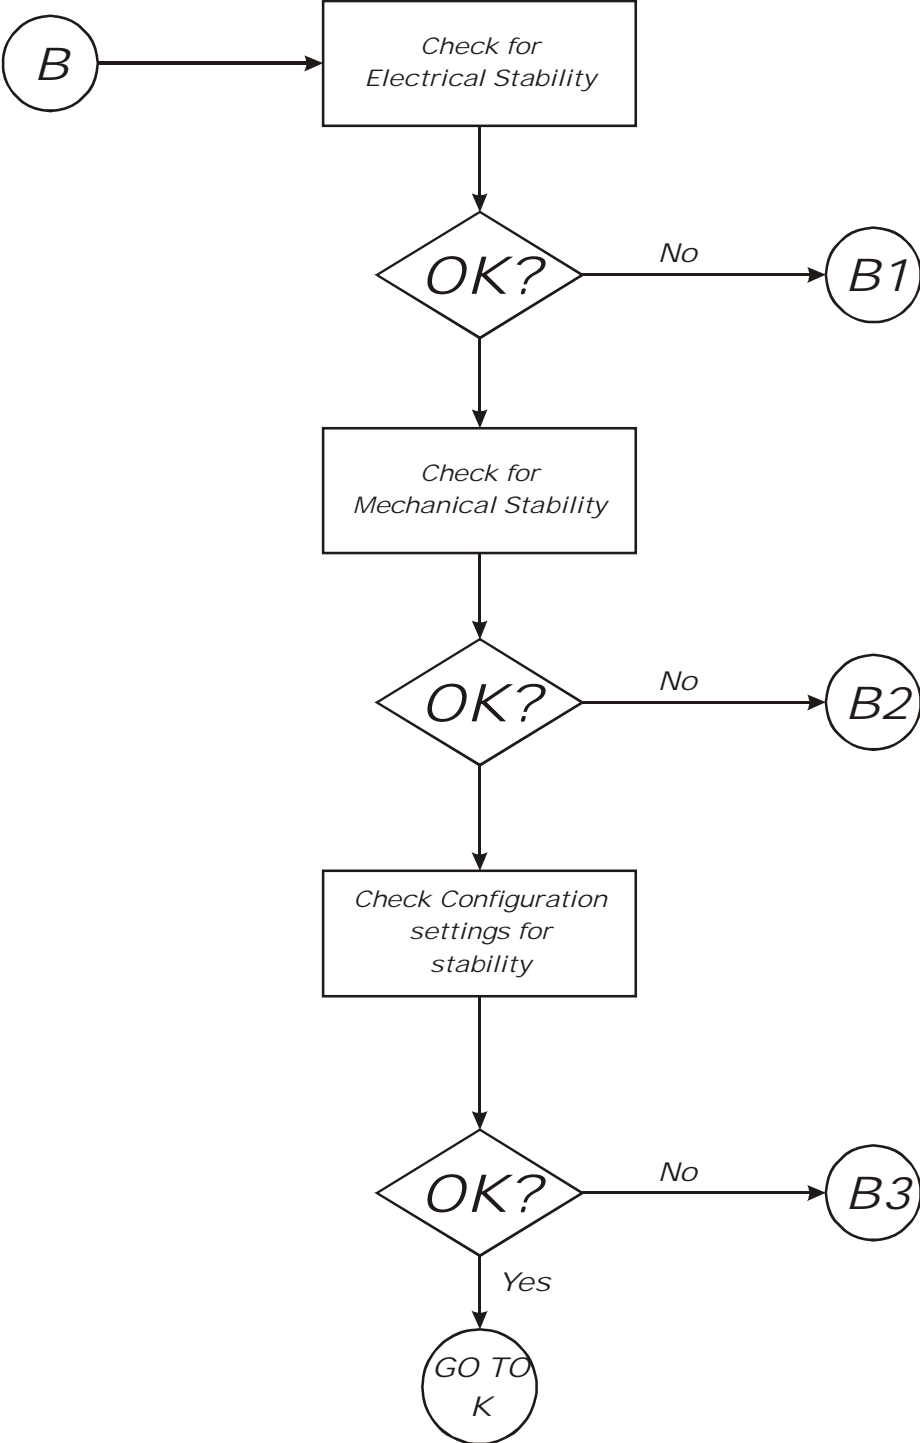

### B1 - Guidelines for Instabilities on Formerly Operating Systems (Cont'd)

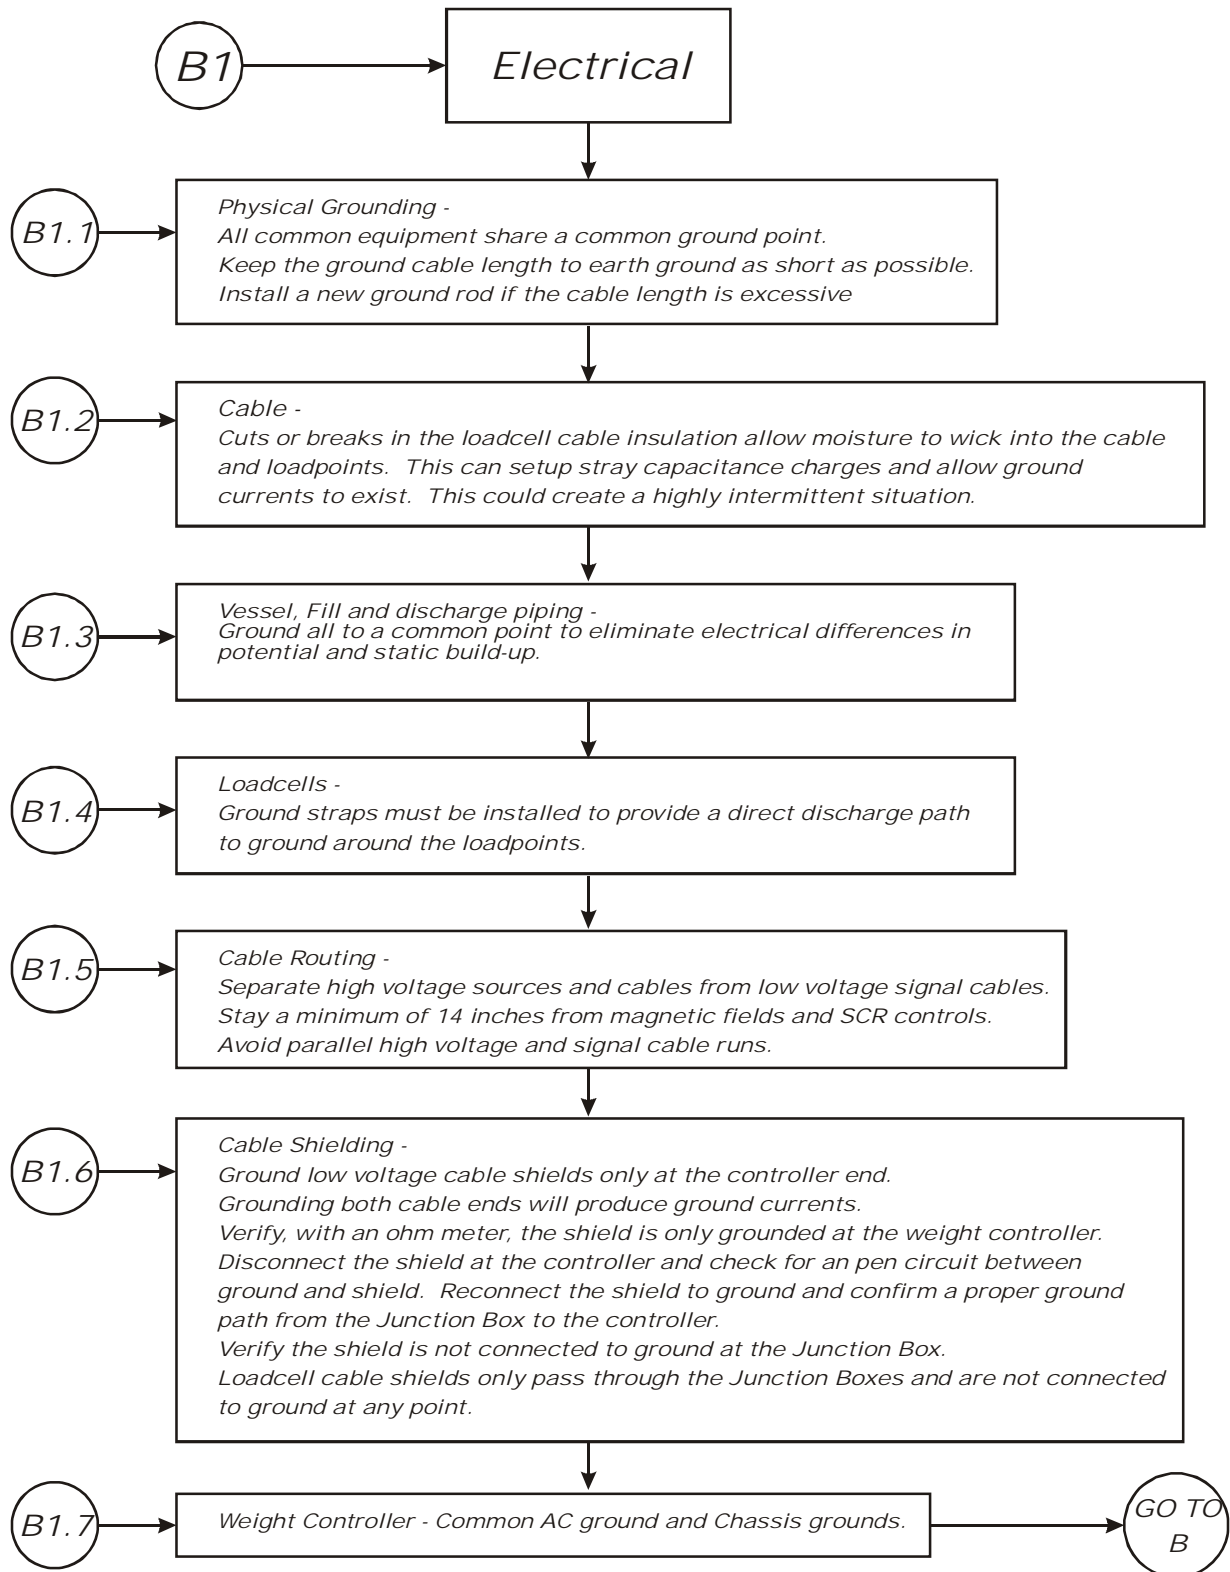


**B2 - Guidelines for Instabilities on Formerly Operating Systems: Mechanical Stability and Configuration Settings**

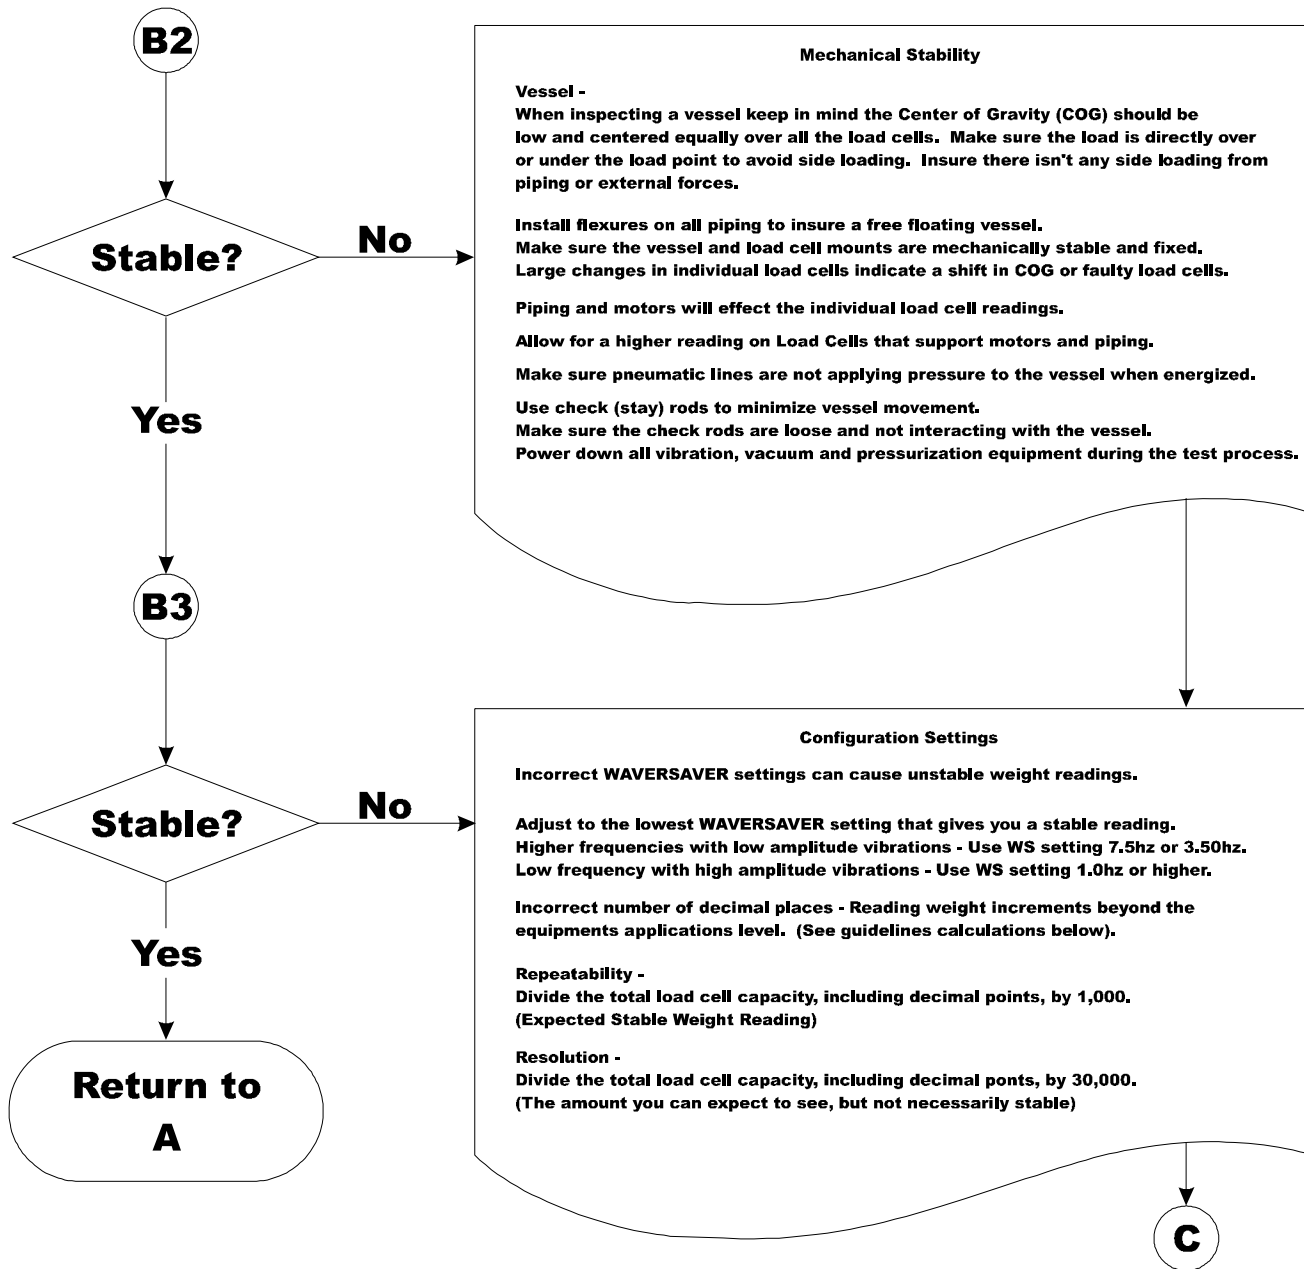





**C - Guidelines for Instabilities on Formerly Operating Systems**

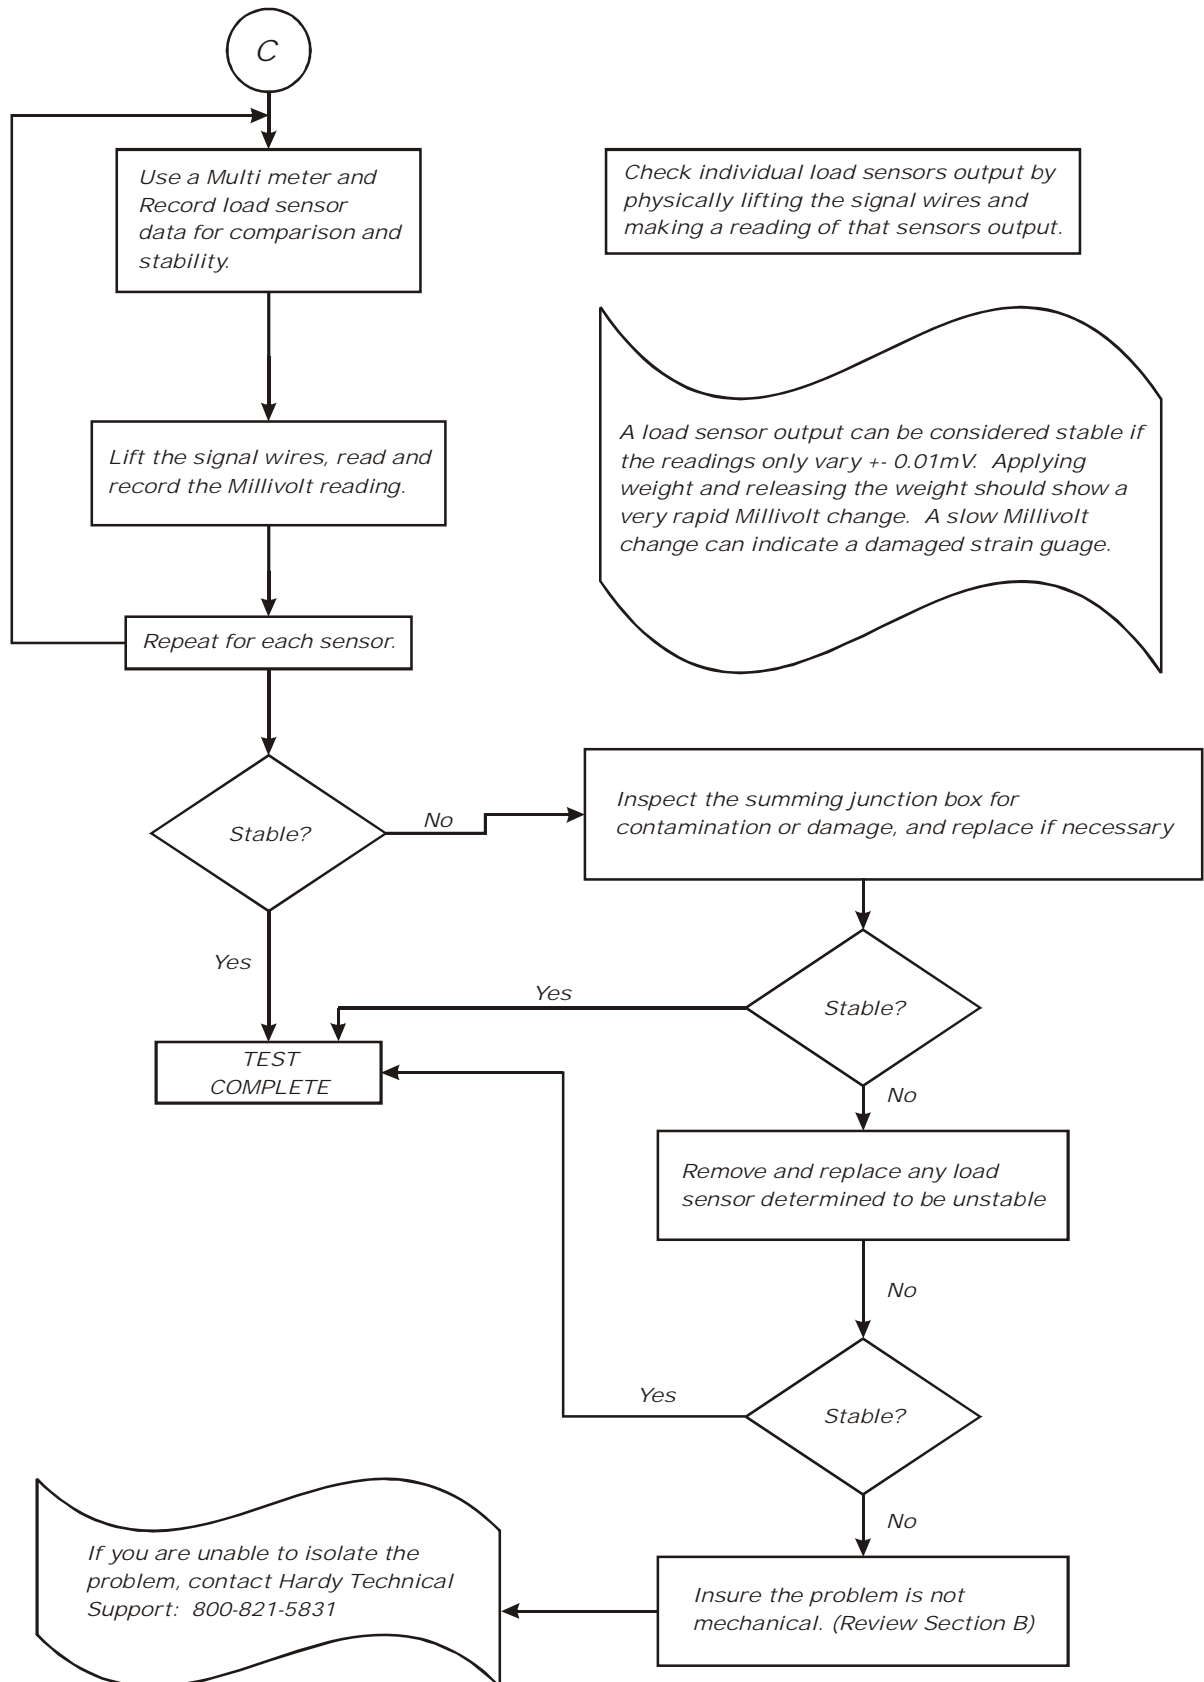

**C1 - Guidelines for Instabilities on formerly Operating systems with the Integrated Technician Summing Junction Box diagnostics**

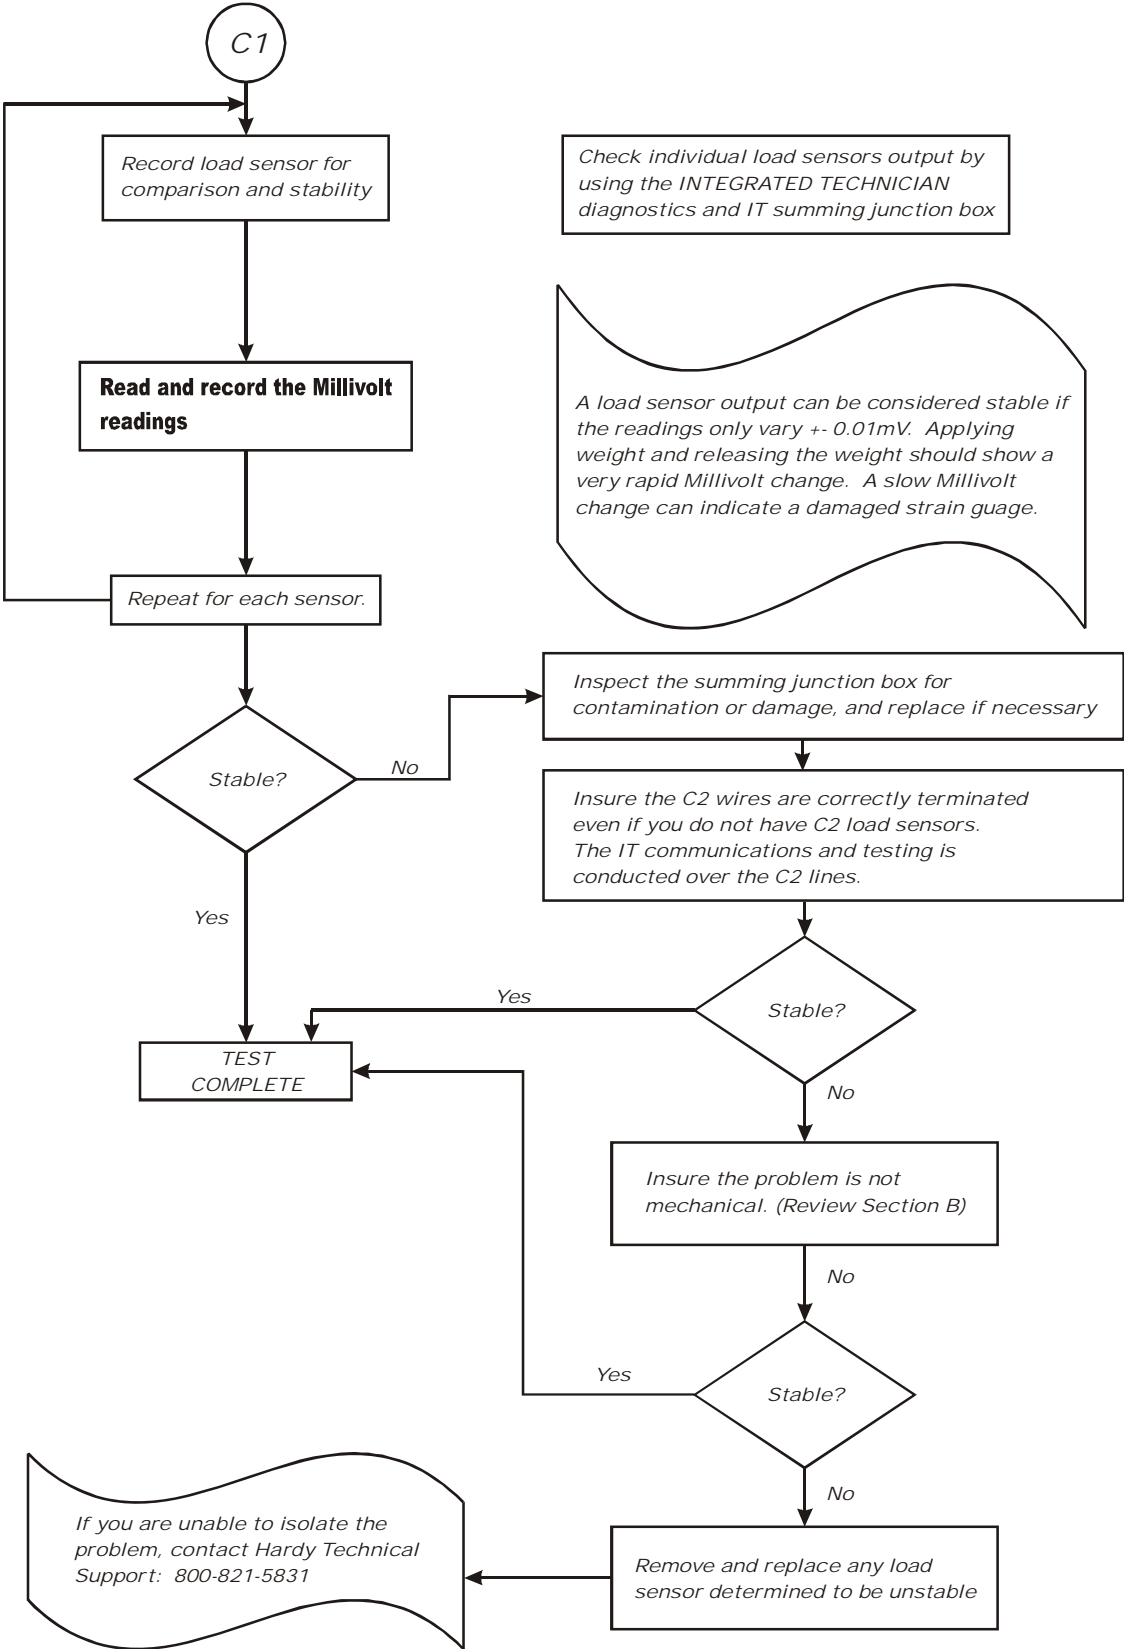


**E - Return to Zero Test**

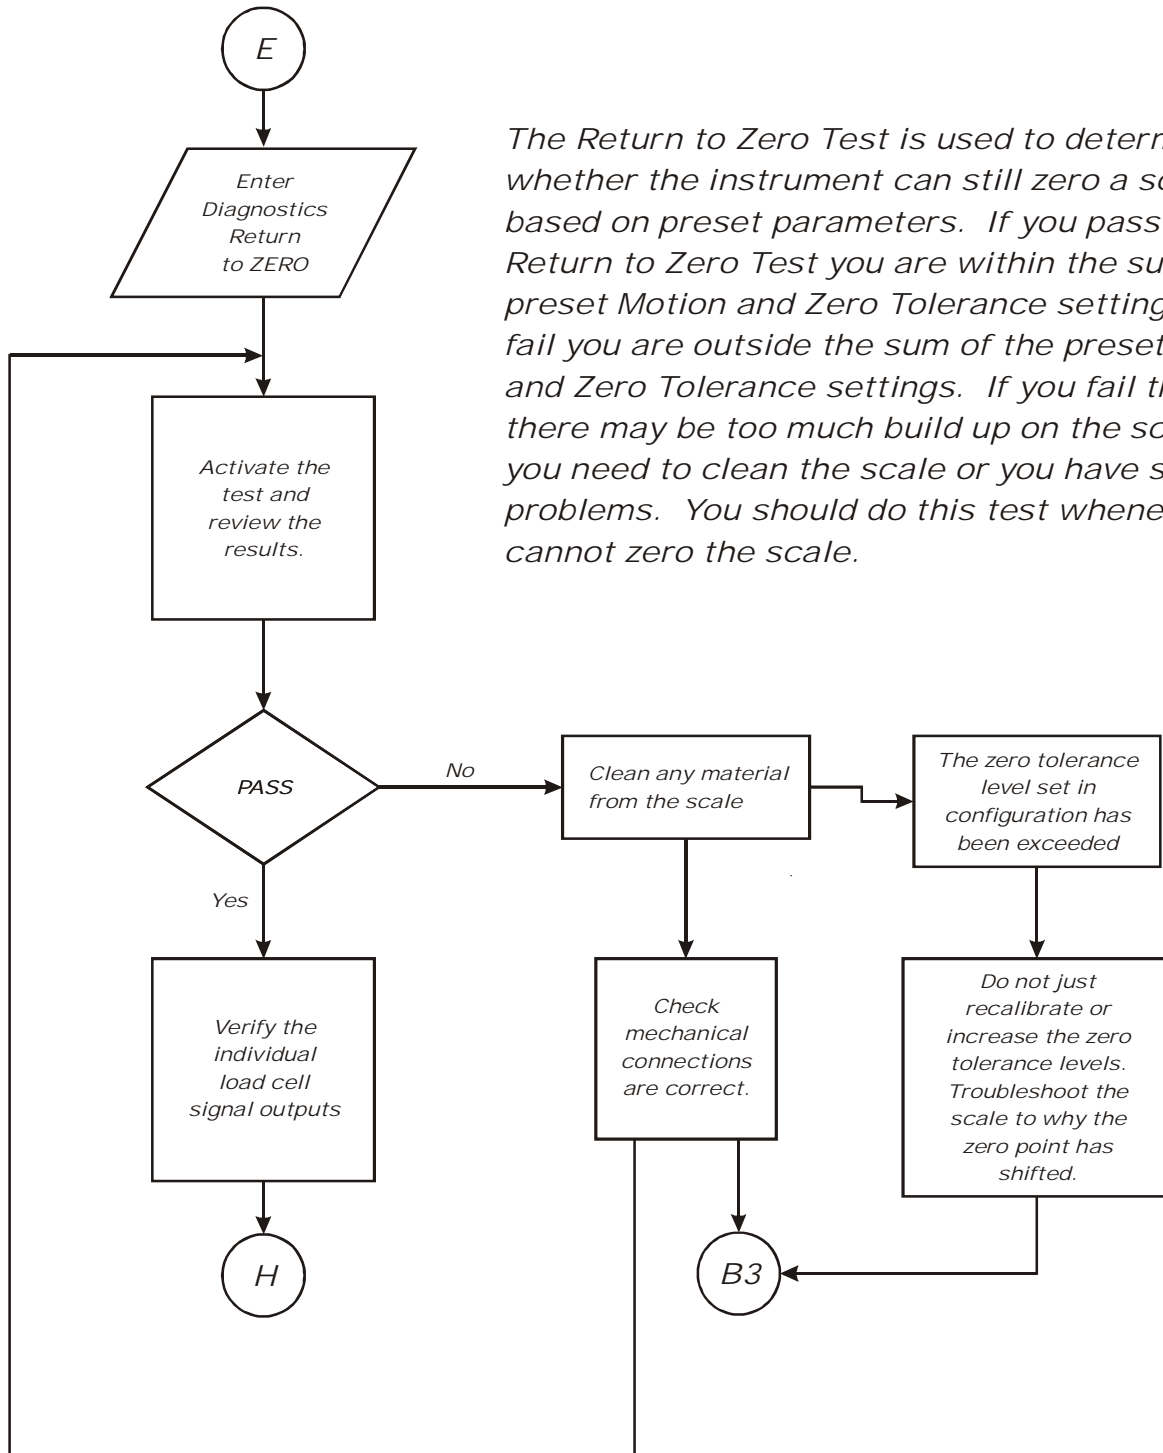

*The Return to Zero Test is used to determine whether the instrument can still zero a scale based on preset parameters. If you pass the Return to Zero Test you are within the sum of the preset Motion and Zero Tolerance settings. If you fail you are outside the sum of the preset Motion and Zero Tolerance settings. If you fail the test there may be too much build up on the scale and you need to clean the scale or you have scale problems. You should do this test whenever you cannot zero the scale.*


# F - Verify Individual Load Cell Milli-Volt Readings

Using the load cell certificate, verify the milli volt per volt rating  
Example: 3 mV/V load cells will produce approximately 15 mV at full load.  
That is 5 volts excitation x 3 mV/V. A scale capacity of 1,000 lbs with 100 lbs  
of dead load at empty the load point mV reading should equal 1.5 mV

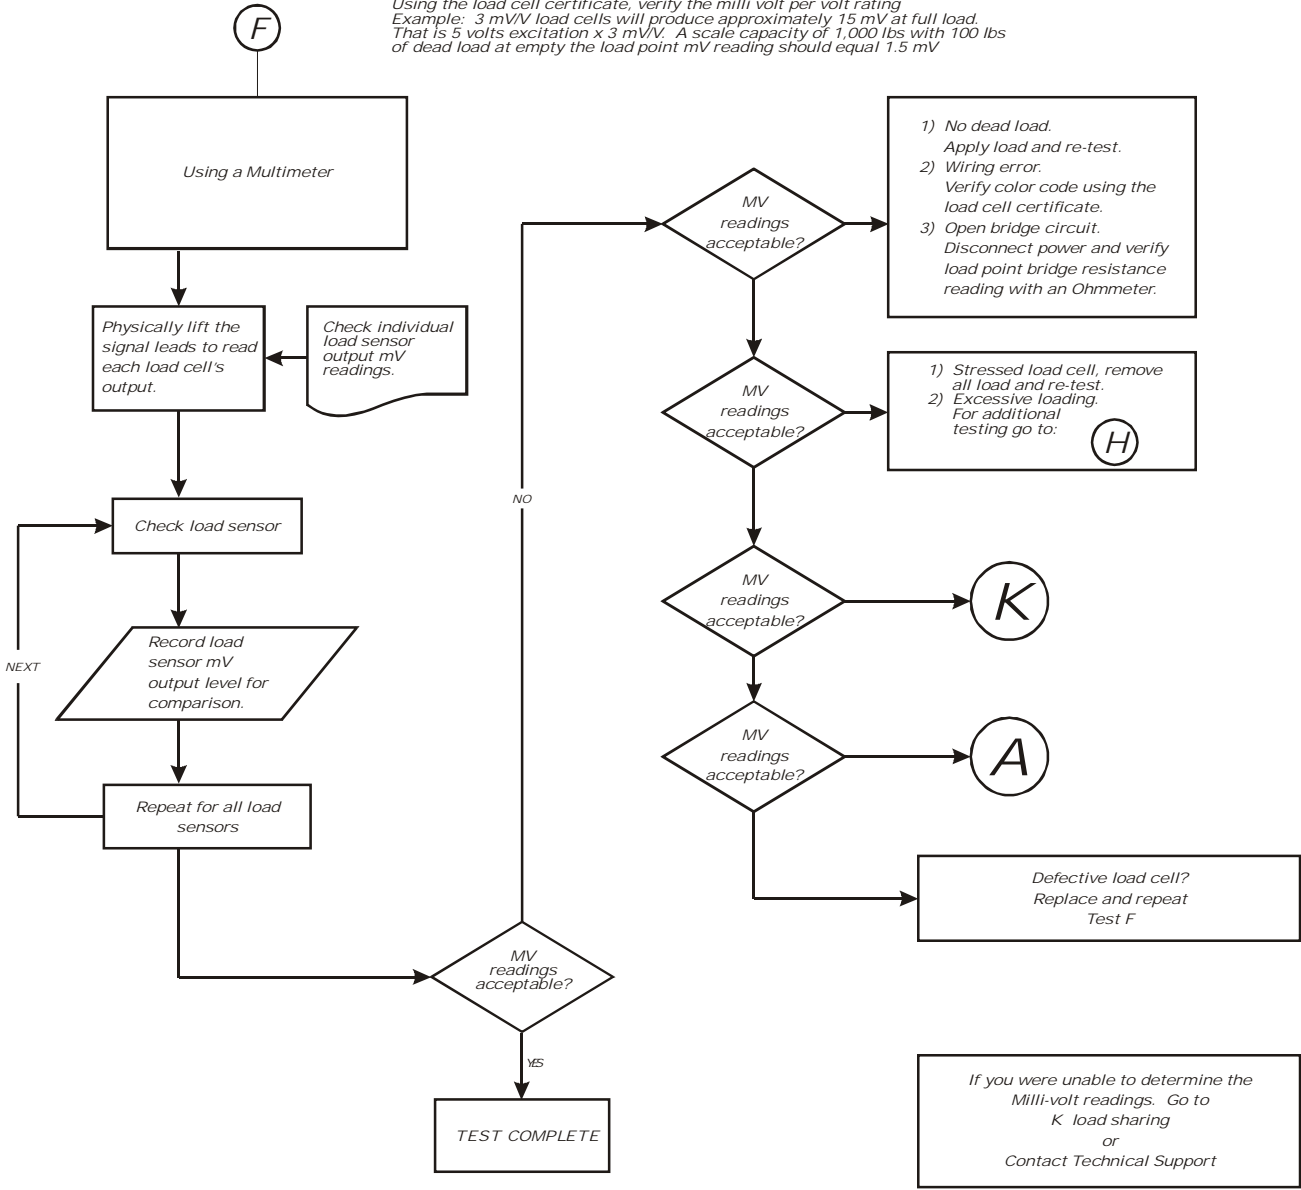


**F(a) - Verify Individual Load Cell Readings**  
Using INTEGRATED TECHNICIAN™


*INTEGRATED TECHNICIAN is a built-in system diagnostics utility that enables the operator to rapidly troubleshoot a weighing system from the front panel, PDA or Web Browser of the HI 3030. Used with an HI 215IT Junction Box you can read each individual load cell in mV, mV/V and weight to determine if a load sensor is malfunctioning or not connected.*

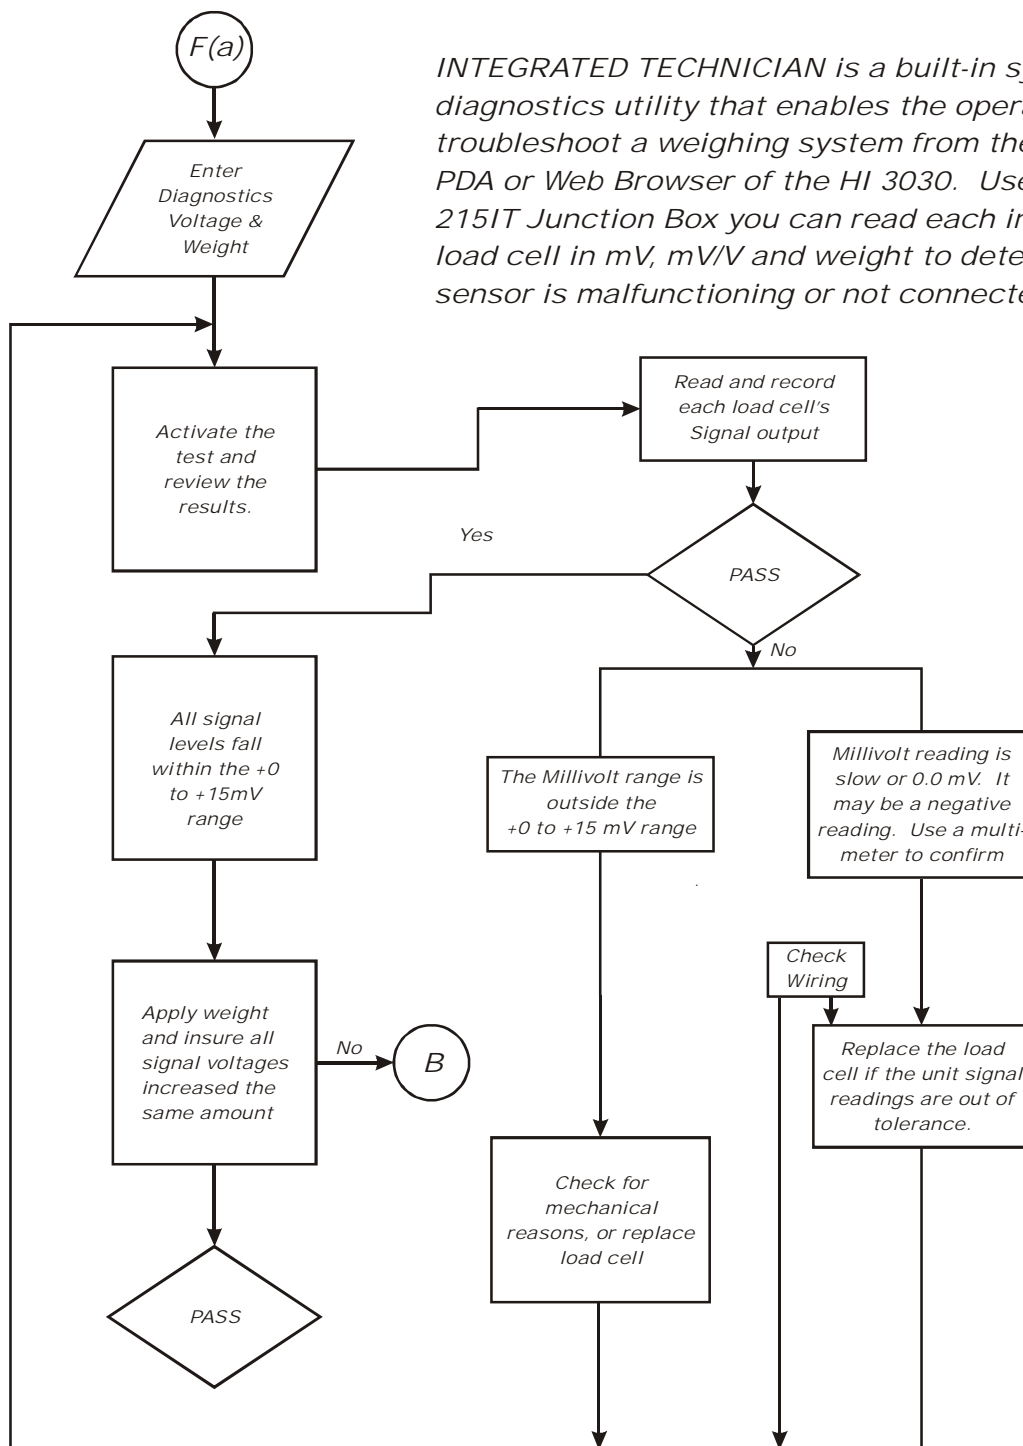


G - A/D Failure Error

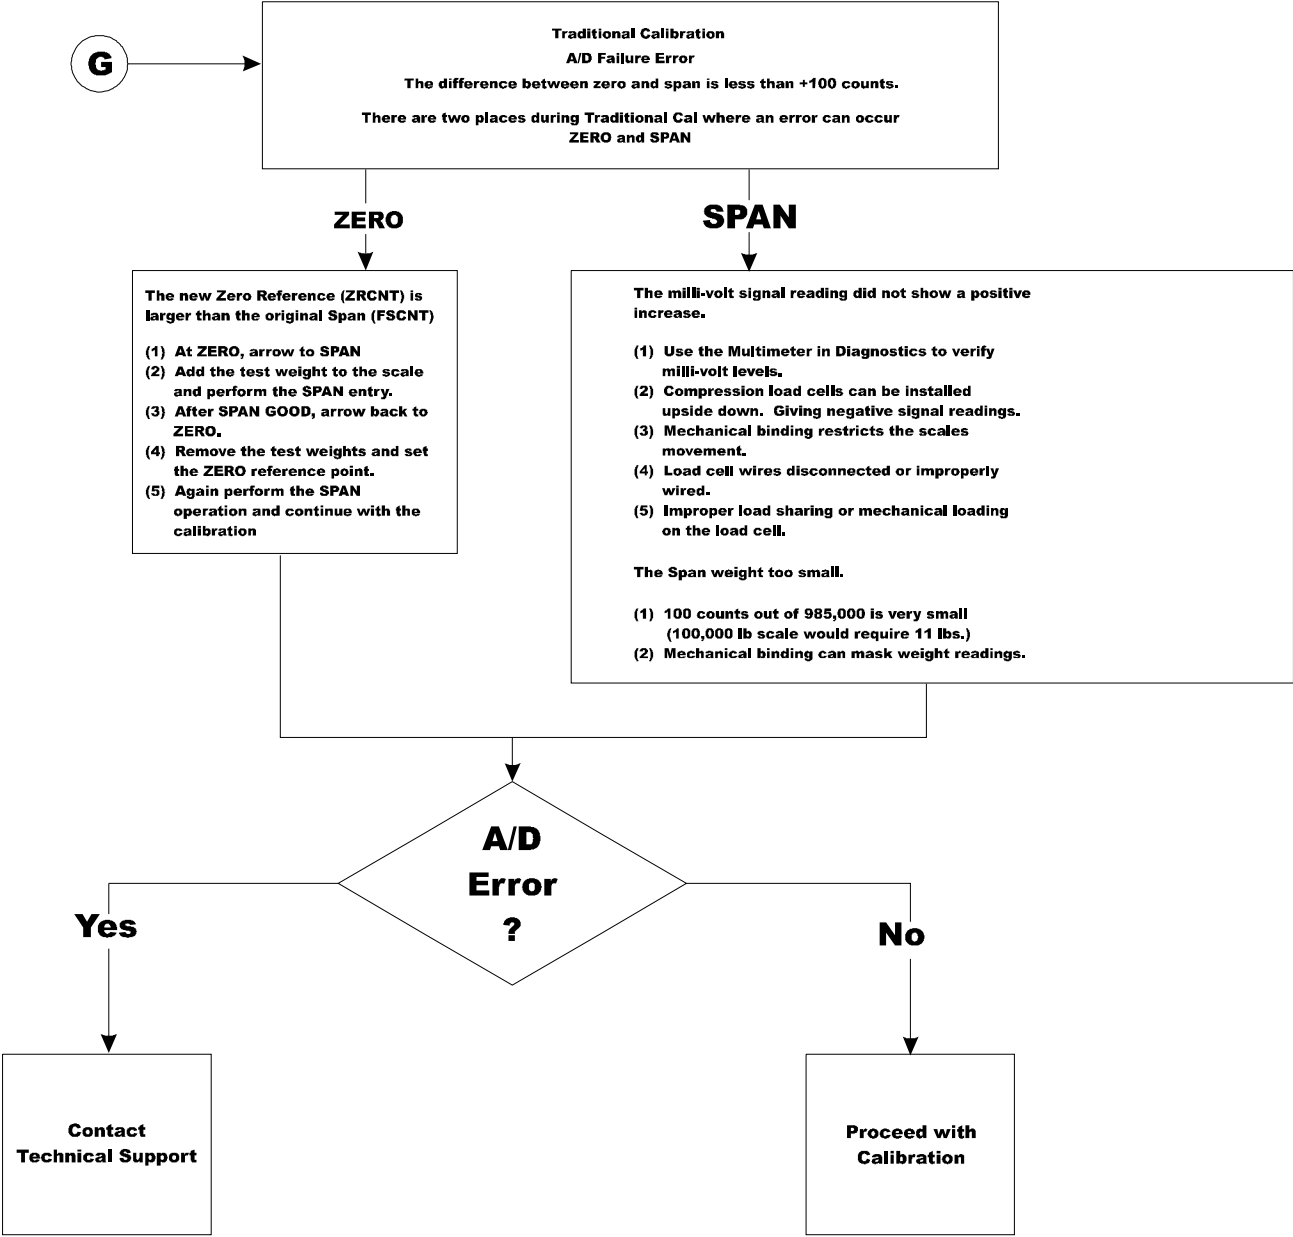


## H - Mechanical Inspection

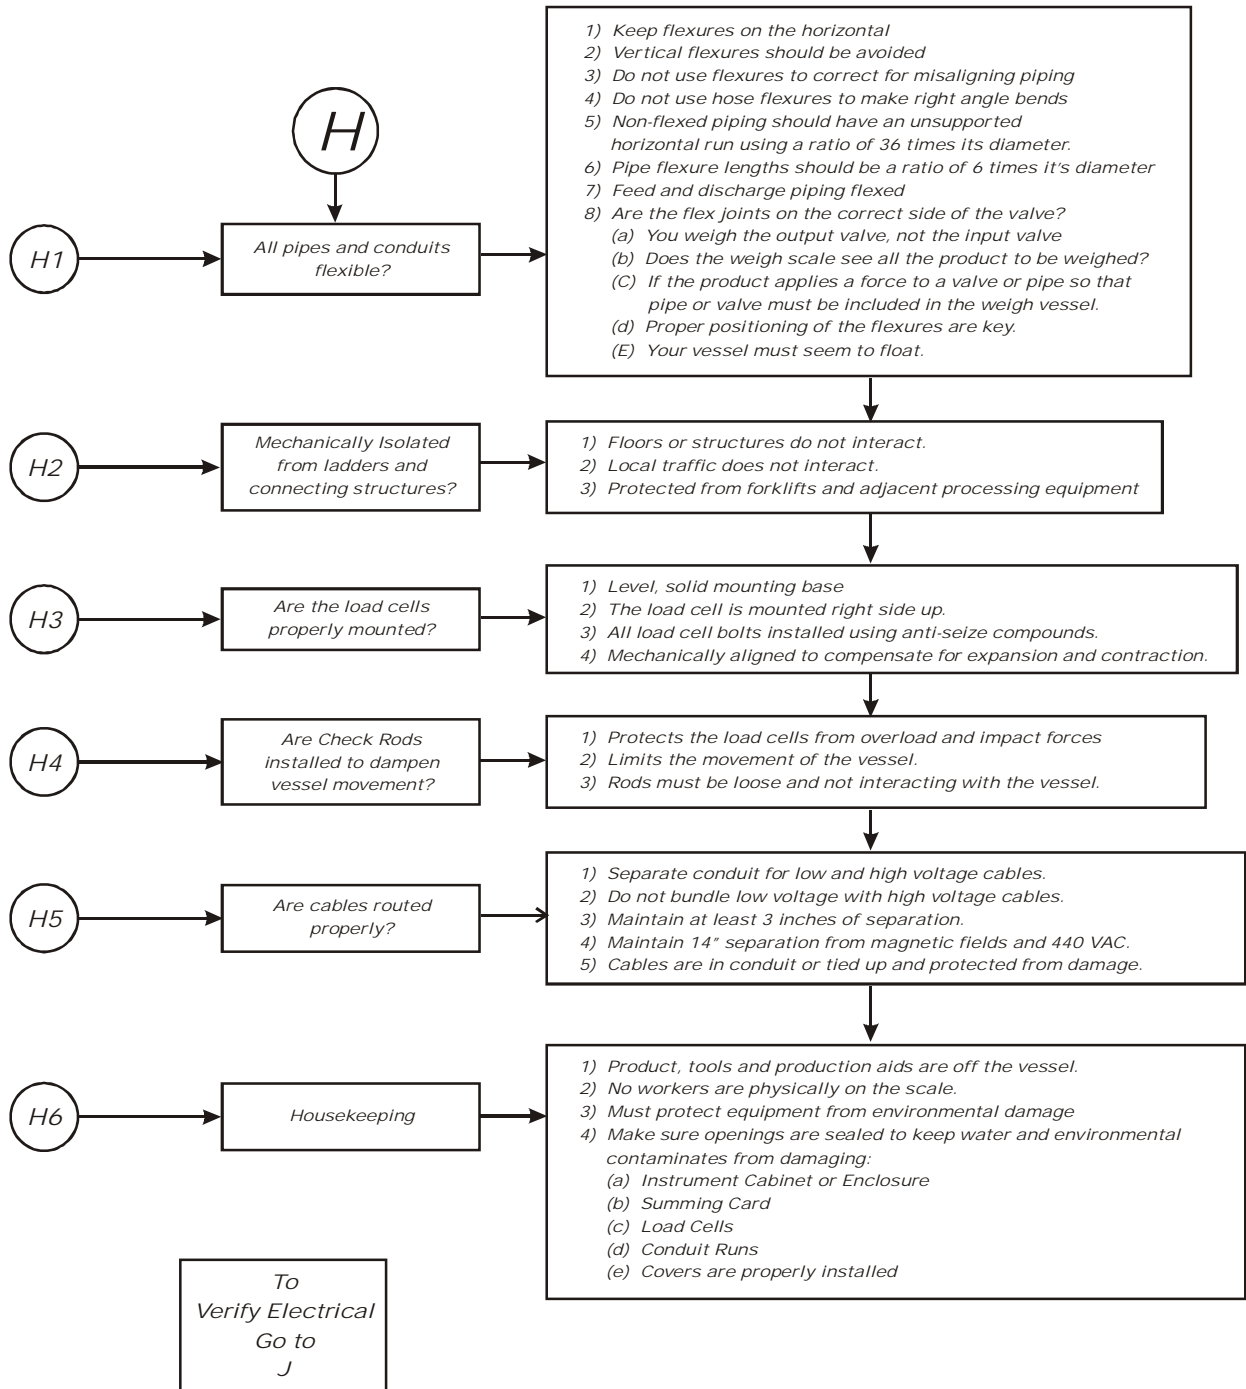


**J - Electrical Inspection**

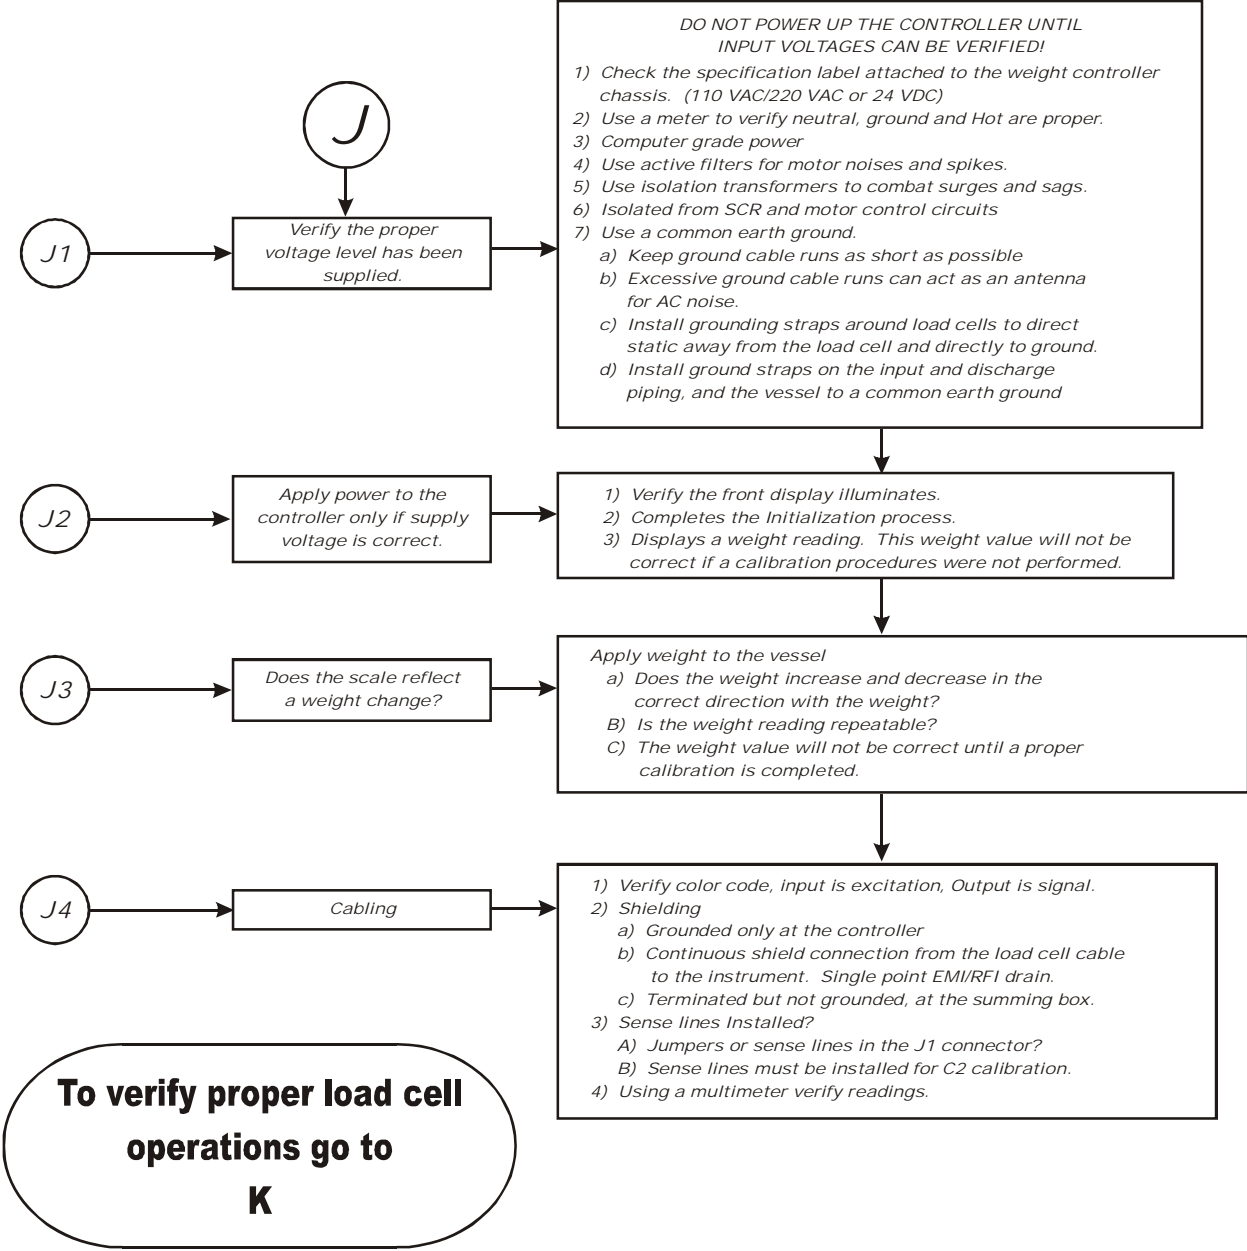

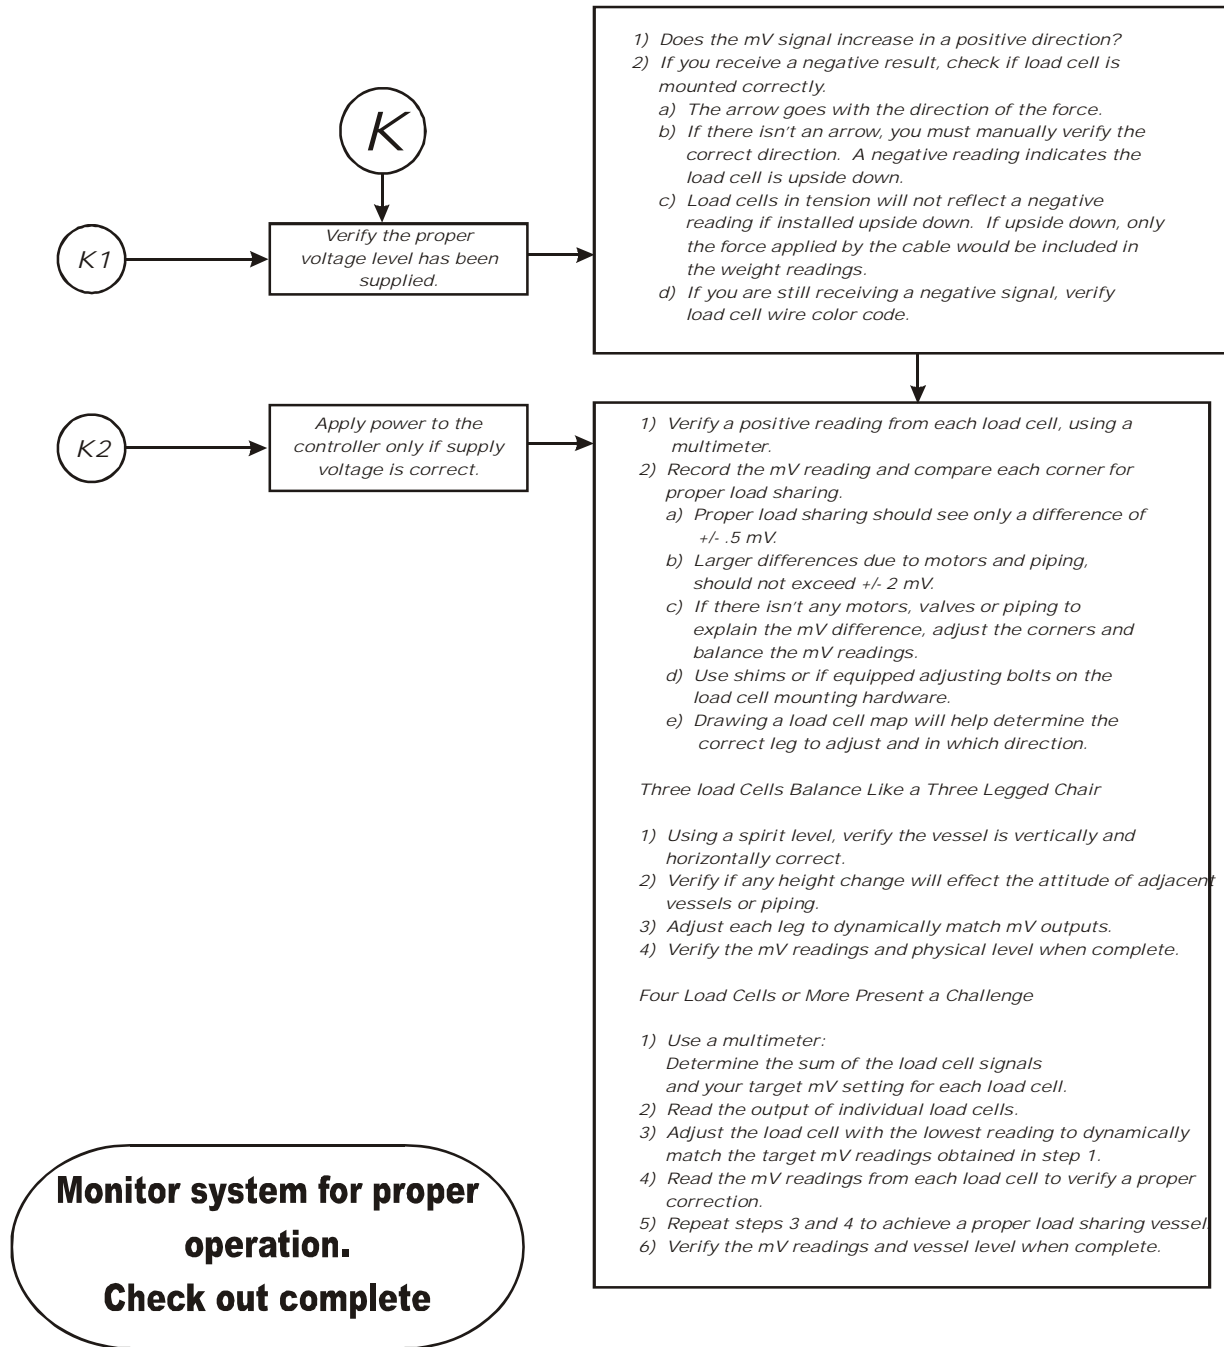


**K - Load Sharing and Load Sensor Checkout**


**M - Weight Reading Stops Incrementing**

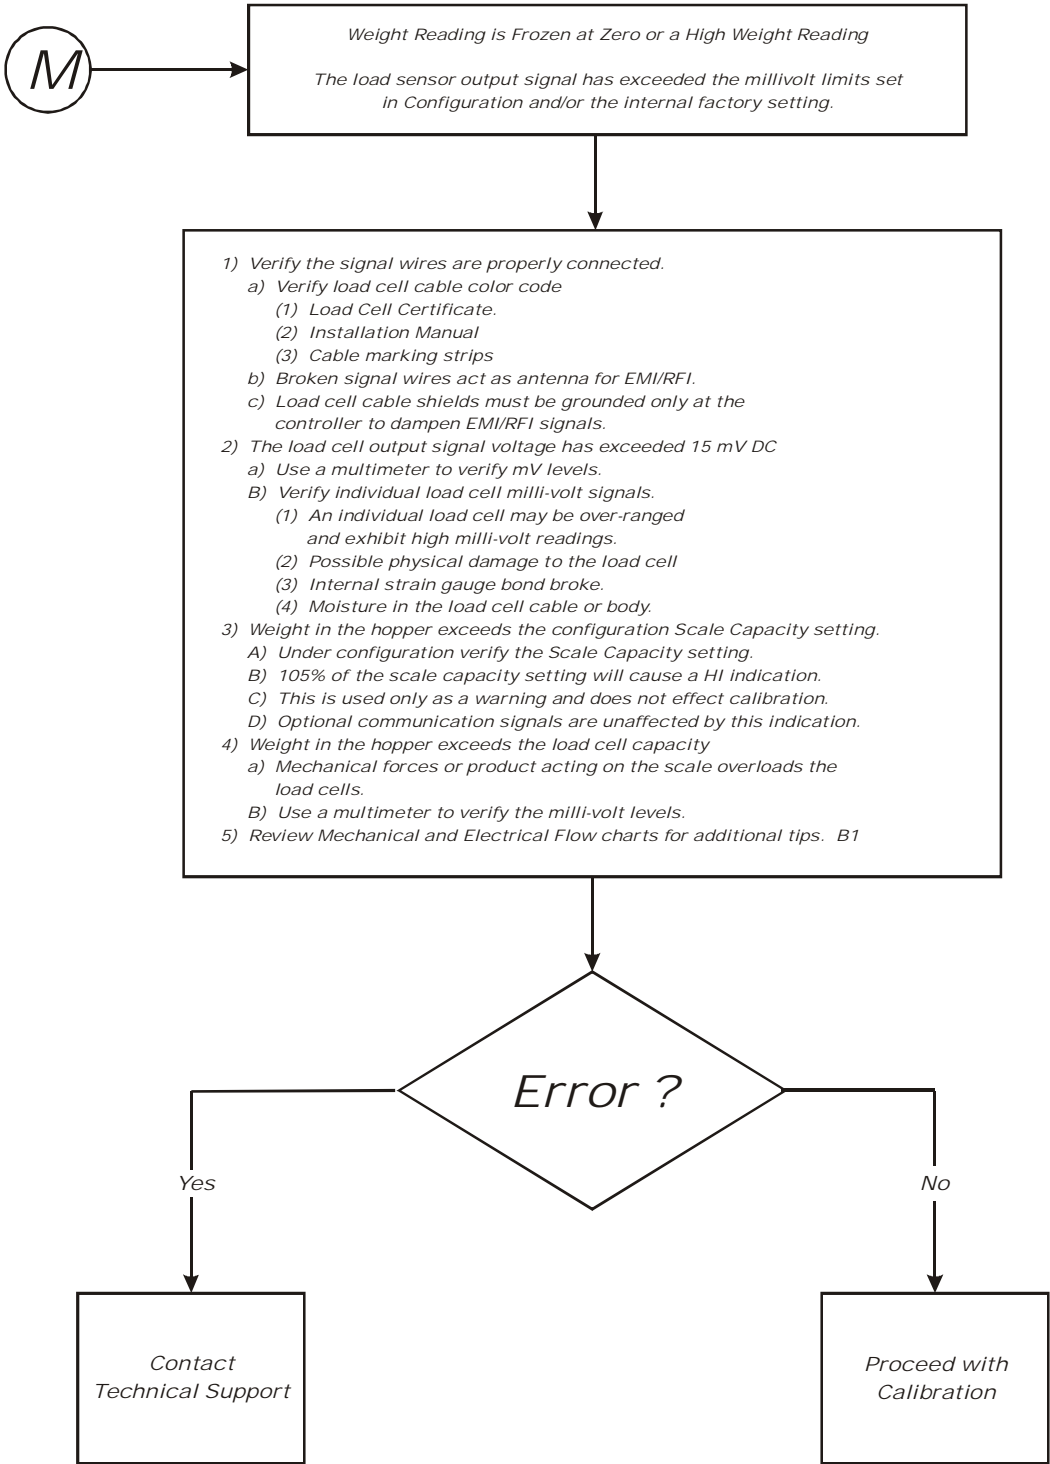


**N - Blank Screen**

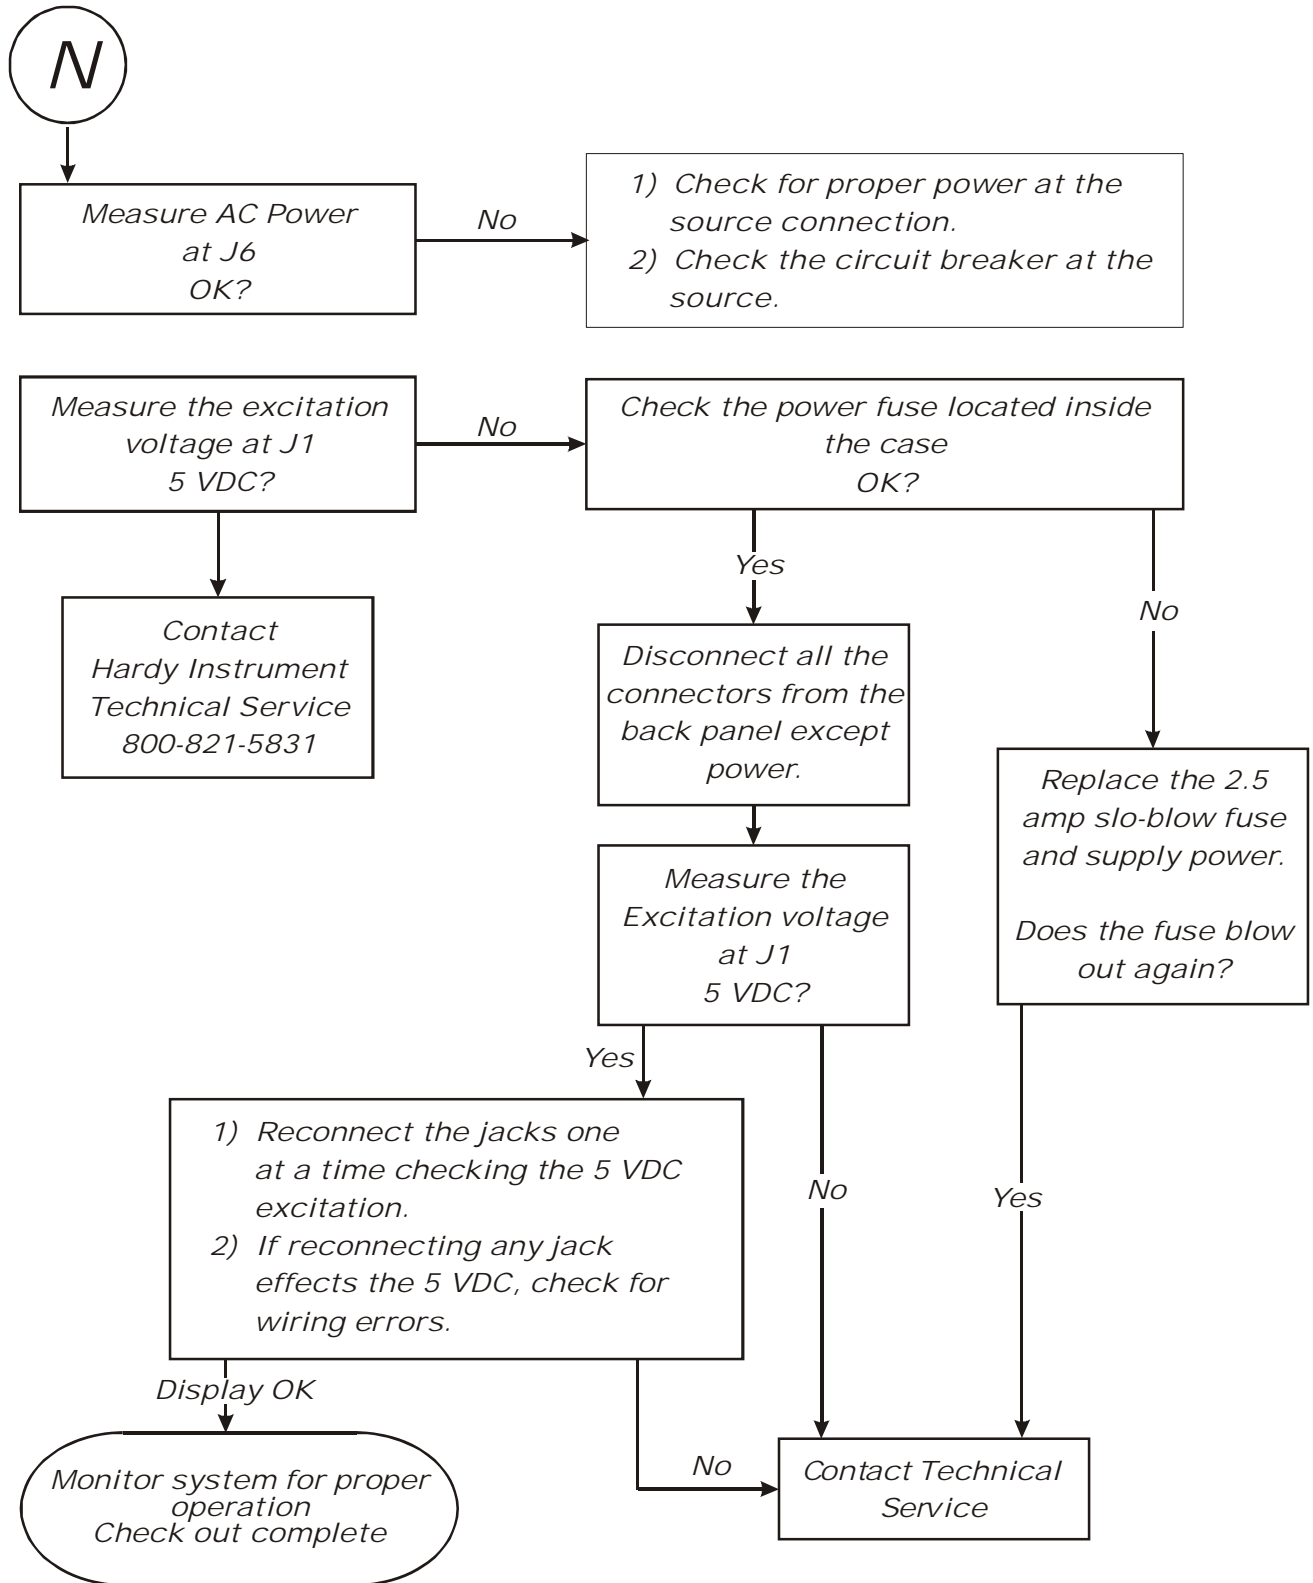


**O - Display Stuck on a Screen**

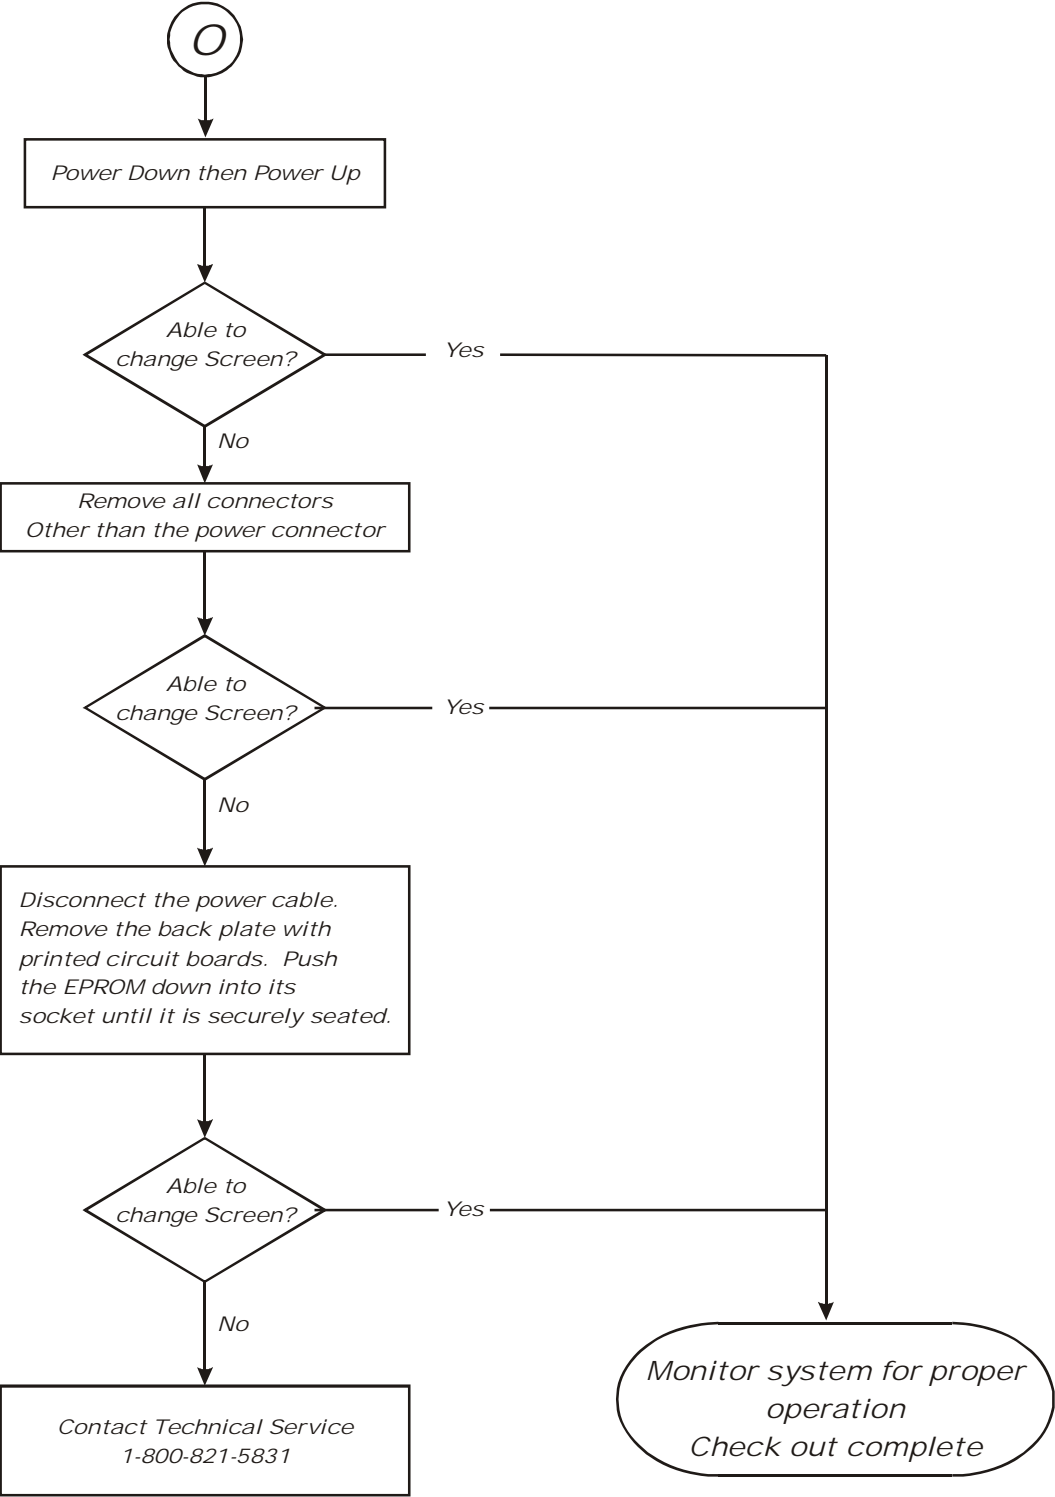

## R - View Input States

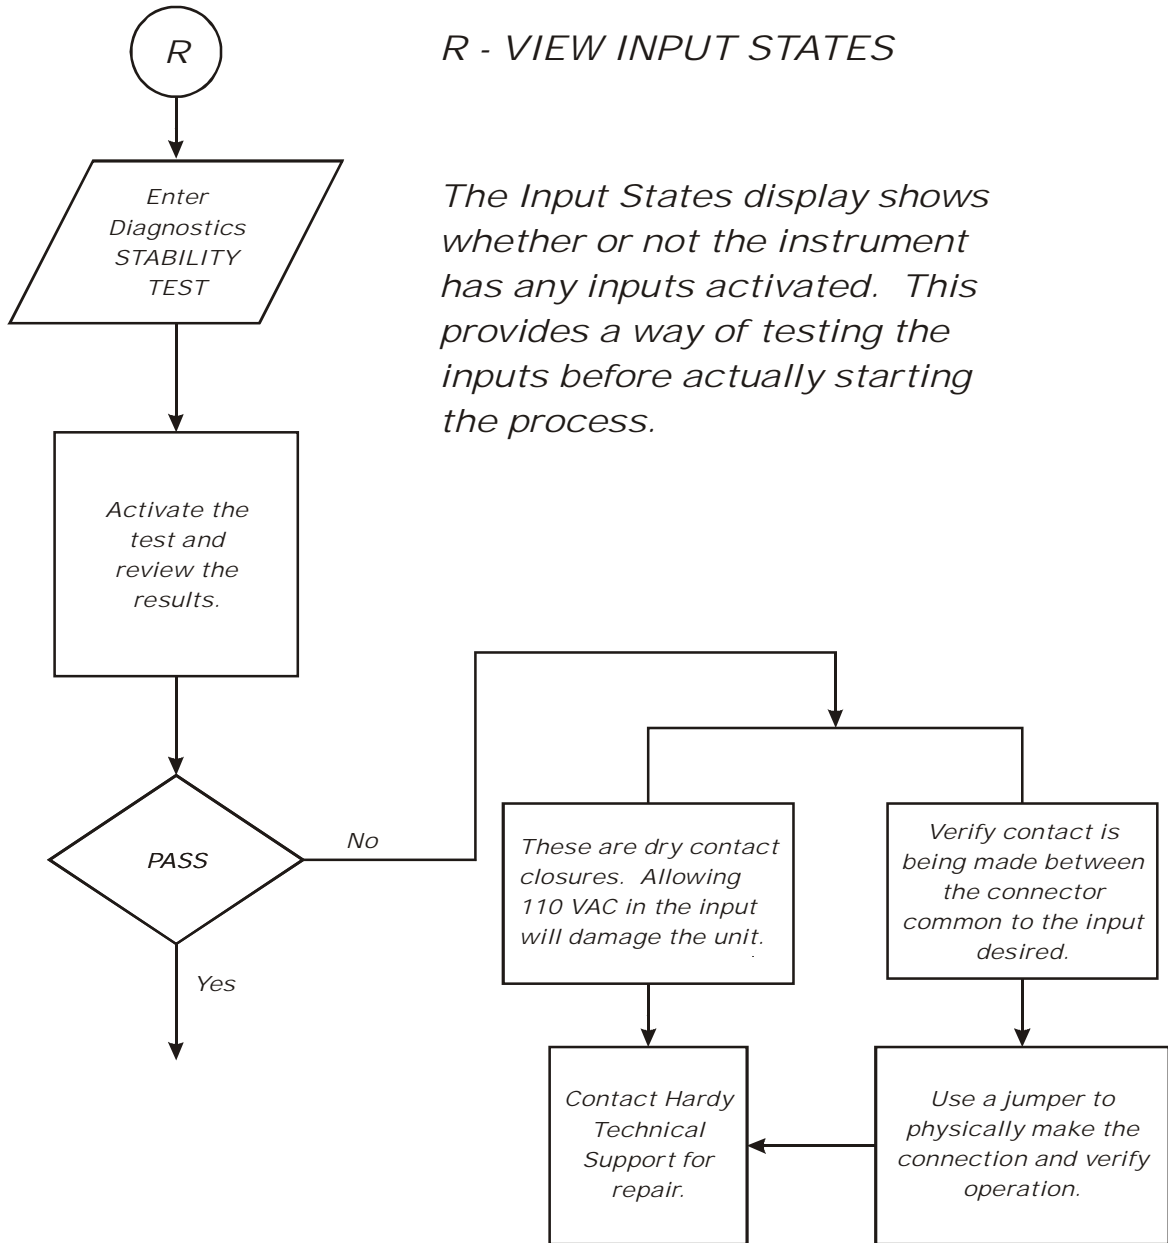

**S - Forcing Outputs**

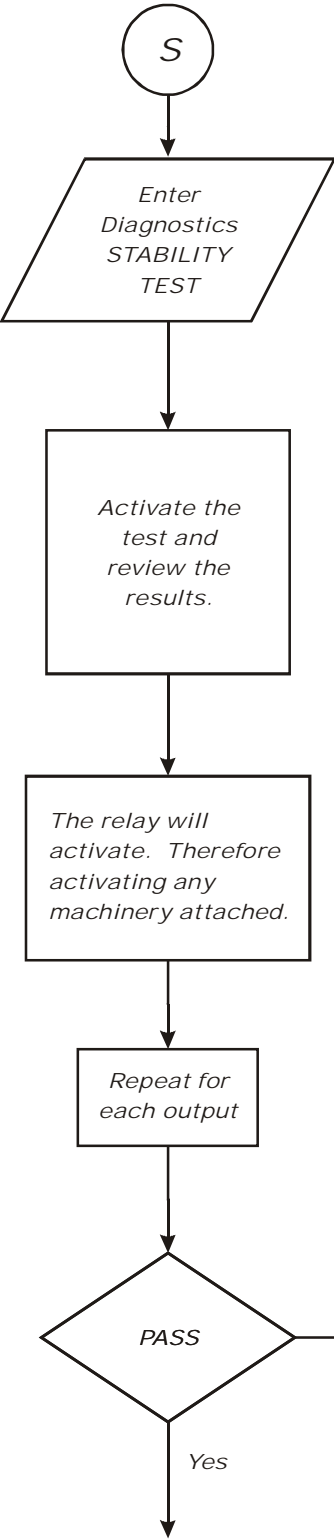

The Force Output function individually activates each of the 4 Output relays in the instrument. Useful in pre-startup to determine that all the relays are connected to the correct auxiliary devices

**WARNING:** Forcing the output relay may cause damage or personal injury. Make absolutely sure you know what the relay is connected to before activating. If you are unsure, do a physical check to determine what the selected relay is connected to BEFORE activating

## System Integrity Check and Fault Determination From the Front Panel

To determine if an instrument or cabling problem exists, verify the basic operation of the system by performing the following system checks.

### Diagnostics


#### About Diagnostics

The Diagnostics menus enable the technician to get a more complete view of how the Weight Controller and scale are working. For example you can check to see the last Calibration, the type of calibration and when the last Calibration was performed. You can view the Data List Display for the Serial Number assigned to the instrument or Program Part Number. You can also check the last graduation size, Units selected, Operator ID, Analog Options and more information about the configuration of the instrument you are checking. You can get information about the Load Sensors such as Output Sensitivity, Hysteresis, Sensitivity of each individual Load Sensor. Many of the Menu Items will allow you to change them. If a Menu Item has an asterisk (\*) in front of it then you can change this item. The Diagnostic Menus allow you to perform a Self Test which provides the total scale input to the instrument such as mV and Weight, mV/V and Weight and mV/V for the units selected (i.e. lbs, kg, oz, g). INTEGRATED TECHNICIAN<sup>®</sup> enables you to totally diagnose a weighing system to determine the source of a problem should one occur.

#### Checking the Device Data List


The Device Data List is a list of all the parameters that were set for the ingredient you are currently using and the instrument parameters that have been set for this instrument. Any parameters that have an asterisk (\*) in front of it can be changed from the Test Data Menu.

- Step 1. From the Standby Display press the Test/9 button. The Test and Data Menu appears with the cursor in front of Device Data List. (See Fig. 7-1)

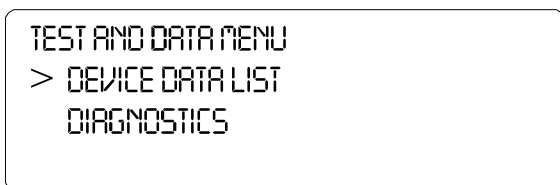


**FIG. 7-1 TEST AND DATA MENU/SELECTING DEVICE DATA LIST**

- Step 2. Press the Enter button. The Device Data List Display appears with the cursor in front of Instrument ID. (See Fig. 7-2)

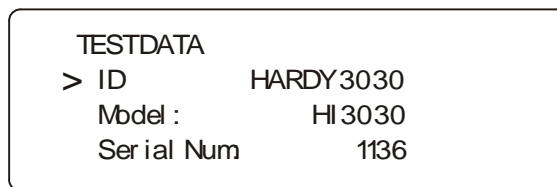

**FIG. 7-2 TEST DATA DISPLAY/INSTRUMENT ID - MODEL NUMBER - S/N**

- Step 3. Here you can view the Instrument ID, Model Number and Instrument Serial Number of the instrument. This is a read only display. To change any of the parameters you will have to go to the Setup Menu/Instrument ID.
- Step 4. Press the down arrow button until the next three parameters appears. (See Fig. 7-3)

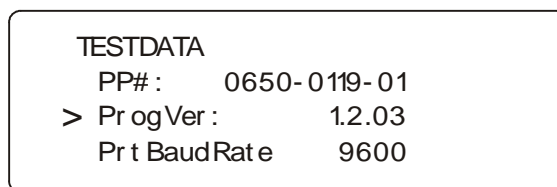

**FIG. 7-3 TEST DATA DISPLAY/PROGRAM VERSION/PRINTER BAUD RATE**

- Step 5. These are read only displays. The information is important:
- PP# = Program Part Number. This is the part number of the firmware. To order additional copies of the firmware you will need this number. This is also additional information available to a service technician for troubleshooting.
  - Often a technician needs to know the program version to determine if the correct version is being used. A Hardy Technical Support Technician will ask what version of software you are currently using to determine the source of a problem. You can find the version here.
  - Prt Baud Rate (Printer Baud Rate) - Indicates the Baud Rate for the printer.

- Step 6. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-4)

TESTDATA	
Pr t Par ity	NONE
> Pr t Data Bits	8
IP:	192.168.110.99

**FIG. 7-4 TEST DISPLAY/PRINTER PARITY - PRINTER DATA BITS - IP ADDRESS**

- Printer Parity - Indicates the parity setting for the printer (Odd, Even, None).
- Printer Data Bits - Indicates the Data Bit setting for the printer.
- IP - Lists the IP address for this instrument. The address listed in Fig. 7-4 is the default IP address of an instrument right from the factory.

Step 7. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-5)

TESTDATA	
DeviceNet Adr :	0
> *ChooseSet point	1
*Amt Req	0.00

**FIG. 7-5 TEST DATA/DEVICENET ADDRESS - CHOOSE SETPOINT - AMOUNT REQUIRED**

- Devicenet Address - Lists the Node Address of the instrument you are checking.
- Choose Setpoint - Note this parameter has an asterisk (\*) in front of it. This means that the value for this parameter or any parameter with an asterisk can be changed
  1. Press the right or left arrow buttons you can select a setpoint (range is 1-12).
  2. Press the Enter button to set the entry.
- Amt Req (Amount Required) - The Amount Required is the weight required for your process.
  1. To change the Amount Required press the Clr (Clear) button.
  2. Use the alphanumeric key pad and enter the new Amount Required.
  3. Press the Enter button to set the entry.

Step 8. Press the down arrow to move to the next 3 parameters. (See Fig. 7-6)

TESTDATA	SETPT:	1
*Pr eact		0.00
> *DeadBd		0.00
Last Cal Type:		C2

**FIG. 7-6 TEST DATA SETPT: 1/PREACT - DEAD BAND - LAST CAL TYPE**

- Preact - The number of units above or below the set point value where you want the relay to trip. Use as an “in flight” compensation value. Enter a negative number for Gain in Weight Applications and a positive number for Loss in Weight Applications.
  1. Press the Clear button.
  2. For Gain in Weight Preact settings, press the User./-/\_/@ button two (2) times. Use the alphanumeric keypad to enter the negative value.
  3. For Loss in Weight Preact settings, use the alphanumeric keypad to enter the positive value.
  4. Press the Enter button to set the entry.
- Dead Bd (Dead Band) - Is a value used to prevent relay chatter once the setpoint is reached. The Dead Band must be larger than the Preact,
  1. Press the Clear button.
  2. Now use the alphanumeric keypad to enter the new Dead Band value.
- Last Cal Type - Lists the type of calibration last performed (C2, Trad or None). This is a read only parameter and cannot be changed from this menu.

Step 9. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-7 & Fig. 7-8)



```

TEST DATA
> *CALIB'D AT:      9H
   *CALIB'D AT:      13m
   *CALIB'D AT:      46S
    
```

**FIG. 7-7 TEST DATA/LAST CALIBRATION TIME**

```

TEST DATA
> *CALIB'D ON DAY:    5
   *CALIB'D IN MONTH: 12
   *CALIB'D IN YR:    2001
    
```

**FIG. 7-8 TEST DATA/LAST CALIBRATION DAY/  
 MONTH/YEAR**

- The Calibration time and date lists the time and date the instrument was last calibrated. This is menu is read only and cannot be changed from this menu. The Cal time is important to determine if the instrument needs calibration to correct a problem with the scale. If a calibration has not been done for a long time it is time to re-calibrate the instrument.

Step 10. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-9)

```

TESTDATA
  Calibr at or      JD
> *Units           lb
  WEVERSAVER:      1.00 Hz
    
```

**FIG. 7-9 TEST DISPLAY/CALIBRATOR - UNITS -  
 WEVERSAVER®**

- The Calibrator is read only and lists the person who last calibrated the instrument.
- Press the up or down arrow until the cursor is in front of \*Units.
  1. This display shows the last selected Unit. Press the left or right arrow buttons to select the Units you want. The selections are lbs, kg, oz, g.
  2. Press the Enter button to set the entry.

3. Press the down arrow to move to the next parameter you want to view or change.

- Press the up or down arrow until the cursor is in front of \*WEVERSAVER. This display shows the last WEVERSAVER selection.

1. Press the left or right arrow buttons to select the WEVERSAVER selection you want.
2. Press the Enter button to set the entry.
3. Press the down arrow to move to the next parameter.

Step 11. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-10)

```


TESTDATA
  *GradSize         1
> ZeroValue:       0.00
  SpanValue:        10000.0
    
```

**FIG. 7-10 TEST DATA DISPLAY/GRADUATION  
 SIZE - ZERO VALUE - SPAN VALUE**

- The Zero Value and Span Value are read only. The Graduation Size, Zero Value and Span Value are for the last traditional calibration only. The \*Grad Size (Graduations) can be changed.
- Grad Size - Minimum increment displayed by the instrument.
  1. This display shows the last selected Graduation size. Press the left or right arrow buttons to select the Units you want. The selections are 1, 2, 5, 10, 20, 50, 100, 200, 500, 1000.
  2. Press the Enter button to set the entry.
  3. Press the down arrow to move to Zero Value
- Zero Value - This is the value used when zeroing the scale with no material in the vessel or on the scale when performing a traditional calibration.
- Span Value - This is the value used when putting between 80% - 100% of the scale capacity when performing a traditional calibration.

Step 12. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-11)

**CAUTION: CHANGING THE ZERO COUNT CAN NULLIFY YOUR CALIBRATION. ONLY SERVICE PERSONNEL SHOULD MAKE ANY CHANGES THE ZERO COUNT, SPAN COUNT OR C2 SENSITIVITY.**

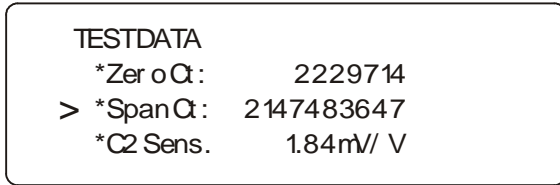

**FIG. 7-11 TEST DATA DISPLAY/ZERO COUNT - SPAN COUNT - C2 SENSITIVITY**

- \*Span Count, \*C2 Sensitivity, \*Scale Capacity can all be changed.
- The Zero Count is the stored A/D counts on the last calibration zero.
  1. To clear the Zero Count press the Clr (Clear) button.
  2. Use the alphanumeric key pad to enter the new Zero Count value

**CAUTION: ZERO COUNTS MUST BE LESS THAN SPAN COUNTS.**

3. Press the Enter button to set the entry.
  4. Press the down arrow to move to the next parameter you want to view or change.
  5. If you get an error during calibration, change Zero Count to 50,000 to clear the calibration error, then recalibrate.
- Press the up or down arrow until the cursor is in front of \*Span Count.


**CAUTION: CHANGING THE SPAN COUNT CAN NULLIFY YOUR CALIBRATION.**

- The Span Count are the A/D counts on the last C2 (full scale) or Traditional (Span) calibration.
  1. To clear the Span Count press the Clr (Clear) button.
  2. Press the Enter button to set the entry.
  3. Change the Span Count to a large number (1,000,000.00) to clear calibration errors, then re-calibrate.

**CAUTION: SPAN COUNTS MUST BE LARGER THAN THE ZERO COUNTS.**

- The C2 Sensitivity is the full scale output sensitivity of C2 load sensor measured at the factory.
  1. To change the sensitivity press the Clr (Clear) button.
  2. Use the alphanumeric key pad and enter the sensitivity specifications that comes with new load sensors and enter the full scale output sensitivity of the C2 load sensors.
  3. Press the Enter button to set the entry.
  4. Press the down arrow to move to the next parameter you want to view or change.

Step 13. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-12)

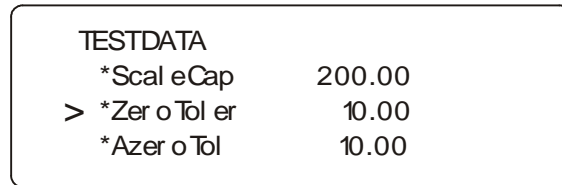

**FIG. 7-12 TEST DATA DISPLAY/SCALE CAPACITY - ZERO TOLERANCE - AUTO ZERO TOLERANCE**

- \*Scale Capacity, \*Zero Tolerance and \*Auto Zero Tolerance can all be changed from this menu.
  - 5.
  - Scale Capacity - The maximum weight the scale is rated for.
    1. To change the Scale Capacity click on clear.
    2. Use the alphanumeric key pad and enter the new scale capacity.
    3. Press the Enter button to set the entry.
- Zero Tolerance - The number of graduations from zero that will be accepted as zero by the instrument.
  1. To clear the Zero Tolerance press the Clr (Clear) button.
  2. Use the alphanumeric key pad and enter the new Zero Tolerance.
  3. Press the Enter button to set the entry.
- Auto Zero Tolerance - When Auto Zero is enabled, automatically zeros the gross

weight as long as the weight is within the zero tolerance for your process.

1. To change the Auto Zero Tolerance press the Clr (Clear) button.
2. Use the alphanumeric key pad and enter the new Auto Zero Tolerance.
3. Press the Enter button to set the entry.
4. Press the down arrow to move to the next parameter you want to view or change.

Step 14. Press the down arrow button until the next three menu items are displayed. (See Fig. 7-13)

TESTDATA	
*Motion Tol	10.00
> *Averages	10
Numof Sensor s	4

**FIG. 7-13 TEST DATA DISPLAY/MOTION TOLERANCE - AVERAGES - NUMBER OF SENSORS**

Step 15. \*Motion Tolerance, \*Averages can be changed from this menu. Number of Sensors is read only and cannot be changed.

- Motion Tolerance - The allowable deviation between consecutive weight readings.
  1. To change the Motion Tolerance press the Clr (Clear) button.
  2. Use the alphanumeric key pad and enter the new Motion Tolerance.
  3. Press the Enter button to set the entry.
  4. Press the down arrow to move to the next parameter you want to view or change.
- Averages - The Number of weight readings used to compute displayed weight.
  1. To change the Averages press the Clr (Clear) button.
  2. Use the alphanumeric key pad and enter the new Averages.
  3. Press the Enter button to set the entry.
- Number of Sensors - Lists the number of C2 load sensors that are connected to the the channel and instrument you are checking.

Step 16. Press the down arrow button until the cursor is in front of Load Sensor. (See Fig. 7-14)

TESTDATA	
*Averages	10
> Numof Sensor s	4
Load Sensor	1->


**FIG. 7-14 TEST DATA/AVERAGES - NUMBER OF SENSORS - LOAD SENSOR**

- Load Sensor 1 - The instrument will read C2 load sensors certification information only.
  1. The instrument displays sensor number 1 as a default.
  2. If you want to look at the certified specifications for other load sensors press the up or down arrows to move the list of sensors. The instrument can detect a maximum of 32 sensors per scale.
  3. To view the certified sensor information which is read from the C2 chip, do the following:
    - a. Press the Enter button. The Load Sensor Display appears. (See Fig. 7-15)

LOADSENSOR	
Serial # :	45236
> Capacity	1000.00
Sens.	0.00mV/ V

**FIG. 7-15 LOAD SENSOR DISPLAY/SERIAL NUMBER - CAPACITY - SENSITIVITY (MV/V)**

- b. Serial Number - This is the serial number of the selected load sensor for this channel. In our example we selected channel 1.
- c. Capacity - the maximum weighing capacity of the load sensor.
- d. Sensitivity - Sensitivity specification of the load sensor set at the factory.
- e. Press the down arrow until the remainder of the load sensor specifications appear. (See Fig. 7-16)

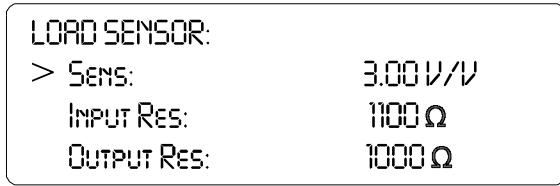


**FIG. 7-16 SENSITIVITY - INPUT RESISTANCE - OUTPUT RESISTANCE**

- f. Input Resistance - This is the Certified Input Resistance from the certification done by the factory.
- g. This is the Certified Output Resistance from the certification

Step 17. Press the Exit button to return to the Test Data Display.

Step 18. Press the Exit button to return to the Test and Data Menu. (See Fig.7-17)

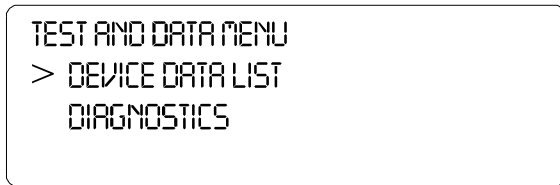

**FIG. 7-17 TEST AND DATA MENU**


**Diagnostics**

**INTEGRATED TECHNICIAN™ (IT®)**

INTEGRATED TECHNICIAN™ is a built-in system diagnostics utility that enables the operator to rapidly troubleshoot a weighing system from the front panel or Web Page of the HI 3030. Used with an HI 215IT Junction Box you can read each individual load cell in mV, mV/V, and weight to determine if a load sensor is malfunctioning or not connected.


**Using IT From the Front Panel**

Step 1. From the Summary Display, press the up or down arrow buttons until the cursor is in front of the scale you want to diagnose. In our example we selected Scale 1. (See Fig. 7-18)

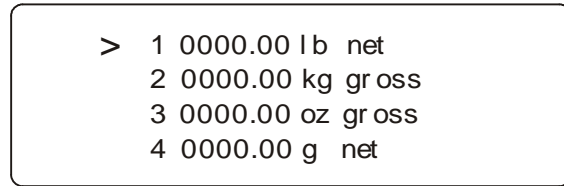

**FIG. 7-18 SUMMARY DISPLAY/SELECTING SCALE NUMBER 1**


Step 2. Press the Test/9 button. The Test and Data Menu appears. (See Fig. 7-19)

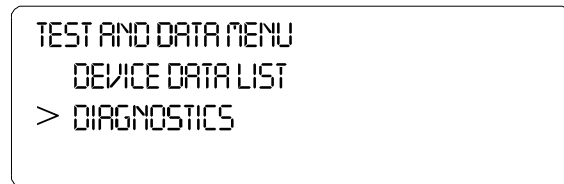

**FIG. 7-19 TEST AND DATA MENU/SELECTING DIAGNOSTICS**


Step 3. Press the down arrow until the cursor is in front of Diagnostics. (See Fig. 7-19)

Step 4. Press the Enter button. The Diagnostics Display appears with the cursor in front of Voltage & Weight. (See Fig. 7-20)

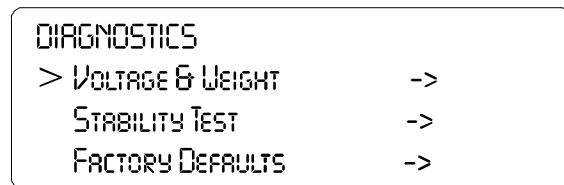

**FIG. 7-20 DIAGNOSTICS DISPLAY/SELECTING VOLTAGE & WEIGHT**

Step 5. To test the Voltage and Weight Press the enter button. Voltage & Weight briefly turn to !! TESTING!! while the test is performed. (See Fig. 7-21)

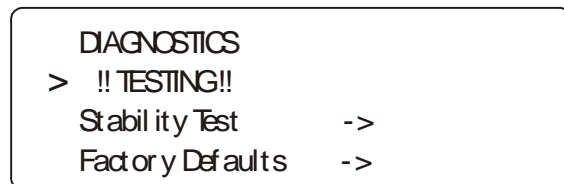

**FIG. 7-21 DIAGNOSTICS DISPLAY/VOLTAGE & WEIGHT TESTING DISPLAY**

Step 6. The Scale # Screen appears with the total MilliVolt (mV), Milli-Volt/Volt (mV/V) and Weight (lb kg, gr., oz) readings from the load sensors that are connected to the selected Scale. In our example it is Scale #1. (See fig. 7-22)

	SCALE 1
> ALL	3.2720 mV
ALL	0.457 mV/ V
ALL	0.00 lb

**FIG. 7-22 SCALE #1 WITH TOTALS DISPLAYED**

Step 7. If you connected the load sensors directly to the HI 3030 without using the HI 215IT Junction Box, Fig. 7-22 is displayed.

Step 8. If you are using IT and connected the load sensors to an HI 215IT Junction Box the Scale #1 display appears with arrows to the right of each category. (See Fig. 7-23)

*NOTE: The values listed here are for illustration purposes only. Your readings will be different.*

	SCALE 1
> ALL	3.2720 mV ->
ALL	0.457 mV/ V ->
ALL	0.00 lb ->

**FIG. 7-23 SCALE #1 WITH TOTALS DISPLAYED AND HI 215IT JUNCTION BOX CONNECTED**

Step 9. The IT Junction box enables you to read each individual load sensor's Millivolt, Millivolt/Volt or Weight Reading.

- The mV reading is a coarser reading than the mV/V or Weight. The mV reading is sufficient to balance the corners of your scale or vessel.
- These readings allow you to determine if the problem is in the instrument (internal) or in a load sensor(s) (external). The specification range for the Weight Controller is 0-15 mV. If you are getting a reading outside this range (15.5 mV, 3.1 mV/V Maximum or any negative values) the problem is exterior to the Instrument (most likely improper wiring). If you are getting a read-

ing between 0-15 mV the reading is normal.

Step 10. To select the Millivolt readings for all the load sensors that are connected to the scale, press the up or down arrow buttons until the cursor is in front of the All Millivolt (mV).

Step 11. Press the Enter button. The Scale Millivolt per individual Scale Load Sensor display appears providing the readings for all the load cells that are connected to Scale 1. (See Fig. 7-24)

- To see the reading for Load Sensor #4 press the down arrow button. The Scale Millivolt display appears with LS4 displayed. (See Fig. 7-24 & 25)

	SCALE 1
> LS1	0.817 mV
LS2	0.817 mV
LS3	0.817 mV

**FIG. 7-24 SCALE 1/INDIVIDUAL MILLIVOLT DISPLAY 1**

	SCALE 1
> LS2	0.817 mV
LS3	0.817 mV
LS4	0.817 mV

**FIG. 7-25 SCALE 1/INDIVIDUAL MILLIVOLT DISPLAY 2**

- If all the load sensor readings are 0.00 mV there is something wrong between the HI 3030 and the HI 215IT Junction Box or with the Junction Box itself. The cable is disconnected or something is wrong with the Junction Box such that it is not transmitting the Millivolt readings to the HI 3030 Weight Controller.
- If you do not get a reading for one or possibly two or more load sensors (LS3 for example reads 0.00 mV or the millivolt reading is either larger or smaller than it should be) and you know that the Load Sensors are connected to the Junction Box, the individual load sensor cable is disconnected from the junction box or the load sensor is malfunctioning.

- With this information you can quickly determine what the problem is and where it is located either from the Front Panel or Web Browser.
- If the Millivolt readings are not fine enough to determine the problem select the Millivolt/Volt readings.

Step 12. Press the Exit button to return to the Totals Display. (See Fig. 7-26)

Step 13. To read the Millivolt/Volt reading for finer troubleshooting, press the down arrow until the cursor is in front of the Millivolt/Volt (mV/V) reading for the selected scale. In our example we selected Scale #1. (See Fig. 7-26)

	SCALE 1
ALL	3.2720 mV ->
> ALL	0.457 mV/ V ->
ALL	0.00 lb ->

**FIG. 7-26 SCALE #1 WITH TOTALS/MILLIVOLT/VOLT SELECTED**

Step 14. Press the Enter button. The Scale Millivolt/Volt for individual Scale Load Sensor display appears. (See Fig. 7-27)

	SCALE 1
> LS1	0.114 mV/ V
LS2	0.114 mV/ V
LS3	0.114 M/ V

**FIG. 7-27 SCALE 1/INDIVIDUAL MILLIVOLT/VOLT DISPLAY 1**

- To see the reading for Load Sensor #4 press the down arrow button. The Scale Millivolt/Volt display appears with LS4 displayed. (See Fig. 7-28)

	SCALE 1
> LS2	0.114 mV/ V
LS3	0.114 mV/ V
LS4	0.114 M/ V

**FIG. 7-28 SCALE 1/INDIVIDUAL MILLIVOLT/VOLT DISPLAY 2**

- If all the load sensor readings are 0.00 mV/V there is something wrong between the HI 3030 and the HI 215IT Junction Box or with the Junction Box itself. The cable is disconnected or something is wrong with the Junction Box such that it is not transmitting the Millivolt/Volt readings to the HI 3030 Weight Controller.
- If you do not get a reading for one or possibly two or more load sensors (LS3 for example reads 0.00 mV/V or the millivolt/Volt reading is either larger or smaller than it should be) and you know that the Load Sensors are connected to the Junction Box, the individual load sensor cable is disconnected from the junction box or the load sensor is malfunctioning.
- With this information you can quickly determine what the problem is and where it is located either from the Front Panel or Web Browser.
- If the Millivolt/Volt readings are not fine enough to determine the problem select the Weight readings.


Step 15. Press the Exit button to return to the Totals Display. (See Fig. 7-29)

Step 16. To read the Weight reading for finer troubleshooting, press the down arrow until the cursor is in front of the Weight (lb, kg, gr, oz) reading for the selected scale. In our example we selected Scale #1. (See Fig. 7-29)

	SCALE 1
ALL	3.2720 mV ->
ALL	0.457 mV/ V ->
> ALL	0.00 lb ->


**FIG. 7-29 SCALE #1 WITH TOTALS/WEIGHT (LB) SELECTED**

Step 17. Press the Enter button. The Scale Weight for the individual Scale Load Sensor display appears. (See Fig. 7-30)

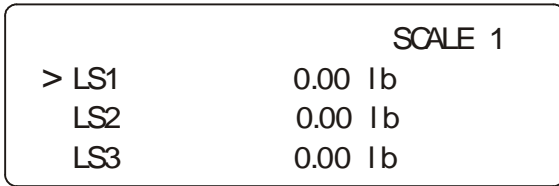

**FIG. 7-30 SCALE 1/INDIVIDUAL WEIGHT DISPLAY 1**

- To see the reading for Load Sensor #4 press the down arrow button. The Scale Millivolt/Volt display appears with LS4 displayed. (See Fig. 7-31)

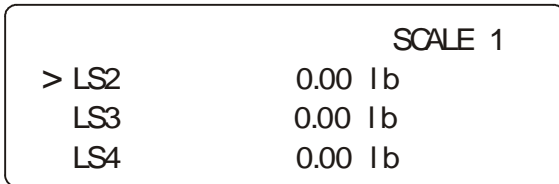


**FIG. 7-31 SCALE 1/INDIVIDUAL WEIGHT DISPLAY 1**

- If you do not get a reading from one of the load sensors, either the cable to the load sensor is disconnected or the load sensor is malfunctioning.
- If one of the load sensors is reading higher or lower than the other load sensors in your system and you know that you calibrated the instrument and cornered the scale, there is something wrong with the load sensor.
- If one of the load sensors is reading higher or lower than the other load sensors and you do not know if the scale has recently been calibrated, re-calibrate the scale then perform the Voltage and Weight test again.

**Stability Test**


The Stability Test switches a fixed signal into the analog to digital convertor, and calculates the mean squared variation from the average reading, using 100 samples. The test passes if the mean squared variation is less than 5.0, and the average reading is between 30237 and 36955.

Step 1. Press the up or down arrow buttons until the cursor is in front of Stability Test. (See Fig.7-32)

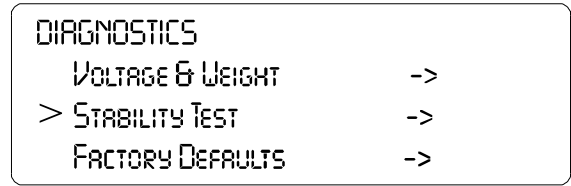

**FIG. 7-32 DIAGNOSTICS DISPLAY/SELECTING STABILITY TEST**


Step 2. Press the Enter button. The Information display appears “SYS. STABILITY TEST, PRESS ENTER TO START”. (See Fig. 7-33)

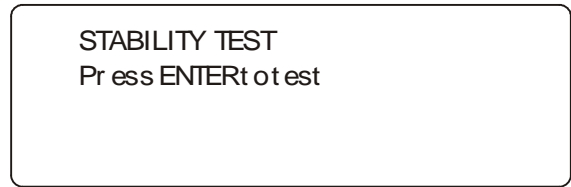

**FIG. 7-33 STABILITY TEST DISPLAY**

Step 3. Press the ENTER button to perform the stability test.

- Each channel that passes the Stability Test are displayed as PASS. (See Fig. 7-34) This means that the Mean Squared Variation is less than 5.0 and the average reading is between 30237 and 36955. In short the instrument is working fine.

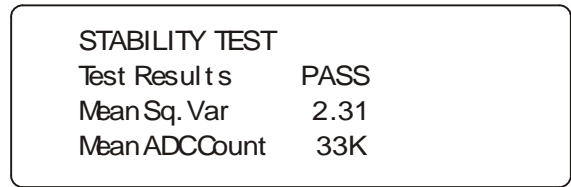

**FIG. 7-34 SYSTEM STABILITY TEST DISPLAY/ PASS**

- If the channel does not pass the Stability Test the FAIL display appears. This means that the Mean Squared Variation is greater than 5.0 and/or the average reading is not between 30237 and 36955. This test examines the internal electronics and not the load cells input signal.


1. Disconnect the power cord and reconnect the power cord to restart the instrument.
2. Repeat the Stability test.
3. If a channel Fails the Stability Test again, contact Hardy Instruments Inc., Technical Support for assistance.

Step 4. Press the Exit button to return to the Diagnostics display.

### Factory Defaults

**CAUTION: IF YOU CHOOSE FACTORY DEFAULTS ALL DATA WILL BE LOST! MAKE ABSOLUTELY SURE THAT THIS IS WHAT YOU WANT TO DO BEFORE CHOOSING THIS OPTION. DO NOT USE THIS FUNCTION IN AN EFFORT TO CORRECT ANY MALFUNCTIONS IN THE OPERATION OF THE INSTRUMENT.**


Step 1. Press the up or down arrow buttons until the cursor is in front of Factory Defaults. (See Fig. 7-35)

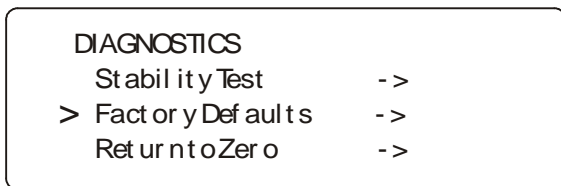

**FIG. 7-35 DIAGNOSTICS DISPLAY/FACTORY DEFAULTS**


- Resetting the Default Parameters is used when you want reset the instrument to all defaults when changing a scale or application to be sure that all parameters are set to a known working condition. Also used when the scale seems not to respond to any corrective action.
- It is required that the security access to this menu is High (HI).

Step 2. Press the Enter button. The Factory Defaults display appears. (See Fig. 7-36)

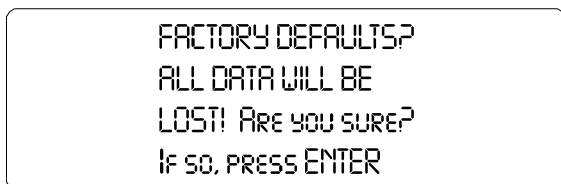


**FIG. 7-36 FACTORY DEFAULTS DISPLAY**

- Step 3. Press the Exit button if you do not want to set the Factory Defaults. The Diagnostics display reappears.
- Step 4. Press the Enter button if you want to set the Factory Defaults.
- Step 5. If the password is not set for HI security a Security Violation appears. You will have to change your security level for your password to HI or find someone who has a HI security clearance to set the Factory Defaults. (See HI 3000 manual, Security Section for more instructions)
- Step 6. A display appears telling you to Please Wait. (See Fig. 7-37)
- Step 7. The Summary Display appears listing all the Channels. (See Fig. 7-38)

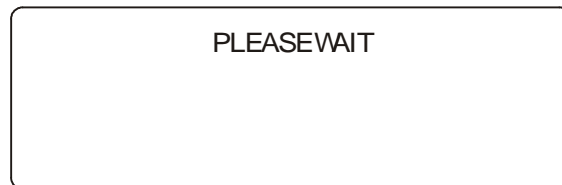

**FIG. 7-37 PLEASE WAIT DISPLAY**

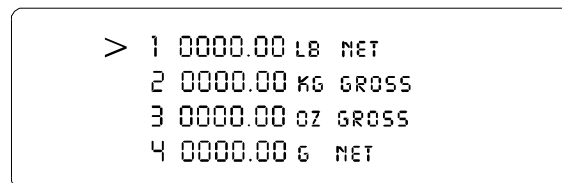

**FIG. 7-38 SUMMARY DISPLAY**


Step 8. You will have to go back into the Diagnostics section again to continue.

### Return to Zero Test

The Return to Zero Test is used to determine whether the instrument can still zero a scale based on preset parameters. If you pass the Return to Zero Test you are within the sum of the preset Motion and Zero Tolerance settings. If you fail you are outside the sum of the preset Motion and Zero Tolerance settings. If you Fail the test there may be too much build up on the scale and you need to clean the scale or you have scale problems. You should do this test whenever you cannot zero the scale.


Step 1. Press the up or down arrow buttons until the cursor is in front of Return to Zero. (See Fig. 7-39)



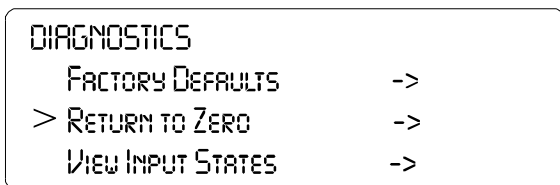

**FIG. 7-39 DIAGNOSTICS DISPLAY/SELECTING RETURN TO ZERO TEST**


Step 2. Press the Enter button. The Return to Zero Test display appears. (See Fig. 7-40)

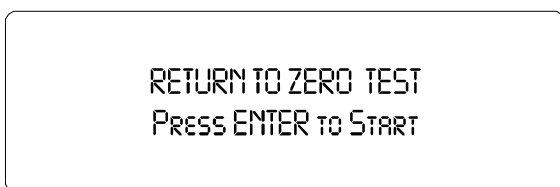

**FIG. 7-40 RETURN TO ZERO TEST DISPLAY**


Step 3. To perform the test press the Enter button. In a few seconds a display appears telling you if the instrument has passed or failed.

- If you Pass the Test the Pass display appears. (See Fig. 7-41)

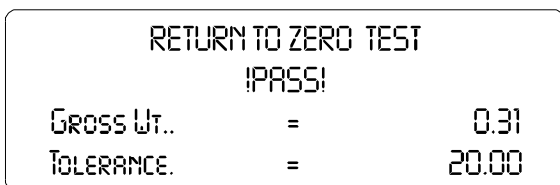

**FIG. 7-41 RETURN TO ZERO TEST/PASS**

- If instrument Fails the test the Fail display appears. (See Fig. 7-42) You may need to do the following:
  1. Check the scale for excess material.
  2. Check your Motion and Zero Tolerance settings. They might be set too low for your process.

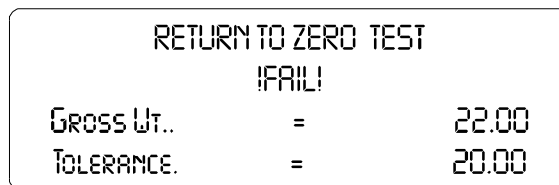


**FIG. 7-42 RETURN TO ZERO/FAIL**

Step 4. Press the Exit button to return to the Diagnostics display.

#### View Input States


The Input States display shows whether or not the instrument has any inputs activated. A 1 means the input is active and a 0 means it is not.

Step 1. Press the up or down arrow buttons until the cursor is in front of View Input States. (See Fig. 7-43)

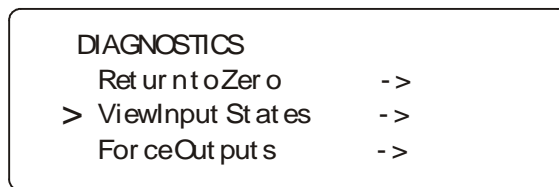

**FIG. 7-43 DIAGNOSTICS/VIEW INPUT STATES**

Step 2. Press the Enter button. The Input States display appears. (See Fig. 7-44)

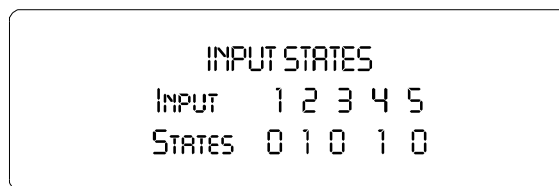

**FIG. 7-44 INPUT STATES DISPLAY/INPUT 2 AND 4 ACTIVE**

Step 3. Press the Exit button to return to the Diagnostics display.


#### Force Outputs

**WARNING: FORCING THE OUTPUT RELAY MAY CAUSE DAMAGE OR PERSONAL INJURY. MAKE ABSOLUTELY SURE THAT YOU KNOW WHAT THE RELAY IS CONNECTED TO BEFORE ACTIVATING. IF INSECTARY DO A PHYSICAL**

**CHECK TO DETERMINE WHAT THE SELECTED RELAY IS CONNECTED TO BEFORE ACTIVATING.**


The Force Outputs function individually activates each of the 4 Output relays in the instrument. Useful in pre-startup to determine that all the relays are connected to the correct auxiliary devices.

Step 1. Press the up or down arrow buttons until the cursor is in front of Force Outputs. (See Fig. 7-45)

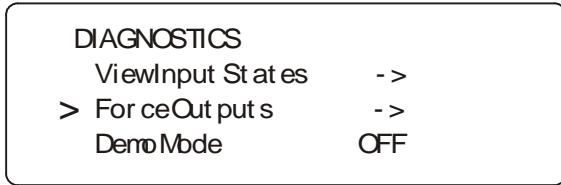


**FIG. 7-45 DIAGNOSTICS DISPLAY/FORCE OUTPUTS**

Step 2. Press the Enter button.  
Step 3. The Output Relay display appears with the cursor in front of Output Relay #1. (See Fig. 7-46)

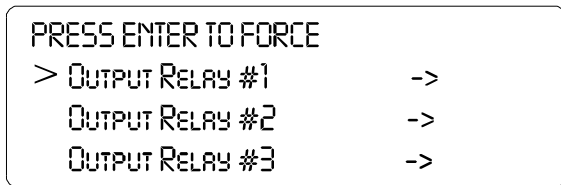

**FIG. 7-46 OUTPUT RELAY DISPLAY/SELECTING OUTPUT RELAY #1**


Step 4. To select another Output Relay, press the up or down arrow buttons until the cursor is in front of the Output Relay you want to force. (See Fig. 7-47)

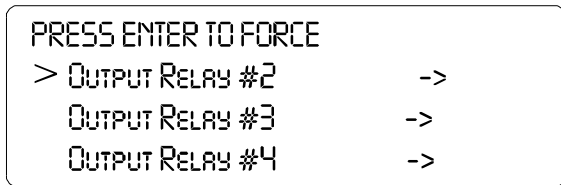

**FIG. 7-47 OUTPUT RELAY DISPLAY/SELECTING OUTPUT RELAY #2**

Step 5. Press the Enter button to activate the output relay you have chosen. The Output Relay Forced Closed display appears. (See Fig. 7-48)

- All the output relays on the instrument are Normally Open so activation will close the relay.

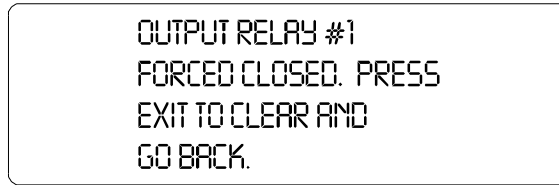

**FIG. 7-48 OUTPUT RELAY #1 FORCED CLOSED DISPLAY**

Step 6. Press the Exit button to return to the Output Relay Display.

- If you want to select another Output Relay do so now.
- If you do not want to select another Output Relay, press the Exit button to return to the Diagnostics display.

Step 7. Press the Exit button again to return to the Diagnostics display.

Step 8. Press the Exit button until you return to the Summary Display.

**System Integrity Check and Fault Determination From the Web Browser**

**Diagnostics**

Diagnostics is used to troubleshoot the Weight Controller. A complete Troubleshooting Guide is available in this Service Manual. What is important for Operational purposes is to be able to see the information about this instrument. Setting Default Settings is also useful to operators.

**Using IT From the Web Browser**

Step 1. From the Home Page click on Operation. (See Fig. 7-49) The Operation Choose One page appears. (See Fig. 7-50)



FIG. 7-49 HOME PAGE/SELECTING OPERATION

Step 2. Click on Diagnostics. (See Fig. 7-50) The Operation-Diagnostics Page appears with the four (4) scales listed. (See Fig. 7-51)

## Operation - Choose One

[Diagnostics](#)

[Monitor](#)

FIG. 7-50 OPERATION - CHOOSE ONE/SELECTING DIAGNOSTICS

**Operation - Diagnostics**

Instrument ID:

Model Number: HI-3030

Program Part Number: 0650-0126-01

Firmware Revision: 2.13.00.06 eval

Serial number: 2397

Channel Calibration

Channel	Type	Operator ID	Date
Channel #1	TRAD		3 Jun 2009
Channel #2	C2		3 Jun 2009
Channel #3	C2		1 Jan 2001
Channel #4	C2		3 Jun 2009

Status Word: 0001  
A/D Conversion Error\*

[C2 Data](#)   [Stability Test](#)   [Weight and Voltage](#)   [Set Factory Defaults](#)   [UDP](#)  
[View Input/Output](#)   [Return to Zero Test](#)   [Parameters \(Read Only\)](#)   [Parameters \(Read/Write\)](#)   [Status log](#)

FIG. 7-51 OPERATION - DIAGNOSTICS

Step 3. Click on Weight and Voltage. (See Fig. 7-52) The Operation/Diagnostics - Weight & Voltage page appears with all four (4) channels listed. (See Fig. 7-52)

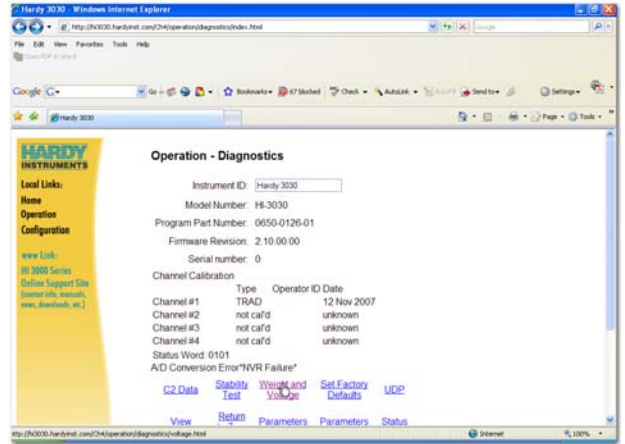


FIG. 7-52 OPERATION - DIAGNOSTICS/SELECTING WEIGHT AND VOLTAGE

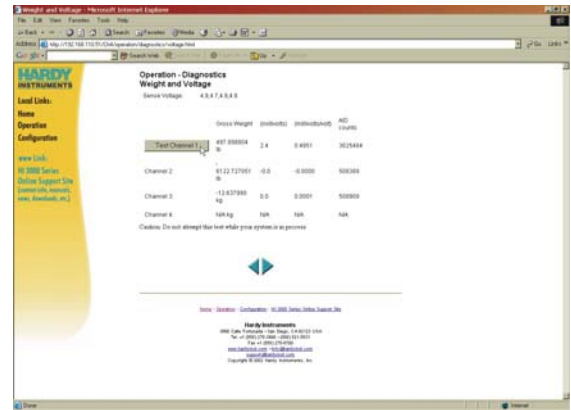


FIG. 7-53 OPERATION/DIAGNOSTICS - WEIGHT & VOLTAGE PAGE

Step 4. You will notice that the First Channel has a Test Channel #1 button. This means that this channel is connected to an HI 215IT Junction Box. The other three (3) channels have the load sensors connected directly to the HI 3030 and are not set for IT.

*NOTE: Whichever channel is connected to an HI 215IT Junction Box will have a test button.*

Step 5. Click on the Test button of the channel you want to test. In our example we selected the Test Channel #1 button. (See Fig. 7-54) The IT J-Box Diagnostics Weight and Voltage results appear.

*NOTE: The values expressed here are for illustration purposes only. Your values will be different.*

**IT J-Box Diagnostics  
Weight and Voltage**

	Gross Weight lb	(millivolts)	(millivolts/volt)	A/D counts
Sense Voltage:	4.9			
Sensor 1:	-64.460335	1.16	0.2369	1713053
Sensor 2:	70.578217	1.31	0.2683	1872400
Sensor 3:	111.961601	4.89	1.0029	5607168
Sensor 4:	364.890167	2.31	0.4736	2916084

**FIG. 7-54 IT J-BOX DIAGNOSTICS WEIGHT AND VOLTAGE PAGE**

*NOTE: The IT Web page shows all the Weight and Voltage values at once. So if you want to save time use the Web Browser IT page for troubleshooting.*

- The mV reading is a coarser reading than the mV/V or Weight readings. The mV reading is sufficient to balance the corners of your scale or vessel.
- These readings allow you to determine if the problem is in the instrument (internal) or in a load sensor(s) (external). The specification range for the Weight Controller is 0-15 mV. If you are getting a reading outside this range (15.5 mV, 3.1 mV/V Maximum or any negative values) the problem is exterior to the Instrument (most likely improper wiring). If you are getting a reading between 0-15 mV the reading is normal.

Step 6. Check the results:


- If all the load sensor readings are 0.00 there is something wrong between the HI 3030 and the HI 215IT Junction Box or with the Junction Box itself. The cable is disconnected or something is wrong with the Junction Box such that it is not transmitting the readings to the HI 3030 Weight Controller.
- If you do not get a reading for one or possibly two or more load sensors (Sensor 3 for example reads 0.00 or the reading is either larger or smaller than it should be)

and you know that the Load Sensors are connected to the Junction Box, the individual load sensor cable is disconnected from the junction box or the load sensor is malfunctioning.

Step 7. With this information you can quickly determine what the problem is and where it is located either from the Front Panel or Web Browser.

**Setting the Factory Defaults from the Web Browser**

Step 1. Click on “Set Factory Defaults”. The Set Factory Defaults page appears. (See Fig. 7-55)

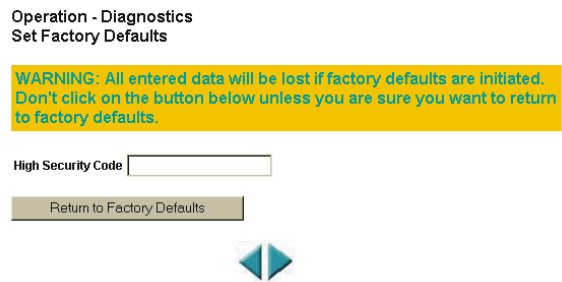


**FIG. 7-55 SET FACTORY DEFAULTS**

**WARNING: ANY AND ALL DATA WILL BE LOST IF FACTORY DEFAULTS ARE INSTALLED. THIS, INCLUDES EVERY PARAMETER THAT WAS CHANGED FOR INGREDIENTS, IP ADDRESS, EVERYTHING. THE INSTRUMENT IS RETURNED TO THE CONDITION IT WAS RIGHT FROM THE FACTORY.**

- Step 2. Enter the High Security Code Number.
- Step 3. Click on the Return to Factory Defaults button.
- Step 4. The Confirmation Page appears.
- Step 5. The page informs you that all Factory defaults have been set.
- Step 6. Click on “Back” to return to the previous page. The previous page appears.
- Step 7. Click on the left arrow to return to the Operation Diagnostics page.
- Step 8. Click on Home to return to the Weight Controller Home Page.

**Overview of Typical Load Cell System**

1. The typical system consists of one or more load cells/points, a summing junction box, and an HI 3030 Weight Controller. (See Figure 7-56).

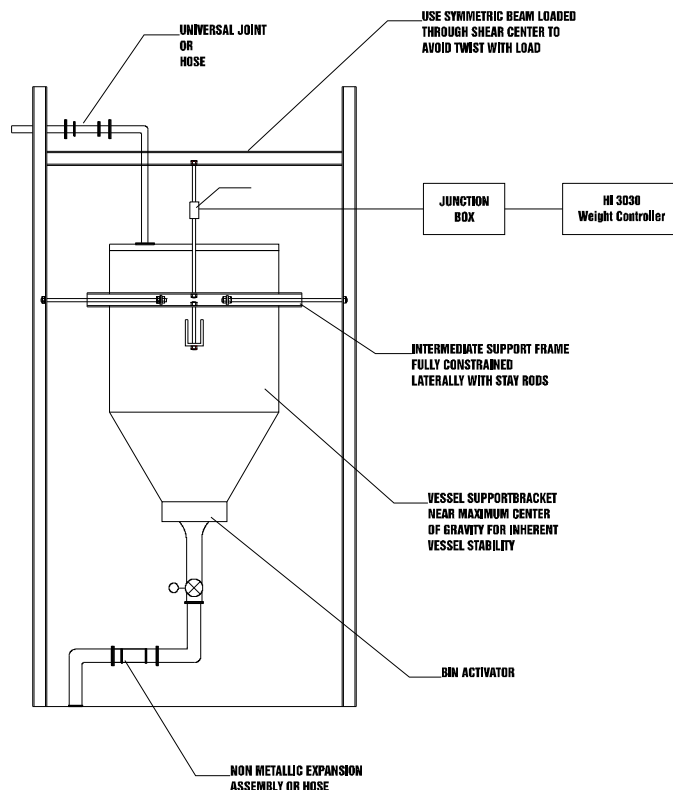

**FIG. 7-56 TYPICAL LOAD CELL SYSTEM**

2. Load Cell/Sensor/Point - is a strain gauge based force transducer, which generates an electrical signal proportional to the load applied to the scale. Load cells/points can be used any place a person needs to measure pressure, load, or torque. This can be accomplished by either Tension or Compression type load cells/points. The load cell/point takes as an input the 5 volts DC Excitation Voltage generated by the HI 3030, and depending upon how much weight is applied to the scale, generates a millivolt output (proportional to the weight, 0-10mv DC for 2mv/V load cells/points or 0-15mv DC for 3mv/V load cells/points).
3. Weight Controller - is part of the HI 3010 instrument which, among other functions, is used to power the load cell(s)/point(s), take the millivolt signal output from the load cell(s)/point(s), and digitize, interpret, communicate and display the results as a weight indication.

### Troubleshooting The Network Connections and Configuration with the "Ping" Tool

- Step 1. The Ping Tool is used from the root directory of the PC. Get to the Root directory. The Root Directory is the "C:/" Prompt.
- Step 2. If you do not know how to get to the Root Directory, check you Operating System User Guide or Manual for information on how to get to the root directory.

#### Selecting the module by number for Testing

*NOTE: You can only ping from the PC you cannot ping from an instrument.*

- Step 1. Type PING <space>IP address of the instrument you want to test. For Example:

**C:/PING 192.168.110.99**

- In our example we used the default address for all HI 3000 Series Instruments. The IP address you are testing will be different.

- Step 2. Press the Enter key on the PC.

Step 3. The PING utility starts sending out 56 signals and 64 signals should return if the unit is functioning correctly.

- If the instrument or network are configured incorrectly and cables are loose or not connected correctly, nothing prints out after the first line. Do the following:
  1. Check the Network cables and connectors to be sure they are tightly fastened and the correct cables for this application.
  2. Check the configuration to be sure that the instrument is configured correctly. (See Configuration IP Address in Chapter 6)
  3. Check the Ethernet card to be sure that is securely seated and that it is functioning correctly.
- If the unit is configured correctly and the Ethernet card is functioning correctly and the cables are the correct ones for this application and are securely fastened, 64 signals should be returned and the print out will reflect this fact.

*NOTE: NOTE: The Ping utility continues to send out signals (pings) until you exit the Ping Tool.*

- Simultaneously press the <Ctrl> key and the letter <C> key to stop the signals.

**Exiting the Root Directory**

Step 1. Type exit at the root directory prompt.

**C:/exit**

Step 2. Press the Enter key.


**About Solid State Relays With Light Loads**

There have been installations where solid state relays have been used and failed to shut off a solenoid or relay when de-energized. The actual problem comes from the internal snubbing network in parallel with the Silicon Controlled Rectifier (SCR) which does the actual switching. This network presents an impedance of 30K ohms, which means with 120 volts across, it will pass 4mA of AC current.

**SCR SWITCHING LOAD CIRCUIT**

The SCR itself presents no leakage current. Some solid state relay manufactures specify 20mA minimum load. This is based on the presumption a relay or solenoid will drop out with only 4mA through it, which is not always true. That may not be true. When switching a light load with a solid state relay across the line, you must look at the rated drop-

out current of the load, and if it is less than 4mA it may not turn off. The solution is to put a loading resistor in parallel with the light load, to be sure leakage current is sufficiently shunted away from the coil.

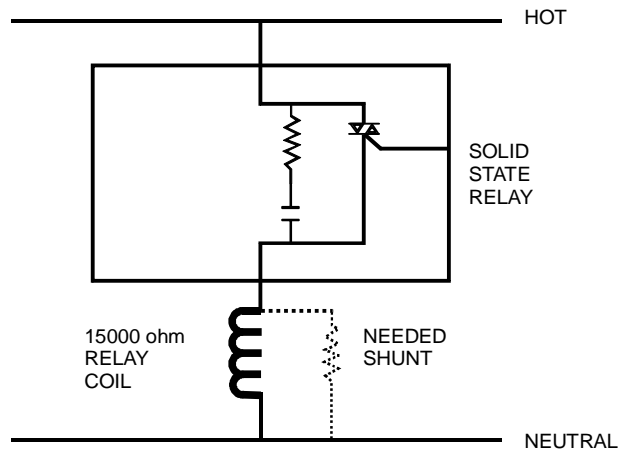

**FIG. 7-57 SCR SWITCHING LOAD CIRCUIT**

Assume a load like a relay with a coil of 15,000 ohms and of 5% of nominal drop-out. When the solid state relay is off, there will still be 1/3 of the line voltages across the relay, so it will not drop out. For the relay to have 5% of the line across it, it and a parallel shunt resistor must be 20 times less resistance than the 30K snubbing network, or 1.5K ohms. Use less than a 1.67K ohm parallel resistor and now total load is below 1.5K ohm or 80mA.

**General Policies and Information**

With over 70 years of industrial weighing experience and products in the field, Hardy Instruments continues to design, manufacture, install and support Hardy products worldwide. The following paragraphs describe Hardy's customer support services and equipment warranty.

*NOTE: Before returning any product to Hardy Instruments, call the Technical Service Department listed below for a Return Authorization Number. Have your company name, address, telephone, equipment model number, S/N, and a brief description of the problem ready to give to him. In addition, please have Appendix A completed and ready to FAX to us before calling.*

**FOR FURTHER INFORMATION CONTACT:**

**Technical Service Manager  
Hardy Instruments, Inc.  
3860 Calle Fortunada, San Diego, CA 92123-1825  
Telephone: (858) 278-2900  
FAX: (858) 278-6700  
Web Site: <http://www.hardyinst.com>  
E-Mail: [support@hardyinst.com](mailto:support@hardyinst.com)**

## Ordering Replacement Parts

Contact the Hardy Instruments Sales Department to order replacement parts and option boards. Have your equipment model number and serial number ready.

## System Support

Technical Service is provided as follows:

- New system start-up: Ensure that the installation is checked and correct; instruments are calibrated, and operators trained.
  1. Service: Engineers are trained and qualified to provide on-site installation, calibration, and maintenance.
  2. On-site training: A Hardy Support Representative can be scheduled to train your operations and maintenance personnel. This can be as simple as basic load cell theory or as complete as troubleshooting techniques which allow you to service your equipment.

## Warranty

A warranty problem may be handled by returning the product to the factory for repair or replacement under warranty.

- The Last Cal Type will tell you what Calibration was done on the instrument. This is important when you are not getting the readings you configured for the instrument.





## DICTIONARY OF MAPPING SYMBOLS

### Map Dictionary:

CMD0 - Specifies input and output locations for the command interface

DI - DeviceNet Input Table, as bits. DeviceNet tables are 125 words (16 bit) long.

DO - DeviceNet Output Table, as bits

DFI - DeviceNet Input, regarded as floats

DFO - DeviceNet Output, regarded as floats

DSI - DeviceNet Input, regarded as 16 bit integers

DSO - DeviceNet Output, regarded as 16 bit integers

DII - DeviceNet Input, regarded as 32 bit integers

DIO - DeviceNet Output, regarded as 32 bit integers

DTO - DeviceNet Output, regarded as text

DTI - DeviceNet Input, regarded as text

### HI - Hardy Input Table

- HI0.0 - HI0.4 = digital inputs

- HI1.X = status bits

HI1.0 = A/D error

HI1.1 = A/D failure

HI1.5 = Real time clock failure

HI1.6 = Motion

HI1.8 = NVR Failure

HI1.9 = Infrared Failure

HI2.0 = Setpoint 1 output

HI2.1 = Setpoint 2 output

HI2.2 = Setpoint 3 output

HI2.3 = Setpoint 4 output

HI2.4 = Setpoint 5 output

HI2.5 = Setpoint 6 output

HI2.6 = Setpoint 7 output

HI2.7 = Setpoint 8 output

HI2.8 = Setpoint 9 output

HI2.9 = Setpoint 10 output

HI2.10 = Setpoint 11 output

HI2.11 = Setpoint 12 output

HI2.12 = Scale 1 in Motion

HI2.13 = Scale 2 in Motion

HI2.14 = Scale 3 in Motion

HI2.15 = Scale 4 in Motion

### HSI - Hardy Input Table (Word)

HSI1 = Instrument Status Word

HSI2 = Setpoint Output Word

HSI3 = Command Status Word, Chan 1. This 16-bit word holds the result status of mapped commands.

HSI3.15 = Command Status Data Valid. This bit is set when the rest of the status bits are valid.

HSI4 = Command Status Word, Chan 2. This 16-bit word holds the result status of mapped commands.

HSI4.15 = Command Status Data Valid. This bit is set when the rest of the status bits are valid.

HSI5 = Command Status Word, Chan 3. This 16-bit word holds the result status of mapped commands.

HSI5.15 = Command Status Data Valid. This bit is set when the rest of the status bits are valid.

HSI6 = Command Status Word, Chan 4. This 16-bit word holds the result status of mapped commands.

HSI6.15 = Command Status Data Valid. This bit is set when the rest of the status bits are valid.

HSI7 = Watchdog Word. Each bit represents the corresponding node(bit0=Node0 etc.) sending data. Five seconds after the last data packet arrives from any node, its bit is set to zero.

HSI8,HSI9,HSI10,HSI11 - Status word for A/D channels 1-4

HSIX.0 = A/D error

HSIX.1 = A/D failure

HSIX.6 = Motion

### HO - Hardy Output Table

HO0.0-HO0.3 = Output Relay 1-4

HO0.7 = Software LED (on back of unit)

HO1.0-HO1.3 = Tare Channel 1-4

HO1.4-HO1.7 = Zero Channel 1-4

HO1.12-HO1.15 = Print Channel 1-4

HO2.0-HO2.3 = C2 Calibrate Chan 1-4

HO2.4-HO2.7 = Trad Cal Low Ch 1-4

HO2.8-HO2.11 = Trad Cal High Ch 1-4

HO3.0-HO3.9 = Send Custom Email 0-9

### HFI - Hardy Float Input Table

HFI4-7 = gross weight on chan 1-4

HFI8-11 = net weight on chan 1-4

HFI12-15 = peak weight on chan 1-4

HFI16-19 = Rate of Change on channels 1-4

### HFO - Hardy Float Output Table

HFO[ 0- 7] - 8 user defined floating point scratchpad variables, saved in non-volatile RAM

HFO9-20 - Setpoint 1-12 input

HFO21-24 - Tare Wt ch 1-4

HFO25-28 - Motion Tolerance ch 1-4

HFO29-32 - Zero Tolerance ch 1-4

HFO33-36 - AutoZero Tolerance ch 1-4

HFO37-40 - Capacity ch 1-4

HFO41-44 - Cal Low Wt ch 1-4

HFO45-48 - Span Wt ch 1-4

HFO49-60 - Setpoint 1-12 Target Wt  
HFO61-72 - Setpoint 1-12 Preact Wt  
HFO73-84 - Setpoint 1-12 Deadband Wt  
HFO85-HFO88 - Analog Output Card, Slot 0  
HFO89-HFO92 - Analog Output Card, Slot 1

**HSO - Hardy Short Output table. A table of 16 bit integers.**

HSO0 Setpoint and Motion Word  
HSO1-4 Unit of Measure Ch 1-4  
HSO5-8 Decimal Point Ch 1-4  
HSO9-12 Grad Size Ch 1-4  
HSO13-16 WaverSaver Ch 1-4  
HSO17-20 Averages Ch 1-4  
HSO21-24 Use Auto Zero Ch 1-4  
HSO25-28 Zero Reminder Ch 1-4  
HSO29-32 Tare Reminder Ch 1-4  
HSO33-36 Channel 1-4 On  
HSO37 AutoPrint On  
HSO38 IR Enabled  
HSO39 Printer Baud  
HSO40 Printer Parity  
HSO41 Printer Data Bits  
HSO42 DeviceNet Baud  
HSO43 DeviceNet Node

HSO44 RIO Baud  
HSO45 RIO Address  
HSO46 RIO Rack Size  
HSO47 RIO Quarter  
HSO48 RIO Last Quarter  
HSO49 ControlNet Address  
HSO50 Profibus Node Number  
HSO51 Profibus Out Size  
HSO52 Profibus In Size  
HSO53 Setup Menu Security  
HSO54 Calibration Menu Security  
HSO55 Options Menu Security  
HSO56 Mapping Menu Security  
HSO57 Medium Level Password  
HSO58 High Level Password

HSO59-62 Calibration Type Ch 1-4  
HSO67-70 Calibration Month Ch 1-4  
HSO71-74 Calibration Day Ch 1-4  
HSO75-78 Calibration Hour Ch 1-4  
HSO79-82 Calibration Minute Ch 1-4  
HSO83-86 Calibration Second Ch 1-4

**HTO - Hardy Text Output table.**

HTO0 Operator ID  
HTO1 Instrument ID  
HTO2-HTO5 Channel 1-4 Name

HTO6-HTO15 Custom Text 0-9

**HTI - Hardy Text Input table.**

HTI0-HTI3 Calibrator ID Ch 1-4  
HTI4 Model Number  
HTI5 Program Part Number  
HTI6 Firmware Revision

**HII - Hardy Integer Input table.**

HII0 IP Address  
HII1 IP Mask Address  
HII2 IP Gateway Address  
HII3 IP DNS Address  
HII4 Serial Number

**EO, EFO, ESO, EIO, ETO- Hardy Control Link Output tables**

EO = Hardy Control Link output, addressed as bits  
EFO = Hardy Control Link output, addressed as floats  
ESO = Hardy Control Link output, addressed as 16 bit integers  
EIO = Hardy Control Link output, addressed as 32 bit integers  
ETO = Hardy Control Link output, addressed as text

**OI, OFI, OSI, OSO, OII, OIO, OTI, OTO- Hardy Control Link Input tables, from Node 0**

OI = Hardy Control Link input from Node 0, addressed as bits  
OFI = Hardy Control Link input from Node 0, addressed as floats  
OSI = Hardy Control Link input from Node 0, addressed as 16 bit integers  
OII = Hardy Control Link input from Node 0, addressed as 32 bit integers  
OTI = Hardy Control Link input from Node 0, addressed as text  
1I, 1FI, 1SI, 1SO, 1II, 1IO, 1TI, 1TO- Hardy Control Link Input tables, from Node 1  
2I, 2FI, 2SI, 2SO, 2II, 2IO, 2TI, 2TO- Hardy Control Link Input tables, from Node 2  
...  
9I, 9FI, 9SI, 9SO, 9II, 9IO, 9TI, 9TO- Hardy Control Link Input tables, from Node 9  
UI, UFI, USI, USO, UII, UIO, UTI, UTO- Hardy Control Link Input tables, from Node 10  
VI, VFI, VSI, VSO, VII, VIO, VTI, VTO- Hardy Control Link Input tables, from Node 11  
...  
ZI, ZFI, ZSI, ZSO, ZII, ZIO, ZTI, ZTO- Hardy Control Link Input tables, from Node 15

**RI, RO, RFI, RFO, RSI, RSO, RII, RIO, RTI, RTO - RIO tables (used if you have an RIO option card)**

RI, RO = RIO input/output, addressed as bits  
 RFI, RFO = RIO input/output, addressed as floats  
 RSI, RSO = RIO input/output, addressed as 16 bit integers  
 RII, RIO = RIO input/output, addressed as 32 bit integers  
 RTI, RTO = RIO input/output, addressed as text

**CI, CO, CFI, CFO, CSI, CSO, CII, CIO, CTI, CTO - Communications Network tables (used if you have a ControlNet, EtherNet/IP or Profibus option card)**

CI, CO = Communication Network input/output, addressed as bits  
 CFI, CFO = Communication Network input/output, addressed as floats  
 CSI, CSO = Communication Network input/output, addressed as 16 bit integers  
 CII, CIO = Communication Network input/output, addressed as 32 bit integers  
 CTI, CTO = Communication Network input/output, addressed as text

**MI, MO, MFI, MFO, MSI, MSO, MII, MIO, MTI, MTO - Modbus tables (used if you have Modbus)**

MI, MO = Modbus input/output, addressed as bits  
 MFI, MFO = Modbus input/output, addressed as floats  
 MSI, MSO = Modbus input/output, addressed as 16 bit integers  
 MII, MIO = Modbus input/output, addressed as 32 bit integers  
 MTI, MTO = Modbus input/output, addressed as text

**HVO The members in this table are displayed in the configured units (lb, kg, oz, g)**

HVO0-3 = Zero Tolerance, channels 1-4  
 HVO4-7 = Motion Tolerance, channels 1-4  
 HVO8-11 = Auto Zero Tolerance, channels 1-4  
 HVO12-15 = Scale Capacity, channels 1-4  
 HVO16-19 = Calibration reference weight, channels 1-4  
 HVO20-23 = calibration span weight, channels 1-4  
 HVO24-27 = peak weight, channels 1-4  
 HVO28-31 = tare weight, channels 1-4



**Symbols**

!C2 Caps Unequal! 75  
 !Function Error! 75  
 !Not Allowed! 75  
 !Security Violation! 75  
 “clean” primary line 16

**Numerics**

0/Char. Button 23  
 10/100 base T Ethernet connection 34  
 10/100 BaseT Ethernet 1  
 14 AWG power line 16  
 2/ABC Button 22  
 32 bit integer 66  
 32 bit integer analog variable types 66  
 3rd party I/O 3  
 55 updates per second 28  
 6/MNO Button 23  
 8/TUV Button 23  
 9 terminal block 17

**A**

A - Guidelines for Instabilities on Formerly Operating Systems 77  
 A/D Convert Error 75  
 A/D counts 98  
 A/D Failure Error 75  
 About Basic Mapping 55  
 About Chapter 2 7  
 About Diagnostics 95  
 About Help 21  
 About Instrument ID 29  
 About IP Addresses 34  
 About Motion Tolerance 26  
 About Operator ID 29  
 About Setting the Clock 31  
 About Solid State Relays With Light Loads 110  
 About the Averages Parameter 28  
 About the Decimal Point Parameter 25  
 About the DeviceNet Parameters 45  
 About the Ethernet Parameters 34  
 About the Graduation Size Parameter 26  
 About The Gravitation Correction Factor 48  
 About the Scale Capacity Parameter 28  
 About the Serial Port Setup Parameters 30  
 About the Set LCD Contrast Parameter 33  
 About the Swivel/Wall Mount 12  
 About the Tare Limit Parameter 31  
 About the Tare Reminder Parameter 28  
 About the WAVERSAVER Parameter 29  
 About Timezones 32  
 About Traditional Calibration 51  
 About Unit of Measure 25  
 AC power 16

**Index**

ACCESSORIES 5  
 Add 66  
 ADJUST INGREDIENT 71  
 Allen-Bradley Remote I/O 1, 3  
 Alpha/Numeric value 22  
 Alphanumeric character LCD 21  
 alphanumeric entry 22  
 amount of deviation 26  
 Amount/4/GHI 23  
 Analog 1  
 analog equation 67  
 Analog Mapping 66  
 Analog Output 5  
 Analog Output (-4AN) 5  
 Analog Output Option 5  
 Analog tables 66  
 analog variables 67  
 AND 66  
 application specific process weighing instruments 1  
 Approvals 8  
 arrays of numeric entities 63  
 artificial zeroing 31  
 ASCII string 67  
 asterisk 73  
 auto print 30  
 Auto Zero Tolerance 98  
 auxiliary devices 106  
 average reading 103  
 Averages 7, 99  
 Averages Parameter 28

**B**

B - Guidelines for Instabilities on Formerly Operating Systems (Cont'd) 78  
 B1 - Guidelines for Instabilities on Former Operating Systems (Cont'd) 79  
 B2 - Guidelines for Instabilities on Formerly Operating Systems  
     Mechanical Stability and Configuration Settings. 80  
 Back 53  
 backspace function 22  
 Base Dimensions 8  
 Basic I/O Mapping Menu 71, 72  
 basic load cell theory 111  
 Basic Mapping Using Hardy Link 55  
 baud rate 30  
 Baud rates 4  
 bi-directional communications 6  
 Binding 47  
 binding 47  
 Block transfer commands 6  
 Boolean equations 67  
 Boolean Mapping 66  
 Boolean operations 66

boolean operations 66  
Boolean tables 66  
Boolean variables 67  
Built-in Smart Diagnostics (Knowledgebase) 1  
Button Functions 21

## C

C - Guidelines for Instabilities on Formerly Operating Systems 81  
C2 7  
C2 Cable 4  
C2 Cal Error 75  
C2 Cal Type 47, 51  
C2 Calibration From the Front Panel 47  
C2 Calibration From the Web Page 50  
C2 Load Points 17  
C2 load sensor 98  
C2 Sensitivity 98  
C2 weighing system 3  
C2® Calibration 3  
C2® Electronic Calibration 1  
C2® Load Point Connection 17  
C2® Second Generation Calibration 3  
Cable color Code 17  
Cable color Code for Non-C2 Load Points 17  
Cabling and Interconnecting 16  
CAL Failed 75  
Calibration completed OK 51  
CALIBRATION Menu 47, 51  
Calibration page 53  
calibration procedures 47  
Calibration Sub-menu 50, 53  
Calibration Techniques 7  
Calibrator 97  
Capacity 99  
captive screws 12  
certified test weight 52, 53  
Channels 17  
Checking the Device Data List 95  
Choose Display 102  
Clear Button 22  
closed containers 75  
Code Explanations 68  
Command Interface 68  
Common Mode Rejection 8  
Common Mode Voltage Range 8  
Communication cables 21  
compression gasket 12  
Configuration Menu 51  
Configuration page 52  
Confirmation Page 108  
Connectivity 3  
connector 75  
controlled static environment 75  
Control-Link Port 41  
Control-Link Port text field 41  
Core Technologies 47

corrective action 50  
cut off frequencies 29  
cycle power 41  
Cycle/7/PQRS Button 23

## D

data bits 30  
Data Menu 100  
data packets 34  
Day-dd field 43  
DCS 1  
Decimal Point Parameter 25  
Default Settings 68  
Defaults display 104  
Device Data List 95  
DeviceNet 5, 7, 21  
DeviceNet input and output tables 66  
DeviceNet input table 64, 68  
DeviceNet interface 3  
DeviceNet network 45  
DeviceNet output table 68  
DeviceNet Parameters 34  
DeviceNet tables 66  
Diagnostic Menus 95  
Diagnostics 100, 106  
Diagnostics Display 100  
Diagnostics menus 95  
Diagnostics Page 70  
Dimensions of the panel cutout 11  
disassembly 75  
Disassembly and Reassembly Notes and Cautions 75  
Dispensing A Vessel Using a Feeder 2  
Display 7  
Display Increments (Graduations) 7  
Do C2 Calibration 49  
Do C2 Calibration button 51  
Do Cal High button 53  
Do Cal Low button 53  
Do Cal Low Calibration 53  
Do Trad Cal 52  
dressed 16  
drives 45

## E

E - Non-Return to Zero 83  
Electrical Installation 16  
electrical parts 75  
electrical plug 75  
Electrostatic Discharge 12  
electrostatic discharge 75  
embedded controllers 45  
embedded web server 3  
Enclosure Front Panel 12  
Enclosure Size Requirements 11  
Environmental Requirements 8  
ESD 12, 15, 75

## Index

- EST 32
- Ethernet - 10/100 Base T 7
- Ethernet and DeviceNet installation 11
- Ethernet IP port 3
- Ethernet Network 34
- Ethernet Parameters 34
- EVEN 31
- Excitation Voltage 7
- Exit Button 22
- Extranet 1, 34
  
- F**
- F - Verify Individual Load Cell Milli-Volt Readings 84
- Factory Defaults 104
- Fail display 103
- FALSE 67
- Fanuc 6
- fastener knobs 13
- Filler/Dispenser Home Page 52, 108
- Filler/Dispenser system 75
- Filler/Dispenser/IBC 1
- Filling a Vessel Using a Feeder 2
- float 66
- flow chart 75
- follow proper safety procedures 75
- FOR FURTHER INFORMATION CONTACT 110
- Force Outputs 105, 106
- Force Outputs function 106
- Frequency 8
- Front Panel 21
- Front Panel NEMA 4 Seal 8
- full scale output sensitivity 98
- function Error 50
- function OK 50
  
- G**
- G - A/D Failure Error 86
- GE 6
- General Policies and Information 110
- General Troubleshooting Flow Chart Index 76
- Getting Started 21, 47
- Getting the Parameter Information on the Web Browser 70
- global industry-standard communication network 45
- GMT 32
- GMT time adjustment 32
- Grad 97
- Graduation Size 97
- gravity 48
- gravity correction factor 48
- Gravity Corrector Factors table 49
- Greenwich Mean Time 32
- Greenwich, England 32
  
- H**
- H - Mechanical Inspection 87
- Hardy C2® Second Generation 47
- Hardy input and output tables 66
- Hardy Instruments C2 certified load sensors 3
- Hardy Link Basic Mapping 62
- Hardy Link Parameter 34
- Hardy Technical Support Technician 95
- Hardy Web Site 1
- Hardy Web Tech 1, 3
- Hardy-Link 35
- Hardy-Link packet output 40
- Hardy-Link pull down list 40
- Help 21
- Help Button 21
- Help button 21
- Help Dialog 21
- HF10 67
- HF11 67
- HI 215IT Junction Box 100, 101
- HI 215IT Series Junction Boxes 5
- HI 215JB Series Junction Boxes 5
- HI 3000 User's Guide 1
- HI 3000-CD 5
- HI 3000-GF 5
- HI 3000-MB 5
- HI 3000-OM 5
- HI 3000-RC 5
- HI 3000-TM 5
- HI 3030 Panel Mount 11
- HI 3030's INTEGRATED TECHNICIAN™ 1
- High Security Code Number. 108
- higher-level controllers 45
- Hour-hh field 43
- http
  - [//www.hardyinstruments.com](http://www.hardyinstruments.com) 1
- Humidity Range 8
- Hysteresis 95
  
- I**
- I/O Mapping 71
- individual Boolean variable 66
- Infrared (IR) 7
- Ingr./1 Button 22
- Input 7
- Input Resistance 100
- Input States display 105
- input table 67
- Installation of Secure Memory Module 18
- Installing Printed Circuit Boards 14
- Installing the HI 3030 in a Swivel/Wall Mount 12
- Installing the HI 3030 Weight Controller 12
- Installing the HI 3030 Weight Controller in a Panel 11
- Instrument ID 29
- Instrument Local I/O 8
- INTEGRATED TECHNICIAN 1
- INTEGRATED TECHNICIAN™ 4, 95, 100
- INTEGRATED TECHNICIAN™ (IT) 100
- interface 5

Internet 34  
Internet (World Wide Web) 1  
Intranet 1, 34  
IT Web page 108

## J

J - Electrical Inspection 88  
J9 terminal block 17  
-JB 4  
Junction Box 101  
Junction Box Wiring 17

## K

K - Load Sharing and Load Sensor Checkout 89  
key pad 1  
knurled knobs 15

## L

Last Cal time 97  
Last Cal Type 111  
latitude 48  
leakage current 110  
Left arrow button 22  
Level Monitoring 2  
LHS 67  
LHS (Left Hand Side) 67  
List of Alarms 75  
list of Destinations 71  
listens and transmits 41  
live load 52  
load cells 47  
Load Point cables 21  
Load Sensor number 48, 50  
Lock Washers 75  
LVDT and Half Bridge Load Cells/Sensors 17  
LVDT Tension Sensor - MB Series Connection 18

## M

M - Weight Reading Stops Incrementing 90  
Main Board 15  
Main Board rear plate 15  
Manual Button 22  
map the Source 71  
mapped data 72  
Mapped I/O 1, 3  
mean squared variation 103  
Mechanical Installation 11  
mechanical noise 3, 29  
MilliVolt (mV) 101  
Millivolt per individual Scale Load Sensor 101  
Millivolt readings 101  
Milli-Volt/Volt (mV/V) 101  
Minute-mm field 43  
Mixed Mapping 67  
Month-mm field 43  
Motion Error 75

Motion Tolerance 99  
motor starters 45  
Mounting Kit 11  
Mounting Options 4  
Multiply 66

## N

N - Blank Screen 91  
National Bureau of Standards (NBS) 4  
National Institute of Standards and Technology (NIST) 4  
National Type Evaluation Program (NTEP) 4  
neatly bundled 16  
Negate 66  
NEMA 4 & 4X 12  
NEMA 4X 5  
NIST/NTEP Option (-NTEP) 4  
No C2 Sensor 75  
nominal drop-out 110  
Non-C2 Load Point Connection 17  
NONE 31  
Non-Linearity 7  
Normally Open 106  
NOT 66  
Not Mapped 73  
-NTEP 4  
NTEP certification 41  
NTEP Mode parameter 41  
NTEP Option Installation 18  
NTEP Seal and label 19  
number of graduations 26

## O

O - Display Stuck on a Screen 92  
ODD 31  
offset 67  
OK to Fill Input Parameter 34  
OLE technology (DCOM) 5  
Online Tech Support Knowledge Base 3  
Operating Temperature Range 8  
Operation/Diagnostics - Weight & Voltage page 107  
Operator ID 29  
Option Cards Configuration 35, 43  
OR 66  
Ordering Replacement Parts 111  
original point of removal 75  
Output Relay #1 106  
Output Relay Forced Closed 106  
output table 63  
Outputs 72  
Overall depth 11  
Overview of Typical Load Cell System 108

## P

Pacific Standard Time 33  
packet output 34



## Index

Panel Cutout Specifications 11  
Panel Mount (Model # HI 3010-PM) 8  
Panel Mount Collar 12  
panhead screw 15  
parallel shunt resistor 110  
PARAMETER NUMBER 67  
Parameter Numbers 68  
PARAMETER VALUE 67  
parameters 95  
PARAMID 67  
parity 30  
Pass display 103  
PC Boards 15  
performance diagnostics 1  
Peripherals/System Components 4  
Personal Digital Assistant (PDA). 21  
Phillips head screw driver 15  
Physical Characteristics 8  
Ping Tool 109  
PING utility 110  
Platform and Floor Scale Bases 5  
PLC® 1  
Power 8  
power and relay circuit card 16  
Power and Utility Requirements 8  
Power Input J1 16  
PP# = Program Part Number 95  
pre-startup 106  
Prime Meridian 32  
Print Button 22  
printed circuit boards 75  
printer port 3  
process weighing 1  
Profibus 1, 6  
Profibus (Process Fieldbus) 6  
program version 95  
Programmable Logic Controllers (PLC) 6  
Provide Feedback link 3  
push buttons 45

## R

rated drop-out current 110  
read only 97  
READINTEGER 67  
rear cover 13  
reassembly 75  
re-calibrate 97  
Recommended load cell cabl 17  
Ref Point 48  
Reference Point 48  
Reference Weight 50  
Reference Weight field 50  
Remote I/O 6  
Removing Printed Circuit Boards 15  
repairs 75  
Replacement or Additional CD's 5  
Resolution 7

Return to Factory Defaults button 108  
Return to Zero Test 104  
Right arrow button 22  
Root directory 109  
RS 232 4  
RS NetWorx® 3  
RS-232 serial port 3

## S

Scale # Screen 101  
Scale Capacity 98  
Scale Capacity Parameter 28  
Scale Millivolt/Volt display 103  
SCR SWITCHING LOAD CIRCUIT 110  
Screws 75  
Secure Memory Module 18  
Secure Memory Module (SMM) 4  
Security Violation 50  
Selectable Predetermined 6  
sensitivity specifications 98  
Sensor Input Options 4  
Sensor Type 48  
Sensor Type choices 48  
sensors 45  
Sequential Batch Control 2  
Serial Number 99  
Serial Port 4  
Serial Port Parameters 30, 34  
Serial RS 232 8  
Service Manuals 11  
Set Clock Parameter 31  
Set Date/Clock Parameters 43  
Set LCD Contrast Parameter 33  
Set the Span Value 52  
Setup/3/DEF Button 23  
short integer 66  
Siemens 6  
Silicon Controlled Rectifier (SCR) 110  
simple operator interfaces 45  
sliding average 28  
slotted head screwdriver 12  
small fasteners 75  
Small Logic Controllers (SLC) 6  
smart devices 5  
SMM 4, 18  
SMM (Secure Memory Module) 1  
solenoid 110  
solid state relays 110  
Spacers 75  
Span Value 52, 97  
Span Weigh 53  
Span Weight field 53  
Special (Command) Mapping) 67  
Specifications 7  
Specifications for a Standard Instrument 7  
Specifications for Peripherals/Systems Components 9  
Stability Test 103

- Standard Interfaces 7
- Standard SPST (Form A) Setpoint Relays 7
- Standby Display 95
- Start Button 21
- Starting Up for the First Time 23
- Stop Button 21
- Storage Temperature Range 8
  - sum 4
- Summary Display 100
- Support Section 1
- Swivel bracket 13
- Swivel Material 9
- Swivel Mount 12
- Swivel Mount (HI 3010-MB) 8
- Swivel Mount brackets 13
- swivel mounted 1
- syntax 67
- system diagnostics utility 100
- System Integrity Check and Fault Determination From the Front Panel 95
- System Integrity Check and Fault Determination From the PDA 106
- System Support 111

## T

- Tare Limit Parameter 31
- Tare Reminder Parameter 28
- Tare Weight 40
- Technical Support Department 1
- Temperature Coefficient 8
- Tension or Compression type load cells 109
- terminal blocks 17
- Test and Data Menu 95, 100
- Test button 107
- Test Channel #1 button 107
- Test Data Display 100
- Test Data List 18
- test weight 52
- Test/9 button 4, 100
- Test/9/WXYZ Button 23
- Texas Instruments 6
- The Secure Memory Module 4
- The WAVERSAVER® Parameter 29
- tied 16
- Timezone field 43
- Too Hi Error 75
- Too Lo Error 75
- Trad Cal Error 75
- Traditional 7
- Traditional Cal Menu 52
- Traditional Calibration 52
- traditional calibration 4, 47
- Traditional Calibration From the Front Panel 51
- Traditional Calibration From the Web Page 52
- troubleshooting 75
- troubleshooting techniques 111
- Troubleshooting The Network Connections and Config-

- uration with the "Ping" Tool 109
- TRUE 67

## U

- UDP packet output 34
- Unit of Measure Parameters 25
- Units/5/JKL Button 23
- Universal Power Supply 8
- universal power supply 16
- Unmap 73
- Unpacking 11
- Up/Down - Left/Right Buttons 22
- Update Rate 7
- User Guide 11
- User././@ Button 23
- Using IT From the Front Panel 100

## V

- Valid Ranges 68
- vibratory forces 29
- View Input States 105
- Voltage & Weight 100
- Voltage & Weight Displays 100
- Voltage and Weight 100
- VPN 1
- VPN (Virtual Private Network) 34

## W

- wall mount 12
- WAP enabled devices 3
- Warranty 111
- Washers 75
- Watts available for DeviceNet Power 8
- WAVERSAVER 3, 7
- WAVERSAVER® 1, 3, 24
- WAVERSAVER® technology 3
- Web Browser 21, 102
- Weight (lb kg, gr., oz) 101
- Weight Controller Configuration From the PDA 38
- Weight Controller Configuration From the Web Page 39
- weight hopper 31
- wiring harness 75
- WRITEFLOAT 67
- WRITEINTEGER 67
- WRITESTRING 67

## Y

- Year-yyyy field 43


## Z

- Zero Count 97
- Zero counts 97
- Zero Ct 52
- zero point 52
- Zero Reminder Parameter 26

## Index

Zero Tolerance 98  
Zero Value 52



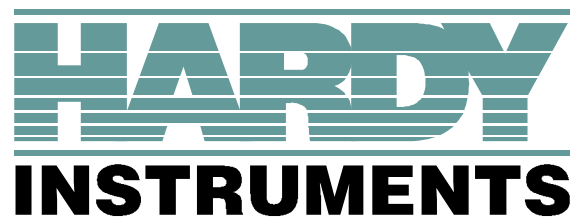

**9440 Carroll Park Drive, Suite 150, San Diego, CA 92121**  
**Telephone: 1-800-821-5831    FAX: (858) 278-6700**  
**Web Address: <http://www.hardyinstruments.com>**