



## Weight Controller


**HI 4050**

**User's Guide**

Hardy Instruments Document Number: 0596-0303-01 REV U



## Local Field Service

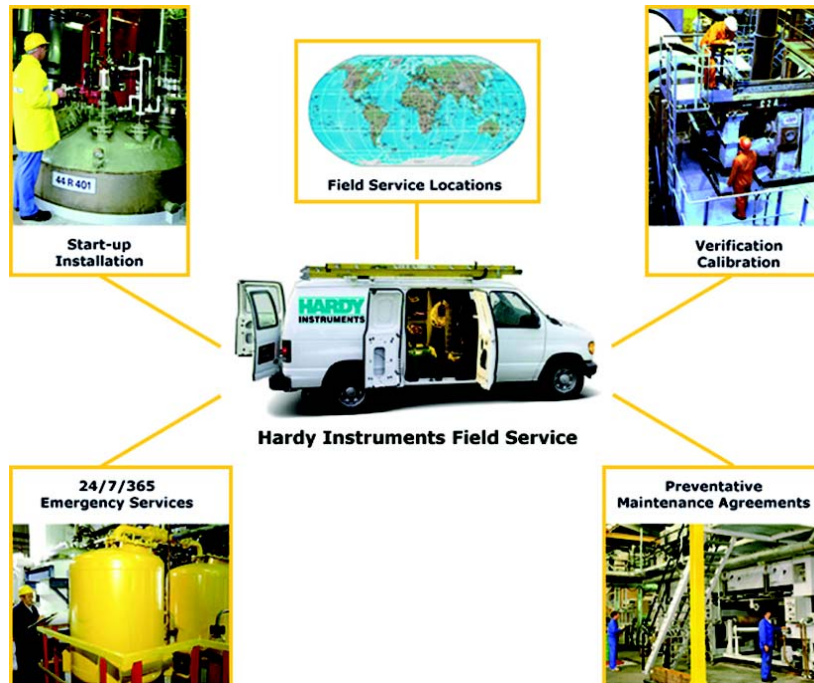

Hardy has over 200 field technicians in the U.S., and more positioned throughout the world to assist you in your support needs. We also have factory engineers who will travel to your facility anywhere in the world to help you solve challenging applications. We're ready to support you with:

- **Installation and start-up**
- **Routine maintenance and certification**
- **Plant audits and performance measurement**
- **Emergency troubleshooting and repair**

To request Emergency Service and Troubleshooting, Start-up, Installation, Calibration, Verification or to discuss a Maintenance Agreement please call **800-821-5831 Ext. 9550** or Emergency Service after hours (Standard Hours 6:30 AM to 5:30 PM Pacific Standard Time) and weekends **Ext. 9550**.

## Outside the U.S

Hardy Process Solutions has built a network of support throughout the globe. For specific field service options available in your area please contact your local sales agent or our U.S. factory at **+1 858-292-2710, Ext. 9550**.

● ● ● ● ● ●

Contents

|   |    |
|---|----|
| Resolution - - - - -                          | 9  |
| Display - - - - -                             | 9  |
| Display Increments (Graduations)- - - - -     | 9  |
| Limits and Ranges - - - - -                   | 9  |
| Excitation Voltage - - - - -                  | 9  |
| Averages - - - - -                            | 9  |
| Input - - - - -                               | 10 |
| Key Pad - - - - -                             | 10 |
| Non-Linearity - - - - -                       | 10 |
| Digital Voltmeter - - - - -                   | 10 |
| C2® Maximum Cable Length- - - - -             | 10 |
| WAVERSAVER®- - - - -                          | 10 |
| Power and Utility Ranges and Limits - - - - - | 10 |
| Voltage - - - - -                             | 10 |
| Frequency - - - - -                           | 10 |
| Power - - - - -                               | 10 |
| Battery - - - - -                             | 10 |
| Common Mode Rejection - - - - -               | 11 |
| Environmental Ranges and Limits - - - - -     | 11 |
| Operating Temperature Range - - - - -         | 11 |
| Storage Temperature Range - - - - -           | 11 |
| Temperature Coefficient - - - - -             | 11 |
| Humidity Range - - - - -                      | 11 |
| Maximum Altitude for Installation - - - - -   | 11 |
| Approvals - - - - -                           | 11 |
| Physical Characteristics - - - - -            | 12 |
| Panel Mount - - - - -                         | 12 |
| Din Rail Mount - - - - -                      | 12 |
| Wall Mount - - - - -                          | 12 |
| Option Cards - - - - -                        | 12 |
| Analog Option Card - - - - -                  | 12 |
| Current Outputs - - - - -                     | 12 |
| Voltage Output- - - - -                       | 12 |
| Resolution - - - - -                          | 12 |
| Accuracy - - - - -                            | 12 |
| Digital I/O Card - - - - -                    | 13 |
| Outputs - - - - -                             | 13 |
| Inputs - - - - -                              | 13 |
| Network Option Cards - - - - -                | 13 |
| Profibus Card - - - - -                       | 13 |
| RIO Card - - - - -                            | 13 |
| DeviceNet Card - - - - -                      | 13 |
| ControlNet- - - - -                           | 13 |
| Ethernet RJ45 - - - - -                       | 13 |



|                  |  |           |
|------------------|--|-----------|
| <b>Chapter 4</b> | <b>Configuration</b>                                       | <b>41</b> |
|                  | Ethernet Network Configuration                             | 41        |
|                  | IP Setup   | 42        |
|                  | LAN Connection   | 42        |
|                  | DHCP Configuration Using the Front Panel                   | 42        |
|                  | Displaying the Complete DHCP IP Address                    | 43        |
|                  | Fixed IP Configuration Using the Front Panel               | 43        |
|                  | Direct Connection  | 44        |
|                  | Direct Connect Hardware                                    | 44        |
|                  | Windows PC Configuration                                   | 44        |
|                  | Windows 2000   | 44        |
|                  | Windows XP   | 45        |
|                  | Windows 7  | 45        |
|                  | Direct Connect Configuration - HI-4050                     | 46        |
|                  | Setting an IP from the Front Panel                         | 46        |
|                  | Network Options Configuration                              | 47        |
|                  | Options Setup from the Web Page                            | 47        |
|                  | DeviceNet  | 48        |
|                  | Remote I/O   | 50        |
|                  | Blind Unit Operation Setup                                 | 51        |
|                  | Viewing the I/O Card Display                               | 51        |
|                  | Ethernet/IP™   | 53        |
|                  | Configuring Ethernet/IP from the Web page                  | 53        |
|                  | Rate of Change (-ROC) Option Configuration                 | 55        |
|                  | Configuring Rate of Change From the Browser                | 55        |
|                  | ROC Configuration from the Front Panel                     | 56        |
|                  | Configuring Rate of Change                                 | 56        |
|                  | Modbus TCP/IP  | 57        |
|                  | Enabling Modbus TCP/IP from the Front Panel                | 57        |
|                  | Configuring MODBUS - TCP/IP Over Ethernet (10 socket max.) | 61        |
|                  | Error Messages:  | 61        |
|                  | Analog Card Option Configuration                           | 62        |
|                  | Analog Card Configuration from the Web Interface           | 62        |
|                  | Configuring the Analog Card from the Front Panel           | 64        |
|                  | Digital I/O Option Card                                    | 65        |
|                  | PROFIBUS® Configuration                                    | 66        |
|                  | Initialization Process                                     | 67        |
|                  | Profibus-DP .GSD File                                      | 67        |
|                  | Pre-Initialization Procedures                              | 67        |
|                  | Initialization Procedures                                  | 68        |
|                  | DP State (Read Only)                                       | 71        |
|                  | WD State (Read Only)                                       | 71        |
|                  | Baud Rate  | 71        |

|   |           |
|---|-----------|
| ControlNet Option Card - - - - -                                    | 72        |
| Instrument Setup Configuration - - - - -                            | 73        |
| Working from the 4050 Display- - - - -                              | 73        |
| Parameters Configured - - - - -                                     | 75        |
| Unit (of Measure) Parameter - - - - -                               | 75        |
| Instrument ID Parameter - - - - -                                   | 75        |
| Operator ID Parameter - - - - -                                     | 76        |
| Decimal Point Parameter - - - - -                                   | 76        |
| RANGE: 0-5 (default 2) - - - - -                                    | 76        |
| Graduation Size Parameter - - - - -                                 | 77        |
| Number of Averages Parameter - - - - -                              | 77        |
| The WAVERSAVER® Parameter - - - - -                                 | 78        |
| Low Pass Filter Parameter - - - - -                                 | 79        |
| Motion Tolerance Parameter - - - - -                                | 79        |
| Zero Tolerance Parameter (Gross Weight)- - - - -                    | 80        |
| AutoZero and AutoZero Tolerance Parameters (Gross Weight) - - - - - | 80        |
| Tare Weight Parameter (Net Weight) - - - - -                        | 81        |
| Capacity Parameter- - - - -   | 81        |
| RANGE: .000001 - 999999 . (Default 999999) - - - - -                | 81        |
| Certification Parameter - - - - -                                   | 82        |
| LCD Contrast Parameter - - - - -                                    | 82        |
| Printer and Time Setup Parameters- - - - -                          | 83        |
| Printer / Scoreboard Setup - - - - -                                | 83        |
| Setup From the 4050 Interface - - - - -                             | 84        |
| Configuring Date and Clock - - - - -                                | 84        |
| Setup From the Web Interface - - - - -                              | 85        |
| Setup From the 4050 Interface - - - - -                             | 85        |
| Set Points- - - - -   | 86        |
| Parameters- - - - -   | 87        |
| Deadband Limit, Preact Limit, and Type - - - - -                    | 87        |
| Mode - - - - -  | 87        |
| Target Weight - - - - -   | 87        |
| Type - - - - -  | 87        |
| Entering Set Points from the Web Page - - - - -                     | 88        |
| Entering Set Points from the Front Panel - - - - -                  | 89        |
| HI 4050 Security - - - - -  | 90        |
| Configuring HI 4050 Security from the Web Page - - - - -            | 90        |
| Setting Parameter Security - - - - -                                | 91        |
| Configuring Security from the Front Panel - - - - -                 | 92        |
| IP Setup Program (necessary for Blind HI-4050 Units)- - - - -       | 93        |
| <b>Chapter 5 Calibration- - - - -</b>                               | <b>95</b> |
| Pre-Calibration Procedures - - - - -                                | 95        |

|                  |   |            |
|------------------|---|------------|
|                  | Mechanical Check Procedures - - - - -                           | 95         |
|                  | Electrical Check Procedures - - - - -                           | 96         |
|                  | Calibration Procedures - - - - -                                | 97         |
|                  | C2 Calibration - - - - -  | 97         |
|                  | Reference Weight - - - - -                                      | 97         |
|                  | Gravitation Correction - - - - -                                | 97         |
|                  | Traditional Calibration - - - - -                               | 101        |
|                  | Load Check - - - - -  | 101        |
| <b>Chapter 6</b> | <b>Mapping - - - - -</b>  | <b>105</b> |
|                  | About Mapping - - - - -   | 105        |
|                  | Glossary of Mapping Terms - - - - -                             | 105        |
|                  | Setpoints - - - - -   | 105        |
|                  | How Mapping Works - - - - -                                     | 106        |
|                  | Input and Output Tables - - - - -                               | 106        |
|                  | Local Input - - - - -   | 107        |
|                  | Volatile and Non-Volatile Memory - - - - -                      | 108        |
|                  | Mapping to an Output - - - - -                                  | 108        |
|                  | Example #1 Mapping to a Network Output - - - - -                | 109        |
|                  | Data Types - - - - -  | 110        |
|                  | Example #2 Mapping an Input - - - - -                           | 111        |
|                  | Advanced Mapping - - - - -                                      | 112        |
|                  | Boolean Mapping - - - - -                                       | 112        |
|                  | Example #3 Mapping an Network Input to a Local Output - - - - - | 113        |
|                  | Example #4 Mapping a Switch - - - - -                           | 114        |
|                  | Analog Mapping - - - - -  | 115        |
|                  | Mixed Mapping - - - - -   | 115        |
|                  | Special (Command) Mapping - - - - -                             | 115        |
|                  | Setting up the Command Interface Mapping - - - - -              | 115        |
|                  | The Command Interface - - - - -                                 | 116        |
|                  | Performing a Parameter List (Dump) - - - - -                    | 117        |
| <b>Chapter 7</b> | <b>Operation - - - - -</b>                                      | <b>119</b> |
|                  | Getting Started - - - - -                                       | 119        |
|                  | The 4050 Front Panel - - - - -                                  | 119        |
|                  | Overview - - - - -  | 120        |
|                  | Button Functions - - - - -                                      | 120        |
|                  | Up/Down - Left/Right Buttons - - - - -                          | 120        |
|                  | Enter Button - - - - -  | 120        |
|                  | Exit Button - - - - -   | 120        |
|                  | Clear Button - - - - -  | 120        |
|                  | Zero Button - - - - -   | 120        |
|                  | Tare Button - - - - -   | 120        |



|  |     |
|--|-----|
| Print Button - - - - -                             | 121 |
| Entering Alphanumeric Values - - - - -             | 121 |
| Starting Up for the First Time - - - - -           | 121 |
| Set Points Configuration- - - - -                  | 122 |
| About Set Points - - - - -                         | 122 |
| Target - - - - -                                   | 122 |
| Entering Set Points from the Web Page - - - - -    | 123 |
| Entering Set Points from the Front Panel - - - - - | 124 |

## **Chapter 8 Troubleshooting - - - - - 125**

|  |     |
|--|-----|
| Disassembly and Reassembly Notes, Warnings and Cautions - - - - -                  | 125 |
| Error Messages - - - - -   | 126 |
| Trouble Shooting Using Integrated Technician (IT®) - - - - -                       | 127 |
| Stability Test ALL - - - - -   | 128 |
| PASS/FAIL and Variance Test - - - - -  | 128 |
| Raw A/D Count - - - - -  | 128 |
| Raw A/D Average Counts - - - - -   | 128 |
| Weight and Voltage ALL - - - - -   | 128 |
| Weight - - - - -   | 129 |
| mV/V are DC voltage signals between 0-30 mv/v - - - - -                            | 129 |
| RTZ (Return to Zero) Test - - - - -  | 129 |
| IT Test - - - - -  | 129 |
| Sensor Number - - - - -  | 129 |
| Audit Trail- - - - -   | 129 |
| General Troubleshooting Flow Chart Index- - - - -                                  | 131 |
| A - Guidelines for Instabilities on Formerly Operating Systems - - - - -           | 132 |
| A1 - Guidelines for Instabilities on Formerly Operating System (Cont'd)- - - - -   | 133 |
| B - Guidelines for Instabilities on Formerly Operating Systems (Cont'd) - - - - -  | 134 |
| B1 - Guidelines for Instabilities on Formerly Operating Systems (Cont'd) - - - - - | 135 |
| B1 - Guidelines for Instabilities on Formerly Operating Systems (Cont'd) - - - - - | 136 |
| C - Guidelines for Instabilities on Formerly Operating Systems - - - - -           | 137 |
| E - Non-Return to Zero (Must be connected to an IT® Summing Box - - - - -          | 138 |
| F - Verify Individual Load Cell Millivolt Readings - - - - -                       | 139 |
| G - Calibration Failed: Not Enough Counts Between ZERO and SPAN - - - - -          | 140 |
| H - Mechanical Inspection- - - - -   | 141 |
| J - Electrical Inspection - - - - -  | 142 |
| K - Load Sharing and Load Sensor Checkout - - - - -                                | 143 |
| M - (*****) or (- - - - -) ERROR - - - - -   | 144 |

|   |          |
|---|----------|
| N - Weight Controller's Front Display is Blank - - - - -                | 145      |
| P - SD Card Diagnostics and Losing Memory at Power Cycles - - - - -     | 146      |
| Tests and Diagnostics - - - - -   | 147      |
| Diagnostic testing from the Web page - - - - -                          | 147      |
| Parameters - - - - -  | 148      |
| System and Load Cell Tests - - - - -                                    | 149      |
| Overview of Typical Load Cell System - - - - -                          | 149      |
| INTEGRATED TECHNICIAN - - - - -   | 150      |
| Stability Test - - - - -  | 151      |
| Weight and Voltage Tests - - - - -                                      | 152      |
| Return to Zero test - - - - -   | 155      |
| Checking Inputs and Optional Outputs - - - - -                          | 155      |
| Viewing System C2 Load Sensors - - - - -                                | 156      |
| SMM-SD Card Directory - - - - -   | 157      |
| Audit Trail and Event Log - - - - -                                     | 158      |
| Checking Network Connections and Configuration with the "Ping" Tool - - | 158      |
| Selecting the module by IP Address for Testing - - - - -                | 158      |
| General Policies and Information - - - - -                              | 159      |
| Ordering Replacement Parts - - - - -                                    | 159      |
| Software Downloads for Your HI 4050 - - - - -                           | 159      |
| Warranty - - - - -  | 162      |
| System Support (Requires Purchase Order or Credit Card) - - - - -       | 162      |
| Technical Service - - - - -   | 162      |
| <b>Appendix A    About Timezones - - - - -</b>                          | <b>1</b> |
| Greenwich Mean Time - - - - -   | 1        |

# Chapter 1

## Overview

.....

### General Introduction to the HI 4050 Weight Controller

This Manual describes installation, setup and troubleshooting procedures for the HI 4050 Weight Controller. Be sure to read and understand all cautions, warnings, and safety procedures in this manual to ensure safe operation and repair of this instrument.

Hardy Instruments sincerely appreciates your business. We encourage input about the performance and operation of our products from our customers. Should you not understand any information in this manual or experience any problems with this product, please contact our Technical Support Department at:

**Phone:** (858) 278-2900

**Toll Free:** 1-800-821-5831

**FAX:** (858) 278-6700

**E-Mail:**

hardysupport@hardysolutions.com

hardyinfo@hardysolutions.com

Or visit our web site at:

**<http://www.hardysolutions.com>**

Our web site provides information about our products, process weighing, web tension and vibration analysis applications. You can also update the HI 4050 User Guide. The latest revised manuals are available FREE in the product selection pull down menu on our Web Site. Other pages on the site provide answers to questions about load points, process weighing, vibration analysis, tension control or other Hardy Instruments products. Be sure to sign up for the Hardy Newsletter to get the latest information on all Hardy products and services. For answers to technical issues and service problems, check the Hardy WebTech on our Hardy Web Site. Most problems can be resolved by the Hardy WebTech, 365 days a year, 24 hours a day 7 days a week. You can still contact a technician by phone during our normal operating hours (6:30 AM to 5:30 PM Pacific Time) if necessary.

### Description

The Hardy HI 4050 is a single-channel, stand alone Weight Controller that comes with a backlit LCD display and key pad or DIN Rail mountable blind remote. The Weight Controller is designed to accommodate any number of configurations which include the following:

### Mounting Options

- Din Rail Mount
- Panel Mount

### Power Supply

- AC
- DC

### Standard Communication

- RS 232 - Printer or scoreboard display (user selectable; two-way communications are not supported). This port can transmit weight data to a serial printer or scoreboard. Baud rates are user selectable at 600, 1200, 2400, 4800, 9600 or 19,200. (Default 9,600)

### Communication Options

- Ethernet/IP™ - Key Code Activation Required
- DeviceNet™ - Slave
- Modbus TCP/IP
- RIO
- ControlNet
- PROFIBUS®

### I/O Options

- DIO - four digital outputs
- Three isolated digital inputs

Standard features include a selectable 10/100 Base T Ethernet port and embedded web server to link performance diagnostics and configuration data to and from your local Intranet, Extranet, VPN or via the Internet (World Wide Web). An available DeviceNet interface allows multiple applications to be viewed and controlled from one display and enables 3rd party I/O to be easily added to the system. Mapped I/O saves you wiring costs by distributing the I/O where you need it, at the process or in the control room. The available communication protocols allow you to integrate the controller into your corporate network, enabling data to be transferred to and from a PLC® (Programmable Logic Controller), DCS (Distributed Control System) or computer network.

### NOTE

*PROFIBUS® is a registered trademark of PROFIBUS International.  
DeviceNet™ and Ethernet/IP™ are trademarks of ODVA™  
PLC® is a registered trademark of the Rockwell Corporation.*

The HI 4050 INTEGRATED TECHNICIAN, in conjunction with an IT Junction Box, provides built-in diagnostics enabling you to troubleshoot and diagnose your weighing system from the front panel, web browser, or over a network. You can read individual load sensor voltages and weights, make comparisons, and isolate individual system components for quick and easy troubleshooting.

### Typical Applications

- Filling a Vessel Using a Feeder - Adding (by gain-in-weight) of a material into a container on a scale.
- Sequential Batch Control - Adding (by gain-in-weight) of multiple ingredients one at a time into a single weight hopper.
- Level Monitoring - Maintaining material levels in various vessels.
- Dispensing to a Vessel - Adding of a material (by loss-in-weight) from a vessel on a scale to a container which is off the scale.

### Connectivity

The HI 4050 enables operators to use the selectable 10/100 Base T Ethernet port and its embedded web server to link performance, diagnostics and setup data to and from your Intranet, Extranet, VPN or the Internet. The available communication interface lets you view and control multiple applications from a display and add third-party I/O to the system. A single RS-232 serial port is configured as a printer port.

### Digital I/O

Digital inputs are used to either signal a change in state or send the commands to tare, zero, or calibrate the instrument. Two setup options provide alternatives for application-specific requirements. The standard option uses only the HI 4050's three built-in external digital inputs, which are sufficient for many applications.

### Mapped I/O

Mapped I/O saves wiring costs by distributing the I/O where you need it, at the process or in the control room. Available interfaces provide communications to PLC, DCS or computer controlled systems.

### WAVERSAVER®

Mechanical noise (from other machinery in a plant environment) can be present in forces larger than the weight forces being measured. The HI 4050 is fitted with WAVERSAVER technology that eliminates the effects of vibratory forces present in all industrial weight control and measurement applications. By factoring out almost all of the ambient vibratory forces, the controller can separate out the actual weight data. WAVERSAVER can be configured from the front panel to ignore noise with frequencies as low as 0.25 Hz. One of four higher additional cut off frequencies can be selected to provide a faster instrument response time. The default factory setting is 1.00 Hz vibration frequency immunity.

## C2<sup>®</sup> Calibration

C2 Electronic Calibration enables a scale system to be calibrated electronically without using certified test weights. A C2 weighing system consists of up to eight load sensors, a junction box, interconnect cable and an instrument with C2 capabilities, such as the HI 4050 Weight Controller. Digital information within every Hardy Instruments C2-certified load sensor details its unique performance characteristics. The HI 4050 Weight Controller reads the performance characteristics of each load sensor and detects the quantity of load sensors in the system. The calibration process uses a reference point from the front panel or the Web Server. The reference is normally zero (no weight on the scale) but can be a known weight on the scale.

### NOTE

*WAVERSAVER<sup>®</sup> and C2<sup>®</sup> are registered trademarks of Hardy Instruments Inc.*

## Integrated Technician<sup>™</sup>

In conjunction with an IT junction box, the HI 4050 INTEGRATED TECHNICIAN<sup>™</sup> (IT<sup>®</sup>) system diagnostics program makes it possible to diagnose weighing system problems from the front panel or over the available networks. IT reads individual load sensor voltages and weights and isolates individual system components for quick and easy troubleshooting.

## Secure Memory Module (SMM - SD)

The Secure Memory Module is a non-volatile secure digital card that stores critical HI 4050 configuration, calibration and setup data, thereby protecting this information from loss and/or corruption. The SD card dramatically increases the HI 4050's non-volatile storage capacity and flexibility. Furthermore the SD card can be read by a PC with an SD card reader. Each controller is equipped with one SD Card, for additional SD cards and SD card readers, writers and adapters, contact your local Hardy Representative or the Hardy Instruments Service Center for price and availability.

### NOTE

*Hardy supports Hardy branded SD cards and readers only. Other non-Hardy branded products are not supported.*

## Model Numbers

An example of a possible number: **HI 4050-DR-AC-EIP-N2-N3**

The abbreviations shown below indicate that the unit is an HI 4050 with a blind Din Rail mount that is AC powered with an Ethernet/IP communication port.

## Model Number Option Symbols

### Mounts

- **DR:** Din Rail
- **PM:** Panel Mount with Local or Remote Display
- **PMWS:** panel mount NEMA4 enclosure for wall mounting with local display

- **DRWS:** panel mount NEMA4 enclosure for wall mounting without local display

### Power Supply

- **AC:** AC Voltage
- **DC:** DC Voltage

### Internal Options

- **N1:** No Internal Option
- **EIP:** Ethernet/IP
- **MD:** Modbus/TCP/IP
- **ROC:** Rate of Change Mode

### Network Options

- **N2:** No External Network
- **CN:** ControlNet
- **RIO:** Remote I/O
- **DN:** DeviceNet
- **4ANA:** Analog Output Option - Network Slot
- **PB:** Profibus

### Auxiliary Options

- **N3:** No Auxiliary Options
- **4ANB:** Analog Output Option - Option Slot
- **DIO:** Digital I/O Option - Option Slot

## Rate of Change Option

The ROC option measures and displays the rate at which a material enters or is dispensed from the scale over a period of time. ROC data uses a 100-entry register. New weight values are written to the register at the rate of 1/100th of the time base. The first register is subtracted from the 101th Register, which is one time base older than the first register. The time frame can be set to units per second, minute, or hour. A time base of discrete values is selectable from 1 to 1800.

## Analog Output Option

Each of four independent analog outputs per option card is configured from the front panel or the embedded web server. Two outputs are voltage and two are current. This option allows the transmission of gross, net, available Rate-of-Change (ROC) or “mapped” weight. Mapped weights can be 0-5V or 0-10V on the voltage outputs and 0-20 mA or 4-20 mA on the current outputs. It also is possible to span these ranges over a portion of the weight data with a resolution of 16,000 counts for each channel. All parameters can be mapped to these Analog Outputs.

### NOTE

*The analog output is not isolated. An external 4-20 ma isolator may be required for stable readings.*

### **Digital I/O Option**

While the standard HI 4050 includes three built-in external digital inputs, the digital I/O card option adds three more digital inputs (isolated) and four digital outputs (non-isolated).

### **RIO Option**

Under license from The Rockwell Corporation, Hardy Instruments Inc. has developed a Remote I/O Interface for the HI 4000 Series. This interface is fast, field proven, requires minimal wiring, requires no special software drivers, and is standard on many Rockwell programmable controllers.

### **ControlNet Option**

ControlNet is an open network protocol used in industrial automation applications for linking an HI 4050 to any ControlNet-capable device (such as PLCs)

### **Profibus Option**

The PROFIBUS-DP (Decentralized Peripherals) communication profile is designed for efficient field-level data exchange. The central automation devices, such as PLC/PC or process control systems, communicate through a fast serial (RS485) connection with distributed field devices, e.g. PLCs. To begin communicating weighing parameters between an HI 4000 Series controller and a PLC, PC or DCS system controller, you need only to load the \*.GSD file and set the node address.

### **DeviceNet Option**

The DeviceNet Network is an open, industry-standard communication network protocol designed to provide an interface through a single cable from a programmable controller or PC directly to all HI 4000 series instruments as well as smart devices such as sensors, push buttons, motor starters, simple operator interfaces, drives and other weigh modules.

### **Communication Options**

Chapter Four provides information concerning the purpose and setup procedures for the following network options:

- DeviceNet
- Ethernet/IP
- Modbus/TCP/IP
- PROFIBUS
- ControlNet
- RIO



● ● ● ● ● ●

## General

- Signal Voltage Range: -.5 to 16.5mV @ 5V

#### **Key Pad**

- 9 tactile keys
- 4 Soft Keys (Mappable)

#### **Non-Linearity**

- 0.0015% of Full Scale

#### **Digital Voltmeter**

- Accuracy  $\pm 2\%$  of full scale

#### **C2<sup>®</sup> Maximum Cable Length**

- 1000' for C2, Non-C2 load cells, or JB Summing Card
- 500' for IT Summing Card

#### **WAVERSAVER<sup>®</sup>**

- 7.5 Hz
- 3.5 Hz
- 1.0 Hz - Default
- 0.5 Hz
- 0.25 Hz

### **Power and Utility Ranges and Limits**

#### **Voltage**

- 24 VDC (Class 2)
- AC: 120/240 VAC Universal (Optional)

#### **Frequency**

- 50/60 Hz

#### **Power**

- 10 Watts maximum with options

#### **Battery**

- Used to maintain time and date only.
- Replaceable Lithium batteries
  - Panasonic model BR1220 3V, 35mAh or BR1225 3V, 48mAh
  - Rayovac model BR1225 3v, 50mAh

- 100dB @ 50-60Hz

### Operating Temperature Range

- -10 to 40° C (14° to 104° F) using AC current
- -10 to 60° C (14° to 140° F) using DC current

- -10 to 50° C (14° to 122° F) using AC/DC current

- DR Type: -40 to 85° C (-40 to 185° F)
- PM Type: -30 to 70° C (-22 to 158° F)

- Less than 0.005% of full scale per degree C for zero and span

- 0-90% (non-condensing)

- 2000 Meters (6,562 Feet)

- UL
- CUL
- Hazardous Class I, Division 2, Groups A,B,C,D, T4A and Class II, Division 2, Groups F, G, T4A
- NTEP
- Canadian Weights and Measures
- CE
- CB
- DeviceNet (ODVA)
- Ethernet/IP (ODVA)

## Physical Characteristics

### Panel Mount

- Display: Width: 7.07" (179.7)  
Height: 4.05" (102.8)  
Depth from panel: 0.73" (18.4)
- Case Dimensions: 2.99" H x 5.65" W x 3.125" D (75.9 mm H x 143.51 mm W x 79.37 mm D)
- Case Material: Aluminum Alloy (6063-T5)
- Weight: 1.85 pounds (.84 Kilograms)
- Enclosure Rating: Front Panel NEMA 4, 4X Seal

### Din Rail Mount

- Depth: 4.0" (101.6mm) Measured from bottom of the Din Rail Mounting Feet to top of the enclosure)
- Case: 2.99" H x 5.65" W x 3.125" D (75.9 mm H x 143.51 mm W x 79.37 mm D)

### Wall Mount

- Stainless steel NEMA4 wall mount, with or without display  
Dimensions: 11.50" h x 8.28" w x 5.54" d (292.1 h x 210.3 w x 140.6 d mm)

## Option Cards

### Analog Option Card

#### Current Outputs

- 0-20 mA
- 0- 500 $\Omega$  load at 20mA

#### Voltage Output

- 0-10 V, max current 10mA

#### Resolution

- 16,000 counts over 0 to 20mA and 0 to 10V range

#### Accuracy

- $\leq 0.25\%$  error typical,  $\leq 0.5\%$  max error over time/temperature

## Digital I/O Card

The Inputs and Outputs must be mapped. (See Chapter 6, Mapping)

### Outputs

- Four non-isolated outputs
- Pulled to ground and current-limited to 250mA.
- Weak 5V pull-up (min 3V at 5mA out)
- Protected against input over voltage above 30V (short term)

### Inputs

- Three optically insulated inputs
- 24 VDC input (30 VDC Maximum)
- 3V min input (high), 1V max input (low)
- Input load about 350 $\Omega$

## Network Option Cards

### Profibus Card

**Connector:** 9-pin serial connector, female

### RIO Card

**Connector:** 5-pin connector

### DeviceNet Card

**Connector:** 5-pin connector

### ControlNet

**Connector:** BNC channels A&B

### Ethernet RJ45

**Connector:** RJ45 Ethernet/IP connector on motherboard

### Analog Out

**Connector:** 8-pin connector



## Chapter 3 Installation

.....

Chapter 3 covers unpacking, cabling, interconnecting and installing the HI 4050. Users and service personnel should be familiar with the procedures in this chapter before installing or operating the HI 4050.

### NOTICE:

**This equipment is suitable for use in Class I, Division 2, Groups A,B,C,D, T4A & Class II, Division 2, Groups F, G, T4A or Non-Hazardous Locations Only.**

**WARNING - EXPLOSION HAZARD - SUBSTITUTION OF COMPONENTS MAY IMPAIR SUITABILITY FOR DIVISION 2.**

**AVERTISSEMENT – Risque d’explosion – La substitution de composants peut diminuer la conformité pour la Division 2**

**WARNING - EXPLOSION HAZARD - DO NOT DISCONNECT EQUIPMENT UNLESS POWER HAS BEEN SWITCHED OFF OR THE AREA IS KNOWN TO BE NON-HAZARDOUS**

**AVERTISSEMENT – Risque d’explosion – Ne pas débrancher l’équipement à moins que l’alimentation soit coupée ou que la zone ne présente pas de risques**

## Unpacking

- Step 1. Before signing the packing slip, inspect the packing for damage, and report damage of any kind to the carrier company.
- Step 2. Check to see that everything in the package matches the bill of lading.
- Step 3. If items are missing or you have any questions, contact Customer Service at:

### **Hardy Process Solutions**

9440 Carroll Park Drive

San Diego, CA 92121

**Phone: (800) 821-5831**

**FAX: (858) 278-6700**

**Web Site:** <http://www.hardysolutions.com>

**E-Mail:** [hardysupport@hardysolutions.com](mailto:hardysupport@hardysolutions.com)

- Step 4. Record the model number and serial number of the HI 4050. Store them in a convenient, secure location for reference when contacting Hardy Instruments Customer Service Department or to buy parts or firmware upgrades.


## Mechanical Installation

### Installing the HI 4050 Weight Controller in a Panel

**WARNING - YOU MUST INSTALL THE HI 4050 IN A NEMA 4X ENCLOSURE WHEN USING THIS INSTRUMENT IN A CLASS I DIV 2 ENVIRONMENT.**

**AVERTISSEMENT – Vous devez installer le HI 4050 dans un boîtier NEMA 4X lors de l'utilisation de cet instrument dans un environnement de catégorie I Division 2**

- Step 1. Make sure that all Electrostatic Discharge (ESD) precautions are taken before and during installation.
- Step 2. A paper template comes with the product (0578-0071-01). Make the hole pattern in the panel door or cover using the dimensions provided on the diagrams below.

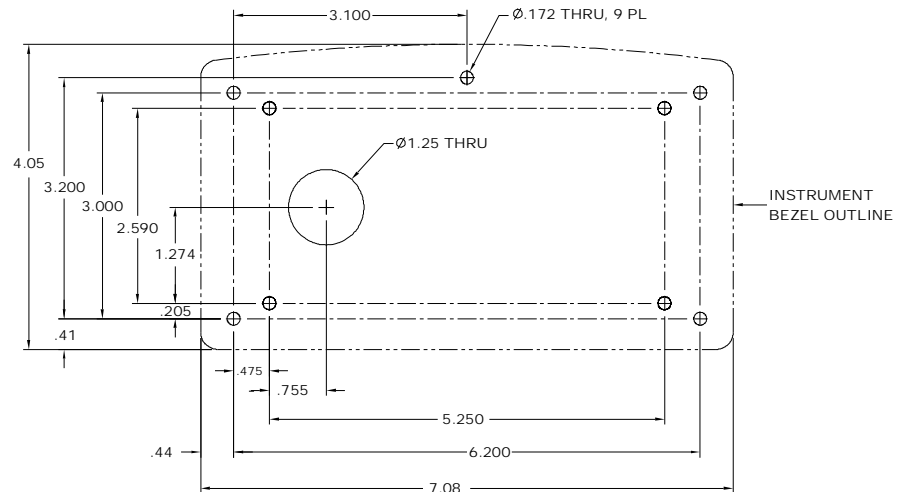

**Panel Hole Dimensions (drawn from the back and not displayed to scale)**

Printers and copy machines can distort or reduce the template measurements. Verify the dimensional accuracy of any paper template before use.




## PANEL HOLE DIMENSIONS (RETROFIT)

**CAUTION:** We recommend installing the HI 4050 in a NEMA 4, 4X or IP 55 rated enclosure or better.


**ATTENTION** Nous vous recommandons d'installer le HI 4050 dans un boîtier NEMA 4, 4X ou IP 55 ou mieux.

**NOTE** *If you are mounting the panel in a wash down or hazardous area, you must drill the top center hole and install with the 6-32 x 1/2 inch screw.*

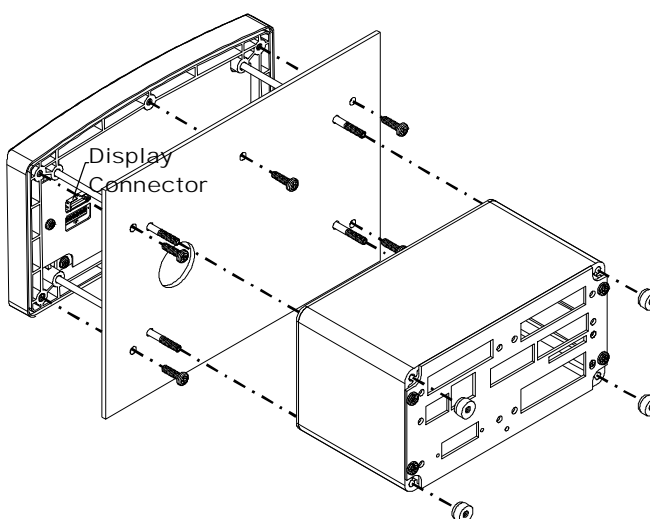


- Step 3. Using a Phillips-head screwdriver, install the five 6-32 x 1/2 inch screws that fasten the bezel to the panel. Use a torque screw driver and torque each screw to 10 inch/pounds. **DO NOT OVERTIGHTEN!**
- Step 4. Thread the four-threaded rods through the appropriate holes in the panel and into the bezel. For the retrofit you don't have to place the rods through the holes.
- Step 5. Hand tighten each rod until you can no longer turn the rod. Do not force the rods or use pliers of any kind.

- Step 6. Put the display cable and connector through the hole in the panel door or cover and plug the display connector into the display header in the bezel. Smooth any sharp or rough edges.
- Step 7. Gently slide the electronic enclosure onto the threaded rods while making sure the display cable glides easily and does not kink.
- Step 8. Move the electronic enclosure toward the panel until it stops. Thread the four 6-32 thumb screws onto the threaded rods until tight. Do not use pliers on the thumb screws.

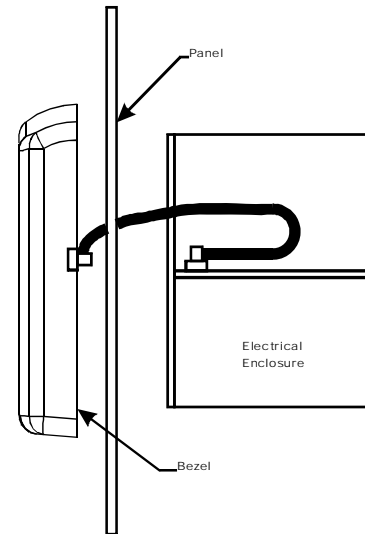

**NOTE**

*The cable orientation is important to insure you do not pinch the ribbon cable when assembled.*

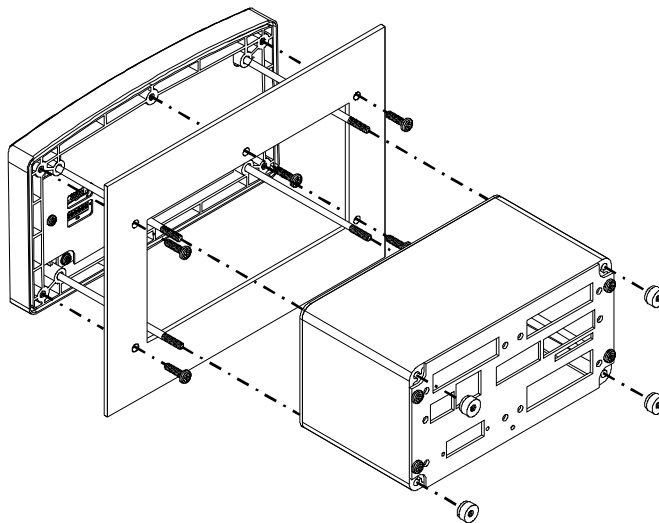

**Installing the Wall Mount HI 4050xxWS Weight Controller**

**Wall mounting to dry wall backing:** The enclosure's four mounting holes are located two top and two lower sides. With these top and bottom holes spaced 6" horizontally, a support back plate will need to be installed. This backing plate material choice is subject to environmental conditions. Indoor, outdoor, hazardous areas or severe wash down conditions.

For this example we are recommending a 3/4" thick 24"x24" piece of MDX plywood, mounted flat and level to create a strong flat mounting surface for the HI4050PMWS and HI4050DRWS enclosure.

It is very important to install the enclosure on a flat surface. When the four enclosure mounting screws are tightened on a warped surface the enclosures NEMA 4/4X seal will be jeopardized.

Mount the plywood to the level surface, insuring you are screwing into two adjacent wall studs. Insure the four screws are flush and positioned to not interfere with the enclosure's four lag screws 3/8"x2". Drill 5/32" pilot holes to avoid splitting the wall studs. With the plywood secured to the wall, use a spirit level and install the enclosure to the plywood, using four 14-1 wood screws.


Verify the door closes and seals properly. You may need to use shims to insure the surface is level.

#### **Blind Units (no display)**

The front display is not necessary for the HI-4050 to operate as a scale controller. Blind units can be fully configured using the Web browser communication and the IP setup program provided on the system CD.

## DIN Rail Installation HI 4050 Weight Controller

Step 1. Snap the two DIN rail mounting feet (shown on right) into the two holes on the front panel of the electronic enclosure appropriate for the desired mounting orientation.

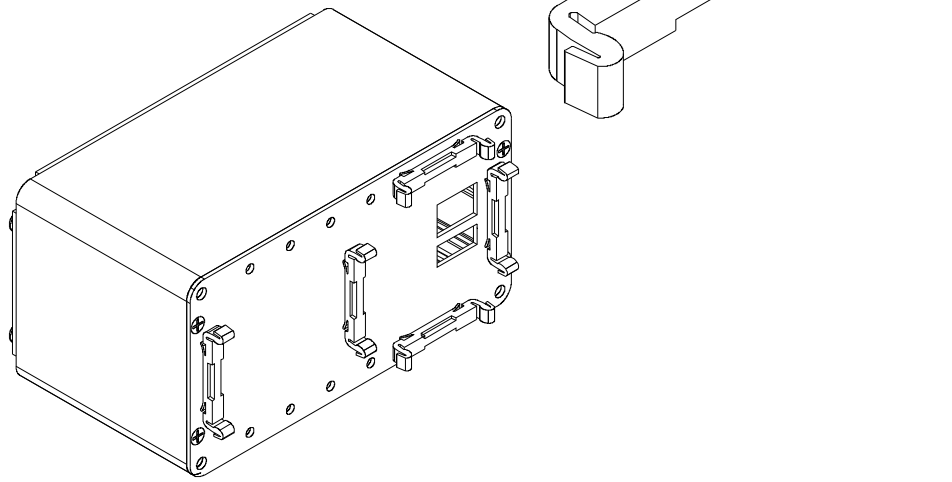

Step 2. When installing, push the mounting feet until you hear a snapping sound. The snap means they are mounted correctly.

Step 3. After installation, check each mounting foot to ensure it is seated correctly.

### CAUTION:

**If you do not hear a snapping sound, the mounting feet are not mounted correctly and the instrument may be loose, which may interfere with other electrical equipment or wiring.**

### ATTENTION

**Si vous n'entendez pas un claquement, cela signifie que les pieds de l'appareil ne sont pas installés correctement et l'instrument n'est pas stable, ce qui peut provoquer des interférences avec les autres équipements électriques ou câblage.**

*There are several horizontal and vertical mounting options. It is required that at least two mounting feet be used per enclosure.*


Step 4. To mount the enclosure onto a DIN rail, place the mounting feet on the DIN Rail and firmly press down until the mounting feet snap onto the rail.

## Remote Display Installation


Step 1. Install the Electronic Enclosure on a DIN Rail or in a panel within 100 feet (30.5 meters) of the remote display.

Step 2. Use any 6 wire, shielded cable (Minimum 22 AWG).

- Step 3. A Template is shipped with the instrument. Use a ruler to verify that the holes displayed on the template match the measurements displayed on the template.
- Use the template to cut the five holes required for mounting the display on a wall or on the door of an enclosure.

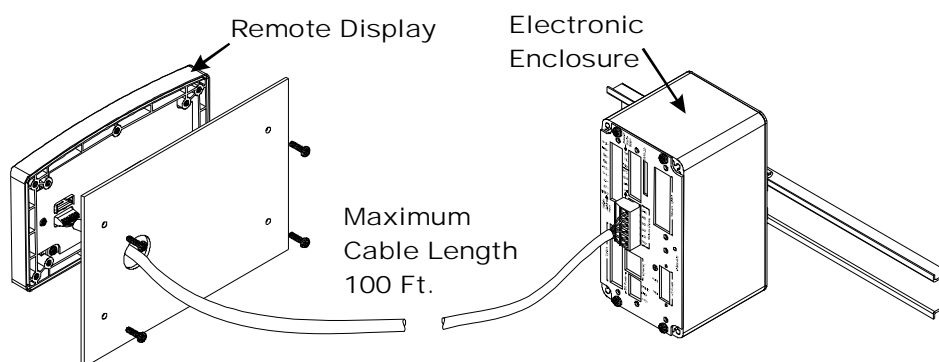

- Step 4. Connect the cable wires to the display and the Electronic Enclosure.

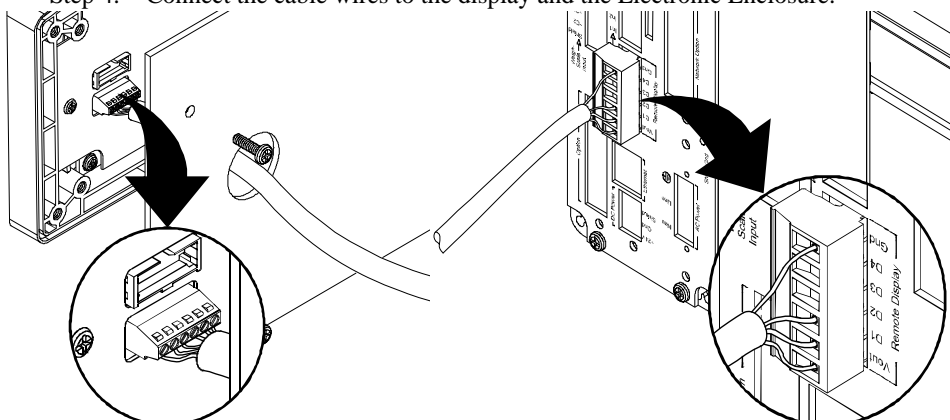

- Step 5. Strip enough insulation off the cable wires so that you can connect the wires to The Electronic Enclosure and Remote Display connector.

**WARNING - Always turn the instrument off before disconnecting the display connector. Do not hot-swap the display connector. Doing so will cause property damage or personnel injury.**

**AVERTISSEMENT – Toujours éteindre l'appareil avant de débrancher le connecteur d'écran. Ne pas changer le connecteur d'écran sans veiller à éteindre le courant au préalable. Cela pourrait causer des dégâts matériels ou des risques de blessures.**

- Step 6. Plug the Cable connector into the Remote Display header at the front panel of the Electronic Enclosure. Put the cable through the large hole you cut in the surface where you are going to mount the display. Smooth the large hole to prevent cable damage.
- Step 7. Strip enough insulation off the cable wires so you can connect the wires to the Display connector mounted at the back of the display. Wire the cable connectors as shown in the table below:


| DISPLAY          | ELECTRONIC ENCLOSURE |
|------------------|----------------------|
| Voltage In (Vin) | Voltage Out (Vout)   |
| D1               | D1                   |
| D2               | D2                   |
| D3               | D3                   |
| D4               | D4                   |
| Ground (Gnd)     | Ground (Gnd)         |

- Step 8. Use a Phillips-head screwdriver and install the four 6-32 x 1/2 inch screws that fasten the bezel to the panel or wall. Use a torque screw driver and torque each screw to 10 inch/pounds. **DO NOT OVERTIGHTEN!**

### Installing a Remote Slave Display

If you only want a remote display and do not want the functionality from the front panel keyboard, you can install a remote display by doing the following:

- Step 1. Use any 4 wire (Shielded) cable (Max 20 AWG / Min 22 AWG - Maximum cable length: 100 feet [30.48 meters]. Do not connect terminals D3 & D4 on either end of the Remote Display cable.
- Step 2. Connect the cable to the display connector.
- Step 3. Plug the connector into the Electronic Enclosure Rear panel header.

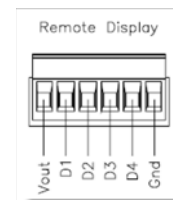

| DISPLAY          | ELECTRONIC ENCLOSURE |
|------------------|----------------------|
| Voltage In (Vin) | Voltage Out (Vout)   |
| D1               | D1                   |
| D2               | D2                   |

| DISPLAY                    | ELECTRONIC ENCLOSURE       |
|----------------------------|----------------------------|
| D3 Not Used do not Connect | D3 Not Used do not Connect |
| D4 Not Used do not Connect | D4 Not Used do not Connect |
| Ground (Gnd)               | Ground (Gnd)               |

**NOTE**

*You can still configure and operate the HI 4050 from the Web Browser.*


**Connecting Two Displays**

You can connect up to two displays by connecting one at the front panel and one at the rear panel. However, the display connected to the rear panel will have no keyboard functionality. Connecting the display at the front panel (panel mount) requires the use of the short cable that comes with the unit.

- Step 1. Install the display to the front panel per Panel Mount instructions above.
- Step 2. Use any 4 wire (Shielded) cable and wire the rear panel connector per Remote Display instructions above.

# Installing the SMM-SD Memory Card

- Step 1. Slide the SMM-SD card into the SMM-SD slot on the rear panel label side up.
- Step 2. Push in the SMM-SD card until a snap indicates that the card is seated.

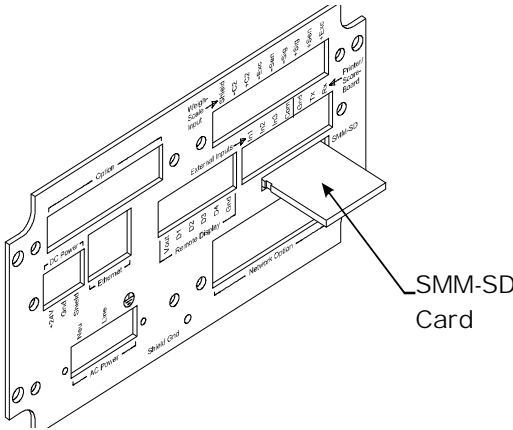

**NOTE**

*The rear panel may have plugs mounted above the SMM-SD slot. When removing these plugs, avoid accidentally disconnecting the SMM-SD card.*

- Step 3. To remove the SMM-SD card, gently push the card in towards the instrument and release the card. The card will pop out a little allowing you to completely remove it from the housing.


Step 4. Always store the SMM-SD card in a static-free enclosure and in a secure environment so as not to lose the information stored on the card.

## Load Point Installation

### NOTE

Use a torque screw driver to insure the smaller 4-40 screws are tightened to 7 inch/lbs (8.06 kg/cm) and the larger #6 and #8 screw to 10 inch/lbs (11.42 kg/cm)

### Rear Panel

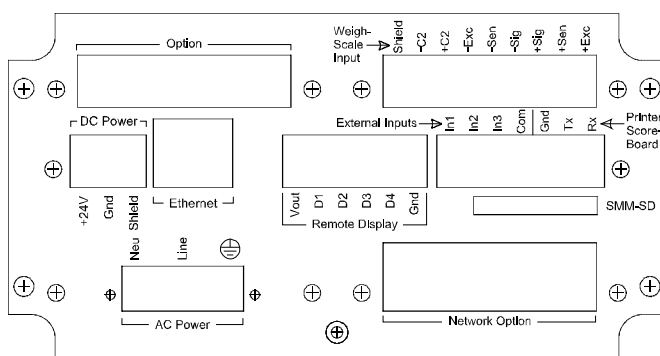

### C2® Load Point Connection

We recommend the use of C2 cable from the instrument to the junction box. Note the color codes for C2 load points (left to right facing the rear panel). Match the load sensor's color coding to ease trouble shooting.

| Load cell connector<br><u>Rear panel 9 pin</u>   | C2 cable TB9 7 pin<br><u>Junction Box Connector</u>   | Load cell color codes<br><u>3 pin connector</u>   |
|--|---|---|
| <ul style="list-style-type: none"> <li>• Shield Ground Wire</li> <li>• C2: -Violet</li> <li>• C2: +Grey</li> <li>• EXC: -Black</li> <li>• SEN: -Brown</li> <li>• SIG: -White</li> <li>• SIG: +Green</li> <li>• SEN: +BLUE</li> <li>• EXC: + RED</li> </ul> | <ul style="list-style-type: none"> <li>• EXC: -Black and SEN: Brown</li> <li>• EXC: + RED and SEN: +BLUE</li> <li>• Shield Ground Wire</li> <li>• C2: +Grey</li> <li>• C2: -Violet</li> <li>• SIG: +Green</li> <li>• SIG: -White</li> </ul> | <ul style="list-style-type: none"> <li>• EXC: + RED</li> <li>• EXC: -Black</li> <li>• Shield Ground Wire</li> </ul> <p><b><u>4 pin connector</u></b></p> <ul style="list-style-type: none"> <li>• C2: +Grey</li> <li>• C2: -Violet</li> <li>• SIG: +Green</li> <li>• SIG: -White</li> </ul> |



- Step 1. Remove the factory-installed jumpers from the terminal block if you are connecting an 8-wire cable from the junction box.
- Step 2. Connect the cable (Recommended load cell cable: Hardy Instruments Prt. # 6020-0001) wires to the channel terminal block according to the cable color code.
- Step 3. Plug the terminal block into the Weigh Scale Input connector on the rear panel.

### Non-C2 Load Point Connection

#### NOTE

*Cable color codes vary between vendors, check with your supplier for the color code for your non-C2 load point. If you are using the Integrated Technician summing card, C2 wires are required to communicate commands to the IT junction card and receive load sensor data in return.*

- Step 1. Remove the factory-installed jumper from the terminal block if you have 6 wire cable that includes sense wires from the load cell or junction box.
- Step 2. Connect the cable (recommended load cell cable: Hardy Instruments Prt. # 6020-0001) wires to the Weigh Scale Input terminal block according to the cable color chart, or per manufacturers specification.
- Step 3. Plug the terminal block into the channel connector on the rear panel.

## Input Power Wiring

#### NOTE

*When you use external over-current protection devices, mount the switch and/or circuit breaker near the instrument. Do not connect AC and DC power at the same time.*

**WARNING - Do not plug the power connector into the header with live power. To do so will result in property damage and/or personal injury.**

**AVERTISSEMENT – Ne pas brancher le connecteur d'alimentation dans le bâti lorsque le courant est déjà présent. Le faire peut entraîner des dégâts matériels et/ou des risques de blessures.**

**WARNING - Danger of explosion if battery is incorrectly replaced. Replace only with the same or equivalent type recommended by the manufacturer. Dispose of used batteries according to the manufacturer's instructions.**

**AVERTISSEMENT – Danger d'explosion si la batterie est malremplacer. Remplacer uniquement avec le meme type ou équivalent recommandé par le fabricant. Recyclage des batteries usagées selon les instructions du fabricant.**

## AC Input Power Wiring (-AC)


**WARNING -** Make sure that the power source does not exceed 240 VAC. Operating with incorrect line voltage can result in property damage and/or personal injury.

**AVERTISSEMENT –** Assurez-vous que la source d'alimentation ne dépasse pas 240 V. L'utilisation d'un mauvais voltage peut résulter en dégâts matériels et/ou des risques de blessures.

**WARNING -** If an automatic disconnect device is used on the AC input wires, the disconnect must act on both the line and neutral wires in a double pole, double throw arrangement i.e. DPDT Relay. Using other automatic disconnect arrangements may cause personal injury and/or property damage.

**AVERTISSEMENT –** Si un dispositif de déconnexion automatique est utilisé sur les câbles d'entrées du courant, la déconnexion doit agir sur les lignes et câbles électriques neutres de type bipolaire, arrangement de type inverseur i.e Relais DPDT. L'utilisation de d'autres types de configurations de dispositifs peut causer des blessures sur personnel et/ou des dégâts matériels.

- Use a clean primary AC power line, directly from the power panel. This line should not supply any other equipment, including the feeding unit, and should be supplied with a maximum 20 amp breaker.
- AC Power Input
  - Neu (Low neutral)
  - Line (HI)
- Earth Ground

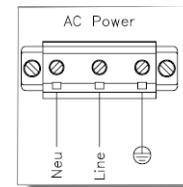

The HI 4050 is configured with a universal power supply rated from 120 to 240 VAC.

- Make sure the VAC power is shut off before installing the wires to the connector.
- Install a 3-wire, minimum 14 AWG power line to the 3-pin terminal block connector. Using copper wiring is recommended. Consult your local rules and electrical codes.

## DC Power Input (-DC)

**WARNING** - Do not operate with incorrect line voltage. To do so will result in property damage and/or personal injury. Make sure that the power source does not exceed 24 VDC.

**AVERTISSEMENT** – Ne pas faire fonctionner le système avec le voltage inapproprié. Le faire pourra causer des dégâts matériels et/ou des blessures sur personnel. Assurez-vous que la source d'alimentation ne dépasse pas 24 V.

### CAUTION:

Be careful not to reverse the ground and hot wires, which can result in damage to the equipment.


You must use a power-limited DC power supply (Class 2) on the DC input wiring. DC power should be supplied by a clean primary line, directly from the DC power source.

### ATTENTION

Faites attention de ne pas inverser les fils sous tension et les fils allant à la masse, ce qui peut entrainer des dégâts sur le matériel.

Vous devez utiliser un transformateur de type courant directionnel ou DC (de classe 2) avec une entrée de type DC. Le courant DC doit être fourni par une ligne conforme provenant de la source d'alimentation DC directement.

- Step 1. Make sure the VDC power is shut off before installing the wires to the connector.
- Step 2. Connect the 24 VDC voltage wire, ground wire and shield wire to the connector that plugs into the DC voltage header at the rear panel.
- Step 3. Plug the connector into the header at the rear panel.
- Step 4. Apply VDC power to the unit.

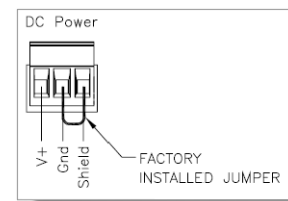

## Printer/Scoreboard Wiring


Serial Gnd to Scoreboard Gnd

Serial Tx to Scoreboard RX

Serial Rx (No Connection)


Printer/score-board transmit data [tx] uses rs-232 serial interface communication protocol. External inputs can be configured via mapping. They are non-isolated, active low and referenced to common [com].

Wire size: 12 awg maximum / 22 awg minimum.

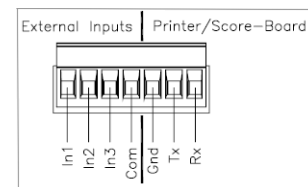

### External Inputs 1-3

The first four pins on the input port are used for general-purpose digital inputs. These inputs can be mapped to switches or buttons to control such functions as tare, or zero scale. Inputs one through three can be used only with devices using 5 volts or less. They are activated by shorting the pins 1, 2, or 3 to the J2 pin 4 COM terminal with a dry contact switch or relay.

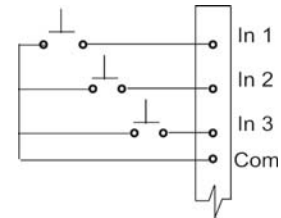


These standard inputs cannot interface with 24v logic directly. To activate the input contacts sent from a PLC, it is necessary to install a relay device as the dry contact or install the optional digital I/O card.

### Disassembly and Reassembly Notes and Cautions

- Installation of this equipment must comply with International, National and Local Electrical and Mechanical codes.
- Make sure that any disassembly is done in a clean, well ventilated, properly controlled static-free environment.
- Always make sure that the assemblies and sub-assemblies are well supported and insulated when working on the instrument.
- Place small fasteners, connectors and electrical parts in closed containers so as not to lose parts during reassembly.
- Read the disassembly instructions before disassembly. If you find the instructions for disassembly unclear, contact Hardy Instruments, Technical Support Department for additional information and assistance.
- Do not disconnect any electrical plug, connector or terminal unless an identification tag is present or one is attached. Always note where the connector or plug was attached to the electrical component or wiring harness.
- Install complete hardware groups (screws, washers, lock washers, spacers, etc.) back to the original point of removal.
- Replace broken or damaged hardware immediately!
- Verify that no loose parts are sitting on printed circuit boards or electrical connectors or wires when disassembling or reassembling.
- Always protect printed circuit boards from electrostatic discharge (ESD). Always use approved ESD wrist straps and anti-static pads.

## Installing Printed Circuit Boards


Step 1. Line up the Printed Circuit board with the grooves in the electrical enclosure

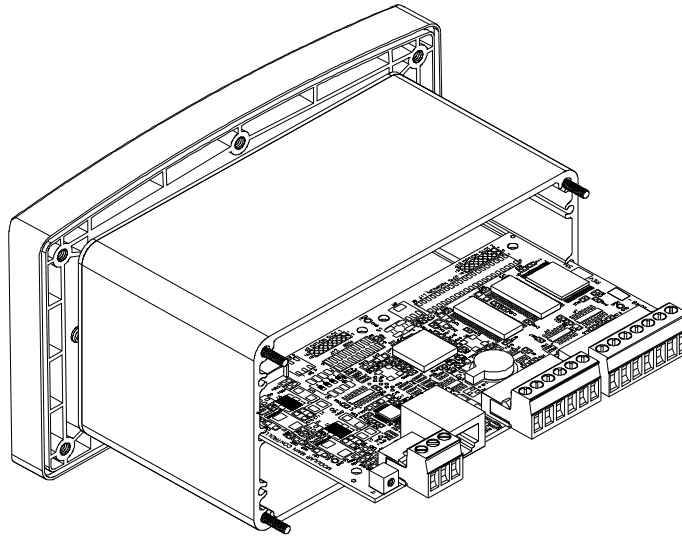

### NOTE

*The Main Board and options are installed assembled. We are showing the Main Board installation only for illustration purposes.*

Step 2. The rear panel is normally installed before the printed board assembly is installed.

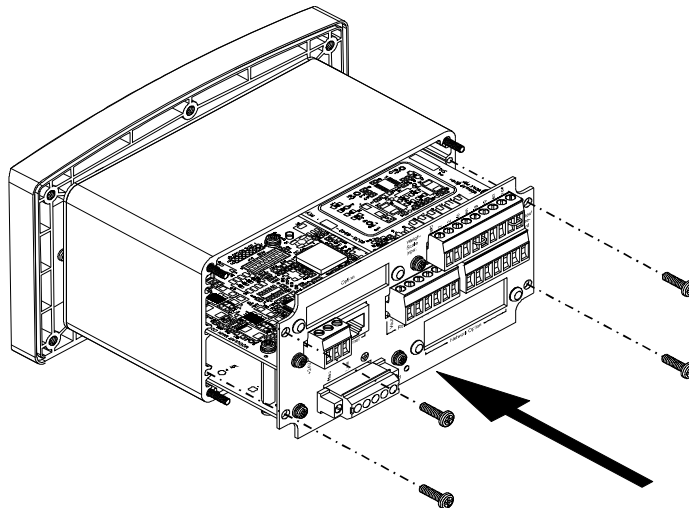

Step 3. Gently slide the circuit boards into the electrical enclosure until the rear panel is against the enclosure.

- Step 4. Use the four 6-32 x .1875 Phillips pan-head screws to fasten the rear panel to the electrical enclosure.
- Step 5. Use a torque screw driver and torque each screw to 10 inch/pounds. **DO NOT OVERTIGHTEN!**
- Step 6. To disassemble the printed circuit board assembly, reverse Steps 1-5.

## Installing Option Cards

The option cards connect to the Main control board either from the network header or option slot header. Each card is installed the same way in either the Network slot or the Options slot, except as noted. This applies to the following cards:

- DIO (options slot)
- Analog Output (option slot - 4ANB) or (network slot - 4ANA)
- Profibus (network slot)
- DeviceNet (network slot)
- ControlNet (network slot)
- RIO (network slot)

## Installing a Card in the Option Slot (applies to -4ANB and -DIO)


### Installing the Cards

- Step 1. Plug the Board Stacker into the Option Slot Header (J9) on the Main Controller board, as shown below.


#### NOTE

*Be careful not to bend the pins when plugging the Analog Board into the board stacker.*


- Step 2. Through holes in the bottom of the option card allow you to plug the board stacker into the option slot header (J2) on top of the card. Align the card through holes with 20mm stacker pins.

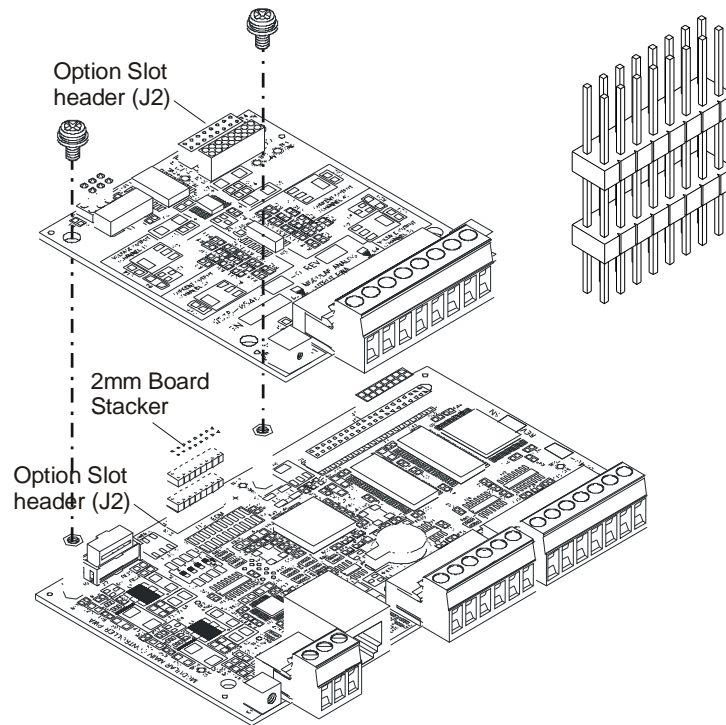

- Step 3. Gently push the card onto the 20mm board stacker pins (making sure you align them through holes on the analog board with the two standoffs on the Main Controller board) until the pins are seated.

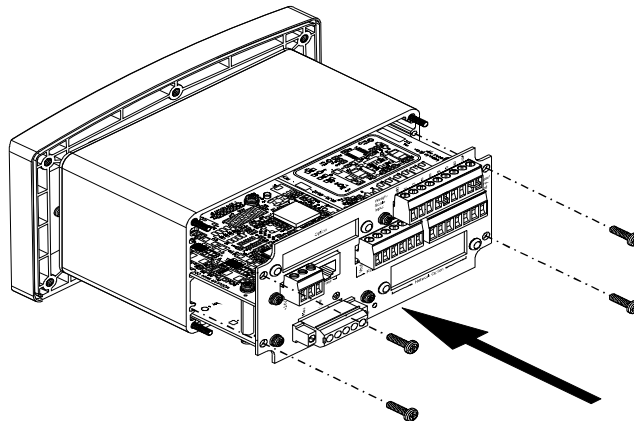


- Step 4. Slide the board assembly into the chassis until it stops.
- Step 5. Use the four pan-head screws (6-32 x .1875") to fasten the rear plate to the chassis.

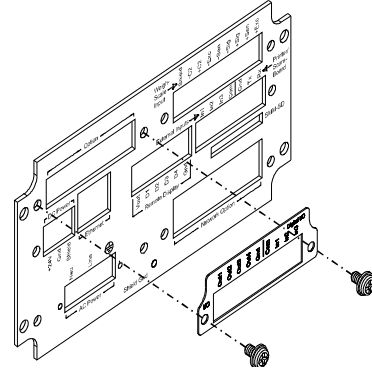

#### Installing Labels

- Step 1. After removing the protective cover off the label, align the label with the through holes on each side of the Option port.
- Step 2. Press the label onto the rear panel making sure that it sticks evenly.
- Step 3. Use the two pan-head screws (4-40 x .25") flat and split washers to fasten the rear panel to the card assembly, as shown.

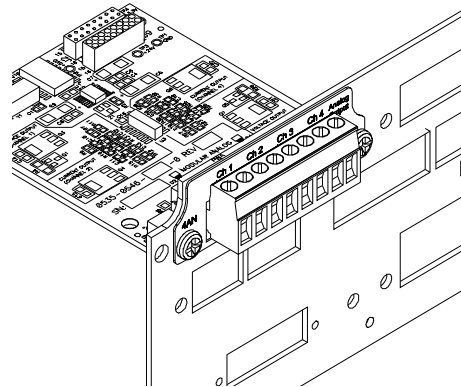

#### Wiring the Analog Output Card

The Analog Output card is a plug-in option (using a 16-pin board stacker) that you install in the controller board either using the option slot header, as described above, or network header slot, as described in the section Installing Network Cards. Four independent analog outputs can be configured to any of the instruments parameters over an adjustable 16,000 counts of resolution: two current (0-20 mA) and two voltage (0-10 VDC)

#### NOTE

*The analog output is not isolated. A 4-20ma isolator may be required for stable readings depending on ground conditions.*

**WARNING - The Voltage and Current outputs are not interchangeable. To interchange voltage and current will cause personal injury and/or property damage.**



**AVERTISSEMENT – La carte analogue de Hardy est de source analogique. Ne pas connecter la carte analogue avec une autre source analogique interne ou externe. Le faire peut endommager le matériel et/ou provoquer des blessures sur personnel.**


**WARNING - The Hardy Analog Card is the Analog Source. Do not connect the Analog card to another internal or external Analog Source. To do so may result in property damage and/or personal injury.**

**AVERTISSEMENT – Les sorties de tension et de courant ne sont pas interchangeables. Inter changer le courant et la tension peut provoquer des blessures sur personnel et/ou des dégâts matériels.**



### Analog Output Wiring

- Channel 1 - Voltage
- Channel 2 - Current
- Channel 3 - Voltage
- Channel 4 - Current

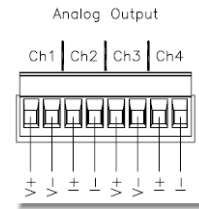


### NOTE

Use a torque connector screw driver to properly tighten the screw terminals to 7inch/lbs (8 kg/cm).

### Wiring the Digital I/O Option Card (-DIO)

The digital I/O card plugs into either the Options or Network slot. (Do not use the External output slot.)

The card can process up to three discrete input signals from a connected PLC or other source without using a relay. Its four outputs enable you to connect to external relays for switching on a valve, switch, etc.

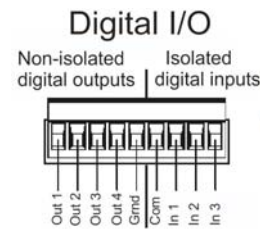


### Pin Setup and Wiring

#### Suggested Option Card Input Wiring

To activate the DIO card's inputs, apply 3-30 VDC between the input terminal (pin 7, 8 or 9) and the COM terminal, pin 6 on the DIO card's 9-pin connector.


- 6 - Common (Isolated)
- 7 - Input 1
- 8 - Input 2
- 9 - Input 3

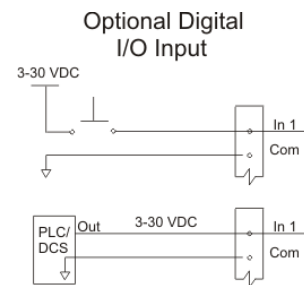

#### Suggested Option Card J1 Output Wiring

You can use the four DIO card outputs to send a TTL weak 5vdc output signal (worst case minimum 3 V at 5mA out) to a relay driver circuit to actuate mechanical relays. The outputs can also implement pull-to-ground applications requiring 250mA or less. When the output activates, it pulls the return side to ground and activates the relay coil.

For connections to the digital outputs, 1-4 are output 1 to output 4, and 5 is the GND (Same as power GND).

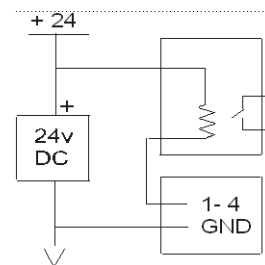

Steps to hook up an external relay

Step 1. Attach a 3-30 VDC power supply common to the GND terminal, pin 5.

Step 2. Connect the power supply plus side to the relay coil.

Step 3. Connect the return side of the relay to a DIO output terminal.

#### Resettable Fuses


A current exceeding the limit trips a thermal fuse. The fuses will trip if any of the outputs are shorted to a power supply, causing the output voltage to rise to a high logic voltage level. The output will remain in the high state until the user resets the fuse.

To reset the fuse, either remove the power source from the output until the circuit cools (about 30 seconds) or toggle the digital output in question to a high voltage state for 30 seconds.

## Installing a Card in the Network Slot

While some cards use a 16-pin board stacker and others use a 40-pin board stacker, the process for installing an optional card in the network slot is basically the same:

Step 1. Plug the 16-pin or 40-pin 28mm board stacker into the header on the network option card.

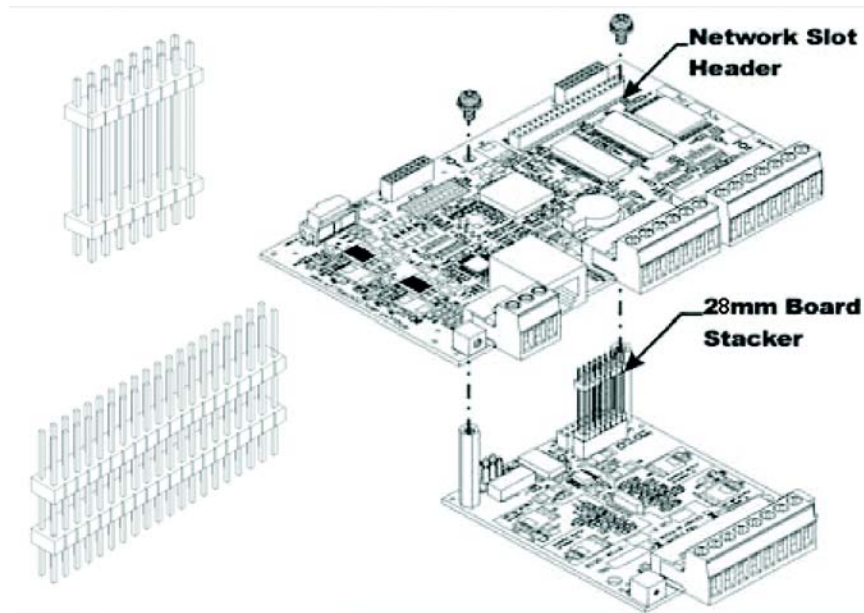


Step 2. Align the board stacker pins with the 16 right-side pin holes for the network slot Header (J41) located on the bottom of the Main Controller board.

Step 3. Using two fingers gently push the board stacker pins into the network slot header until the standoffs touch the bottom of the main controller board.


- Step 4. Use the two pan-head screws (4-40 x.25") to fasten the option card to the standoffs attached to the main controller board.

### Installing a Network Card Label

- Step 1. Peel the protective cover off the label.
- Step 2. Align the label with the through holes on each side of the Network port.
- Step 3. Press the label onto the rear panel making sure that it evenly sticks to the rear panel surface.

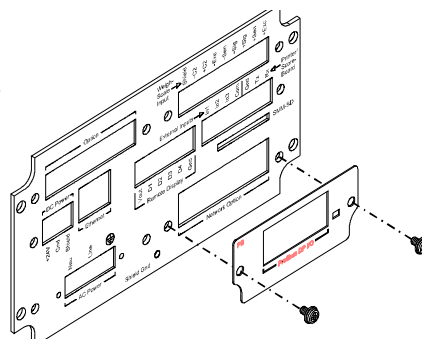

- Step 4. Use the two pan-head screws (4-40 x .25") split and flat washers to fasten the rear plate to the board assembly.

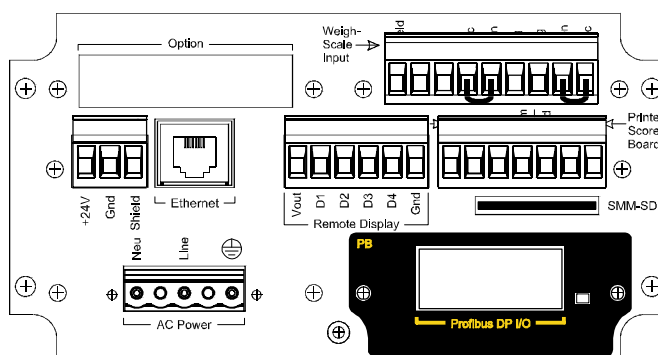


- Step 5. Slide the board assembly into the chassis until it stops.
- Step 6. Use the four pan-head screws (6-32 x .1875") to fasten the rear plate to the chassis.

### Wiring the PROFIBUS Card

Profibus uses the 40-pin board stacker. Follow the procedure above under Installing Network Cards.

Connector Terminations:

- 1** NO CONNECT
- 2** NO CONNECT
- 3** RXD/TXD +
- 4** RTS
- 5** GND BUS STATUS
- 6** +5V BUS
- 7** NO CONNECT
- 8** RXD/TXD -
- 9** NO CONNECT

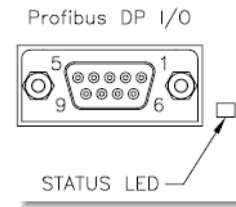


### Wiring the DeviceNet Card

DeviceNet uses the 40-pin board stacker. Follow the procedure above under Installing Network Cards.

Left to Right facing the HI 4050 rear panel:

|        |             |
|--------|-------------|
| V-     | Black       |
| CAN-   | Blue        |
| Shield | Uninsulated |
| CAN+   | White       |
| V+     | Red         |

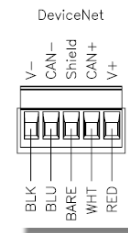


### Wiring the Remote I/O Card

See the separate Remote I/O User's Guide for the HI 4000 Series (PN 0596-0306-01) for setup procedures.

### Wiring the ControlNet Card

#### ControlNet Connectors

The ControlNet option requires standard BNC-type connectors. If redundancy is wanted, both connectors should be used.

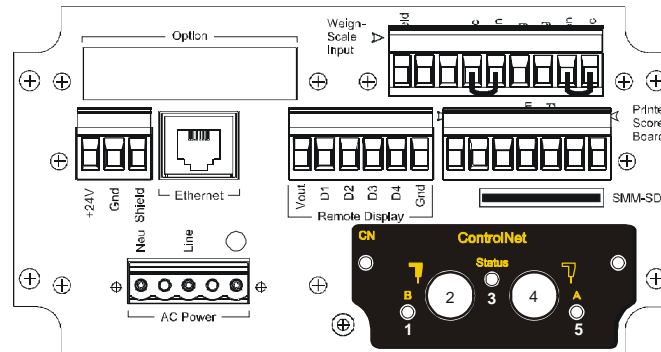

| # | Item                     | # | Item                   |
|---|--------------------------|---|------------------------|
| 1 | Network Status LED B     | 4 | ControlNet Connector A |
| 2 | ControlNet Connector B   | 5 | Network Status LED A   |
| 3 | Configuration Status LED |   |                        |

## Network Status LEDs

| LED         | State                 | Indication  |
|-------------|-----------------------|---|
| Led A and B | Off                   | Not online / No power   |
|             | Flashing Red (1 Hz)   | Incorrect node configuration, duplicate MAC ID etc.                               |
|             | Alternating Red/Green | Self test of bus controller   |
|             | Red                   | Fatal event or faulty unit  |
| Led A or B  | Off                   | Channel is disabled   |
|             | Alternating Red/Green | Invalid link configuration  |
|             | Flashing Green (1 Hz) | Temporary errors (node will self correct) or node is not configured to go on-line |
|             | Green                 | Normal operation  |
|             | Flashing Red (1 Hz)   | Media fault or no other nodes on the network                                      |


## Module Configuration LED

| State                 | Indication   |
|-----------------------|--|
| Off                   | No power   |
| Green                 | Operating in normal condition, controlled by a scanner in Run state      |
| Flashing Green (1 Hz) | The 4050 has not been configured or the scanner is in Idle state         |
| Red                   | Unrecoverable fault(s), EXCEPTION, fatal event                           |
| Flashing Red (1 Hz)   | Recoverable fault(s), MAC ID has been changed after initialization, etc. |

### Wiring the Modbus TCP/IP Option

To connect the HI4050 to a Modbus TCP/IP network, plug a standard RJ-45 network cable into the Ethernet port as you would with any standard Ethernet connection.

Modbus TCP/IP is a software option that comes preinstalled in the HI4050 upon customer request. A key is required to enable the software. You can purchase the option with the Key by contacting your local Hardy Instruments Representative or Hardy Service Center. Chapter 4 describes the activation procedure.

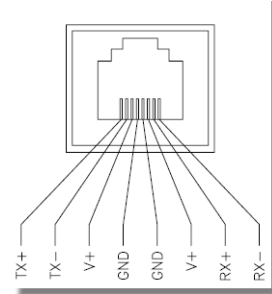



# Chapter 4

## Configuration

.....

Chapter Four contains step-by-step instructions for configuring the Hardy Instruments (HI) 4050 Weight Controller and related communication networks. We recommend reading these procedures because having a correct configuration is necessary to ensure trouble-free operation.

This chapter explains how to configure the HI-4050 from either its own front panel or with a PC-based Web interface connected to the HI-4050 over a standard Ethernet network. HI-4050 features operate the same way in either case.

You must use the Web interface to configure units that do not have a display.

Before operating the HI 4050 Weight Controller, make sure that:

- Power and load point cables are properly installed and in working order.
- Communication cables are properly installed and in working order.

See chapter 3 for details on installing load point cables and Ethernet wiring.

### 4050 Front Panel and Set Point Configuration

See Chapter 7 for a complete description of the front panel and how it works.

See Chapter 6 for a complete description of what set points are and how they are used.

See Chapter 7 for a description of how an operator can change a setpoint weight.

## Ethernet Network Configuration

### NOTE

*Do not confuse the onboard Ethernet TCP/IP communication with Ethernet/IP®. Ethernet/IP is an industrial protocol that does not transmit Web traffic and is a purchased option.*

An embedded Web server in the HI-4050 allows you to easily configure every parameter of the instrument via a standard Web browser. A standard Ethernet network is required to provide the connectivity between the HI-4050 and your desktop / laptop computer.

The HI-4050 Weight Controller is designed with a standard 10/100 BASE-T Ethernet connection for linking to any Windows PC. Once connected, you can monitor, download Hardy software, or configure the HI-4050 from that PC. A Help function can assist you in setup or trouble-shooting. The browser also links to the Hardy Web Site where the user can find additional services and support.

## IP Setup

If you have a blind unit, you must use the IP Setup utility to set the IP address instead of the front panel. Follow the steps below for a LAN or Direct Connection, but use the IP address from these steps in the IP Setup utility to configure the 4050. Refer to the section on IP Setup Program at the end of this chapter for more information.

There are two primary ways to connect the HI-4050 to your computer:

**LAN Connection:** Connect the HI-4050 to an existing Ethernet-based Local Area Network (LAN) that has connectivity to your desktop or laptop computer. See the *LAN Connection* section below.

**Direct Connection:** A direct point-to-point connection between the HI-4050 and your desktop or laptop computer using any standard Ethernet cable. See the *Direct Connection* section below.

## LAN Connection

To connect the HI-4050 to a LAN, you simply connect a standard Ethernet cable between the instrument and the common network hub. You will then need to determine the scheme used on the network to assign IP addresses. Every node on the network must have a unique IP address or conflicts will result. Contact your Network Administrator for the IP address to use for the instrument.

The IP address can be set manually (fixed IP), or it can be set automatically by a network service called DHCP. If you are required to use Fixed IP addresses, refer to the section *Fixed IP Configuration Using the Front Panel* below. For automatic IP assignment (DHCP), use the following steps:

### DHCP Configuration Using the Front Panel

DHCP works only if a DHCP server is installed on your network. To enable DHCP on the HI-4050, you must first set the current IP address to '0.0.0.0' on the IP configuration screen.


- Step 1. Press Enter from the Summary display to activate the Configuration menu. Use the down arrow to select Instrument Setup and press Enter.
- Step 2. Use the down arrow to select Ethernet; then select IP to display the IP screen.
- Step 3. If the display is not already showing 0.0.0.0, press the CLR button to erase the current IP value.
- Step 4. Starting with the right-most digit, enter the value '0.0.0.0' using the up/down arrows to select each character, and press the left arrow to move to the next digit.
- Step 5. Press Enter to save the entry.
- Step 6. Press the Exit key four times to exit the IP, Ethernet, Configuration and Setup menus.

- Step 7. Power-cycle the instrument to force it to enable the DHCP method for setting the IP address. (Step not required for HI 4050 software after version 1.7.0.0.)
- Step 8. Recall the Configuration / Instrument Setup / Ethernet / IP menu. If the DHCP configuration was successful, the DHCP: line will include an IP address provided by the network server. This is the IP address to use in your web browser to access the Web Interface. From here you can jump to the section *Network Options Configuration*.

### Displaying the Complete DHCP IP Address

Read-only screens can display a limited number of characters per line. To see the complete IP address in DHCP, you need to do the following:

- Step 1. On the Ethernet menu, select DHCP. In our example the DHCP address shows 192.168.100.12. The actual address is 192.168.100.128. The “8” is not displayed.

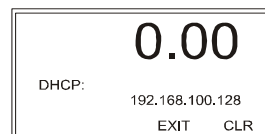

- Step 2. Press Enter and the DHCP edit form will show the complete IP address.

### NOTES

*You cannot change the values of the DHCP IP address. Exit returns to the Ethernet Menu.*


*If the 'DHCP:' line remains 0.0.0.0, allow the instrument another minute to acquire an address from the server and re-enter the IP menu. If this doesn't work, the DHCP server is not visible to the HI-4050 and you should use a Fixed IP configuration.*

### Fixed IP Configuration Using the Front Panel

The HI-4050 can be configured to use any fixed IP address. Fixed IP addresses must be carefully selected to avoid accidentally configuring two devices to the same address with unpredictable results. Since 'guessing' a value could lead to personal or property damage and/or interrupted network services, your network administrator should provide this address.

- Step 1. From the Summary display, press Enter to activate the Configuration menu. Use the down arrow to select Instrument Setup and press Enter.
- Step 2. Use the down arrow again to select Ethernet, and select IP to display the IP screen.
- Step 3. If the display is not showing the correct IP value, press the CLR button to erase the current value.

Step 4. Starting at the right-most digit, enter the IP number using the standard format. Use the up/down arrows to select each character, and press the left arrow to move to the next digit.

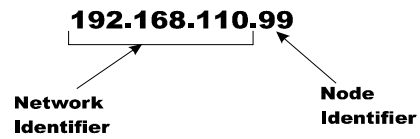

Step 5. Press Enter to save the entry.

Step 6. Press the Exit key four times to exit the IP, Ethernet, Configuration, and Setup menus.

The IP address is now saved and the instrument's embedded Web browser is now available at the entered IP address. From here you can jump to the *Network Options Configuration* section.

## Direct Connection

This method of interconnect between an HI-4050 and a standard Windows PC allows you to configure the instrument using the embedded web browser, even if an Ethernet network is not part of the normal installation. A desktop or laptop may be used on location as necessary.

Both sides of the link require configuration of their IP addresses to establish a working connection. The following steps will walk you through the process of connecting the hardware and configuring the HI-4050 and PC with compatible IP addresses.

### Direct Connect Hardware

Any standard Ethernet cable with RJ-45 connectors at each end can be used to connect the HI-4050 to your PC. A 'crossover' cable is not required. Simply plug the cable into each instrument.

### Windows PC Configuration

#### Windows 2000

- Step 1. After starting your computer, click the Start button.
- Step 2. Click on Settings > Control Panel to display the Windows Control Panel.
- Step 3. Click the Network icon to display the Network dialog.
- Step 4. Click on TCP/IP; then click the Properties button to open the TCP/IP Properties dialog. Click the IP Address tab.
- Step 5. If the 'Use the Following IP Address' box is already checked, write down the displayed IP Address and jump to the *Direct Connect Configuration – HI-4050* section below.
- Step 6. Click the 'Specify an IP Address' check box; then enter the following into the TCP/IP Properties dialog.

IP Address = 192.168.100.100  
Subnet Mask = 255.255.255.000

- Step 7. Select OK on the TCP/IP Properties dialog. The computer is now fully configured.
- Step 8. To return the PC to the original network settings, return to the 'Internet Properties (TCP/IP) dialog, select 'Obtain an IP address automatically,' and click OK.

### **Windows XP**

- Step 1. After starting your computer, click Start.
- Step 2. Click on Settings > Network Connections.
- Step 3. Right click on 'Local Area Connection' and select Properties.
- Step 4. Click on Internet Protocol (TCP/IP) and click on the Properties button to open the Internet Properties (TCP/IP) Properties dialog.
- Step 5. If the 'Use the Following IP Address' box is already checked, write down the displayed IP Address and jump to the *Direct Connect Configuration – HI-4050* section below.
- Step 6. Click the 'Use the Following IP Address' check box; then enter the following into the TCP/IP Properties dialog.

IP Address = 192.168.100.100  
Subnet Mask = 255.255.255.000

- Step 7. Select OK on the TCP/IP Properties dialog box. The computer is now fully configured.
- Step 8. To return the computer to the original network settings, return to the 'Internet Properties (TCP/IP) dialog, select 'Obtain an IP address automatically,' and click OK.

### **Windows 7**


- Step 1. After starting your computer, click the Start button.
- Step 2. Click on Control Panel to display the Windows Control Panel.
- Step 3. Click on Network; then click Internet
- Step 4. Click on Network; then click Sharing Center.
- Step 5. Click on Change Adaptor Settings in the left-hand column.
- Step 6. Right click on Local Area Connection and select Properties.
- Step 7. Click on Internet Protocol Version 4 (TCP/IPv4)
- Step 8. Click the Properties button to open the Internet Properties (TCP/IP) Properties dialog.

- Step 9. If the 'Use the Following IP Address' box is already checked, then write down the displayed IP Address and jump to the *Direct Connect Configuration – HI-4050* section below.
- Step 10. Click in the 'Use the Following IP Address' checkbox; then enter the following into the TCP/IP Properties dialog.  
 IP Address = 192.168.100.100  
 Subnet Mask = 255.255.255.000
- Step 11. Select OK in the TCP/IP Properties dialog box. The computer is now fully configured.
- Step 12. To return the computer to the original network settings, return to the Internet Properties (TCP/IP) dialog, select 'Obtain an IP address automatically,' and click OK.

### Direct Connect Configuration - HI-4050

The HI-4050 must now be assigned a unique IP address that will connect to the Windows PC. There are two simple rules for the IP Address:


- It must have the same network identifier as the computer
- It must have a different node identifier than the computer.

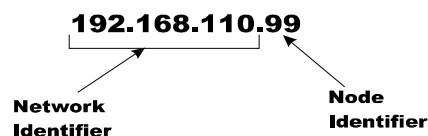

If your Windows PC already had an IP address assigned, simply increment by one the Node Identifier field of the IP Address you wrote down in the Windows PC configuration steps above. If your Windows PC was originally set to automatically obtain an IP address (DHCP), use 192.168.100.50 for the HI-4050 IP address in step 3 below.

### Setting an IP from the Front Panel

- Step 1. From the Summary screen, press Enter to activate the Configuration menu. Use the down arrow to select Instrument Setup and press Enter. Use the down arrow again to select Ethernet. Finally, select IP to display the IP screen.

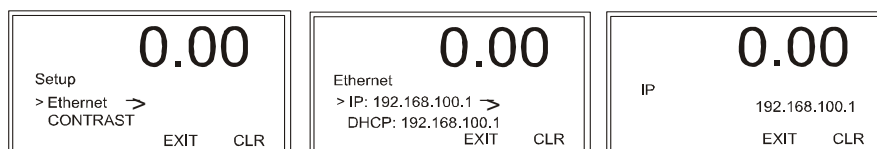

- Step 2. Press the CLR button to erase the current IP value.
- Step 3. Starting with the right most digit of the new HI-4050 IP address, enter each digit using the up/down arrows including the decimal-points. Press the left arrow to move to the next digit.
- Step 4. Press Enter to save the entry.

Step 5. Press the Exit key four times to exit the IP, Ethernet, Configuration and Setup menus.

The HI-4050 is now configured to communicate with the PC. Enter the HI-4050 IP address from step 3 in the Windows PC Web browser to access the embedded web browser. For example: <http://192.168.100.101>.

## Network Options Configuration


The HI 4000 Series Network configurations include:

- DeviceNet
- RIO
- Profibus DP
- Ethernet TCP/IP
- Modbus TCP/IP
- ControlNet
- Analog Out
- Ethernet/IP

This enables the HI 4000 Series to communicate with many devices on the network, including PCs and PLCs. This means that you can map, configure and monitor all the HI 4000 series products from the front panel or your LAN, Internet, DeviceNet, ControlNet and Wireless Servers that are connected to the Network.

### Options Setup from the Web Page

From the Home Page click Configuration to open the Configuration page, and select Options to open the options menu.

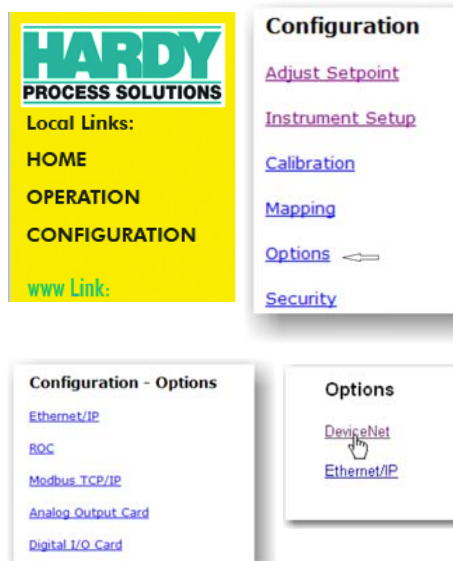

What appears on this menu depends on the cards installed in your system. The second Options menu shown here lists DeviceNet, which we will configure as our first example.

## DeviceNet

DeviceNet is an open network protocol for connecting the 4050 to PCs, PLCs or embedded controllers through a single cable interface. Signals from the 4050 can be used for external diagnostics and troubleshooting. Smart devices, such as sensors, push buttons, motor starters, simple operator interfaces, drives and other weight modules can also be linked with DeviceNet, and third-party I/O can be easily added to any system. You can monitor multiple plant-floor devices from one display and reconfigure them as your needs change or service them as required.

### Configuring DeviceNet from the Web Interface

- Step 1. From the Options Page select DeviceNet to display the DeviceNet Setup page.
- Step 2. Select the Baud Rate from the pull-down list. See your Network Administrator if you don't know the correct Baud Rate.
- Step 3. In the Node text field, type the Node address of the instrument. Our example shows a Node Address 3.
- Step 4. In the Bytes Input text field, type the bytes input value you need for your application. Our example shows 32 Bytes.
- Step 5. In the Bytes Output text field, type the bytes output value you need for your application. Our example shows 32 Bytes.
- Step 6. Click Save Parameters to save the configuration. The status of the DeviceNet Connection appears at the bottom of the display. If the instrument is connected to the DeviceNet Network, the message reads: "Yes DNET Connection. LED On." If not, it reads: "No DNET Connection. LED Off."

**DeviceNet**

Baud: 500k  
Node: 250k  
Bytes Input: 500k  
Bytes Output: 32

Save Parameters

**DeviceNet**

Baud: 500k  
Node: 3  
Bytes Input: 32  
Bytes Output: 32

Save Parameters

No DNET Connection  
LED Off



You can adjust the number of Bytes In and Bytes Out if your process requires a different configuration than the default 32 Bytes In and/or Out.

Step 1. From the Configuration Menu, use the down arrow to select Options and press Enter to open the Options Menu. Use the down arrow to select DeviceNet, then press Enter to display the DeviceNet Menu.

- Step 1. From the Configuration Menu, use the down arrow to select Options and press Enter to open the Options Menu. Use the down arrow to select DeviceNet, then press Enter to display the DeviceNet Menu.

The figure shows three sequential screenshots of the device's configuration menu, illustrating the steps to reach the DeviceNet calibration screen:

- Screen 1:** The main menu shows "0.00" at the top. The "Configuration" option is selected, and the "Options" menu is displayed. The "Calibration" option is highlighted.
- Screen 2:** The "Options" menu is shown with "DeviceNet" selected. The "Ethernet/IP" option is highlighted.
- Screen 3:** The "DeviceNet" menu is shown with "DNET Baud" and "DNET Node" options. The "DNET Baud" option is highlighted, and the value "500k" is displayed.

- Step 2. Select DNET Baud, which is showing the present baud setting. Use the right or left arrow buttons to select the Baud Rate, and press Enter to save. Check with your Network Administrator for the Baud Rate if you don't know the correct Baud Rate.

**RANGE: 125K, 250K, 500K (DEFAULT 125K)**

- Step 3.** Use the Down arrow to select DNET Node; then press Enter to display the DNET Mode edit screen.

RANGE: 0-63  
(DEFAULT 63)

- Step 4.** Use the left or right arrow to position the cursor and the up or down arrow to select the node address assigned to this instrument, then press Enter to save the entry.

- Step 5.** Use the Down arrow to select DNET Bytes In, and press Enter to display the Bytes in edit screen.

RANGE: 0-32 (DEFAULT 32)

0.00

DNET Bytes In 16

EXIT CLR

- Step 6.** Use the left or right arrow to position the cursor and the up or down arrows to select the values.

- Step 7.** When you have entered the new bytes in value, press Enter.

```


0.00
DNET Bytes Out
16
EXIT CLR

```

- Step 8.** Use the same procedure used to enter the DNET Bytes In value to enter the DNET Bytes Out value.

RANGE: 0-32 (DEFAULT 32)

Step 9. The read-only Poll Connection entry should indicate that the 4050 is connected and polling. If the connection to the DeviceNet Network fails, a “No Connection message appears. Reconnect the DeviceNet cable. The “No Connection” goes away and the Poll Connection reappears.

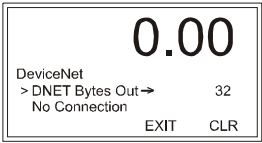


### Remote I/O

**NOTE**

*For complete information about the remote I/O interface, see the HI 4000 RIO Manual.*


Step 1. To configure the Remote I/O from the Web Browser, from the HI 4050 Home page click Configuration; then click Options to display the Options Menu.

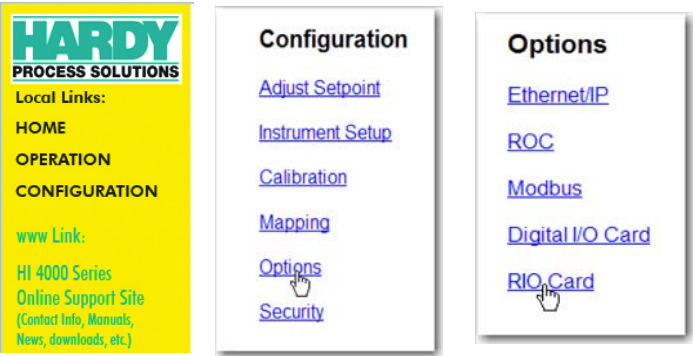


Step 2. Click RIO Card to display the RIO Option Card page.

Step 3. From the Baud pull-down list, select the Baud rate for this application.

Step 4. In the Address text field, enter the address for the HI 4050.

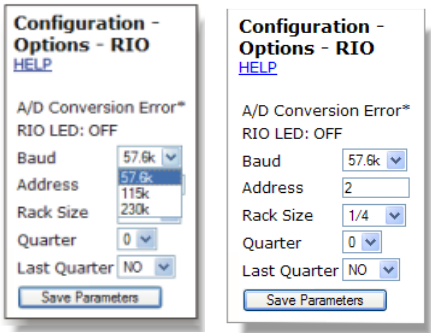

Step 5. From the Rack Size pull down list, select 1/4 or as required. See HI RIO manual for definition.

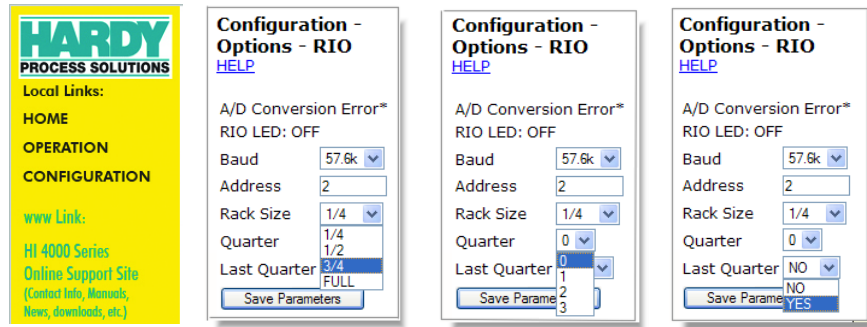

Step 6. From the Quarter (Starting Quarter) pull-down list, select the Starting Quarter you configured in the PLC to use for this location.

Step 7. The Last Quarter pull-down list is selectable as YES or NO.

Step 8. Click Save Parameters when you finish. Note that you do not have to wait until you have configured the all the parameters to save them.

### Blind Unit Operation Setup


An HI 4050-DR Rate Controller cannot be configured from the front panel as a blind unit. In a blind unit, the Remote I/O parameters are configured from the Web browser.

### Viewing the I/O Card Display


The I/O Card Menu is not configurable but is read only from the front panel. The menu indicates whether the I/O Card is connected, A/D Count, Number of Inputs and the Number of Outputs currently activated. The values are hexadecimal values. A table is provided below to determine the values listed. The Input and Output values consist of a byte with the least significant bit equal to the first Input or Output.

### Viewing the Controller I/O Card Option from the Web Page

Select Configuration from the HI 4050 Home Page and select Options to display the Options menu.

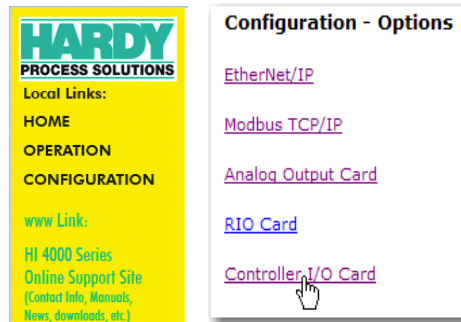


Select Controller I/O Card on the Options menu to open the read-only I/O Card page. This page shows the Inputs and Outputs that are currently activated. You may need to refresh your web screen to view any changes to the inputs.

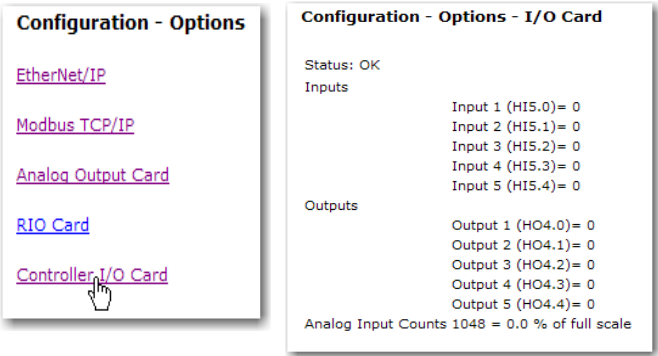

To test the inputs, continuously activate the input and refresh the web page while the input is activated. Confirm and move on to the next input. Be careful not to cause any false actions on the system while testing. When an input is activated you will also see the output percentage of full scale displayed at the bottom of the display.

#### Viewing the Controller I/O Card Option from the Front Panel


Step 1. From the Options menu, use the down arrow to select I/O Card; then press Enter to display the I/O Card menu.

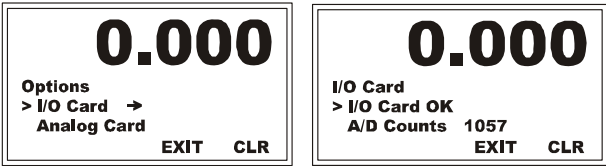


#### NOTE

*If the I/O Card Option is not installed the I/O Card Menu does not appear.*

Step 2. Select Inputs and press Enter to open the Inputs edit form.

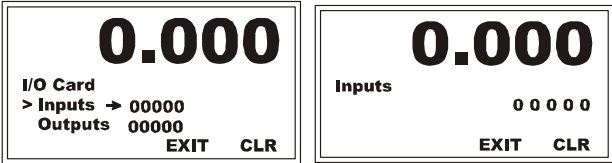



Step 3. The Inputs are displayed as a 5-bit value. (0 0 0 0 0). Note that the least significant (right-most) digit is input 1 and the most significant (left-most) digit is input 5. For example, with Input 1 and Input 3 active, the display reads.



Step 4. The Outputs are displayed as a five-bit value.

0 0 0 0 0  
Relay 5 Relay 4 Relay 3 Relay 2 Relay 1

Relay 1 is on the right of the bit value and Relay 5 is on the left. For example, if Relay 4 and Relay 5 are active, the binary value is (1 1 0 0 0). If the relay output defaults are selected, the alarm and refill relays are activated.

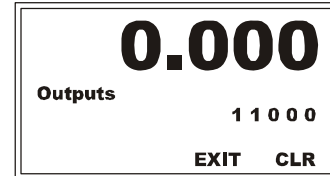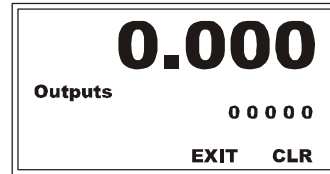

## Ethernet/IP™

Ethernet/IP, short for **E**thernet **I**ndustrial **P**rotocol, is an open industrial networking standard that takes advantage of commercial, off-the-shelf Ethernet communication chips and media. Ethernet technology, enables the user to access device-level data from the Internet. The Ethernet/IP networking standard supports both implicit messaging (real-time I/O messaging) and explicit messaging (message exchange). Ethernet/IP is an open network that takes advantage of commercial technology that already exists.

IP is the transport and network layer protocol of the Internet and is commonly linked with all Ethernet installations and the business world. IP provides a set of services that any two devices can use to share data.

You will need a key number to enable Ethernet/IP. You can purchase a key number by contacting the Hardy Service Center or your local Hardy Representative.

### NOTE


*Ethernet/IP™ is a trademark of ODVA.*

### Configuring Ethernet/IP from the Web page

Step 1. On the Options menu Click Ethernet/IP to open Configuration - Options - Ethernet/IP.




Step 2. A key is required to activate Ethernet/IP. If you have no key, contact the Hardy Instruments Service Center to purchase the key, which you enter in the Key field.

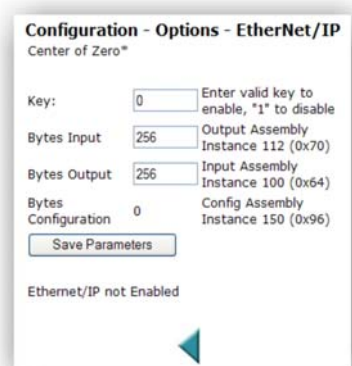

Step 3. Click Save Parameters.

## Configuring Ethernet/IP from the Front Panel

Step 1. From the Configuration Menu, use the down arrow to select Ethernet/IP and press Enter to display the Ethernet/IP menu. Use the down arrow to select EIP Key, then press Enter to display the EIP edit page.

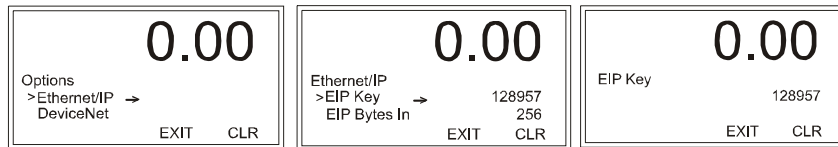


Step 2. Use the left or right arrow to position the cursor and the up or down arrow to select the values. Enter key number you received from the HI Service Center and press Enter to save it. Note that the number displayed above is only for illustration purposes and is based on the serial number.

Step 3. You will have to set the following parameters on your PLC in order to communicate with the HI 4050:

- COMM FORMAT: DATA - SINT
- INPUT INSTANCE 100, LENGTH 256
- OUTPUT INSTANCE 112 - LENGTH 256
- CONFIGURATION INSTANCE 150 - LENGTH 0

Step 4. From the Ethernet IP menu, select EIP Bytes Input to open the edit form.

Step 5. Use the left or right arrow to position the cursor and the up or down arrow to select the values.

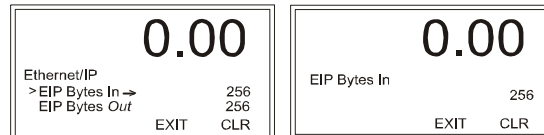

Step 6. Use the left arrow to move to the next digit and enter the number of bytes you require for your application. Our example shows 256 bytes.

Step 7. Use the same procedure used to enter the EIP Bytes In value to enter the EIP Bytes Out value.

Step 8. The read-only Connected entry confirms that the 4050 is connected to the network. If the instrument is not connected to the network, a message appears saying "Not Connected." Check the Ethernet/IP connection at the rear of the instrument to make sure it is securely fastened to the Ethernet/IP port.

## Rate of Change (-ROC) Option Configuration

Enabling Rate of Change requires a Key number. You can purchase a key number from the Hardy Service Center or contact your local Hardy representative.

Rate of Change is enabled as an option of print mode.

### Configuring Rate of Change From the Browser

On the Home Page click Configuration to open the Configuration page, then select Options to open the options menu.



#### Configuration

[Adjust Setpoint](#)  
[Instrument Setup](#)  
[Calibration](#)  
[Mapping](#)  
[Options](#) ←  
[Security](#)

#### Configuration - Options

[Ethernet/IP](#)  
[ROC](#)  
[Modbus TCP/IP](#)  
[Analog Output Card](#)  
[Digital I/O Card](#)

The Option reflects all internal options plus any options installed in your controller.

Step 1. Click ROC to open the Rate of Change page.

Step 2. In the ROC Key field, enter the Key number provided by Hardy.

Step 3. Click Set Parameter. Wait a few seconds for the parameter to be saved in the instrument.

Step 4. Click the left arrow to reopen the Rate of Change page.

Step 5. Select the appropriate Time Measure from the Time Measure pull-down.

#### Enable Rate of Change

Serial Number: 2251  
ROC Key:  Enter valid key to enable, "1" to disable

To enable this feature, please contact Customer Support to purchase a key.




#### Rate of Change

Time Measure:   
Timebase:

[Disable Rate-of-Change](#)

- Step 6. To set the Timebase to use when running a Rate of Change evaluation, type a value in the Timebase text field.
- Step 7. Click on the Set Parameter button to set the entry.
- Step 8. Click the back arrow to return to the HI 4050 Home Page.

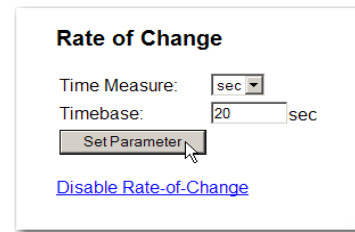

**Rate of Change**

Time Measure:


Timebase:  sec

[Disable Rate-of-Change](#)

### ROC Configuration from the Front Panel

See note above about the key requirement.

- Step 1. Once you have a key number, select ROC from the Options menu to display the ROC menu; then press the down arrow to select ROC Key, and press Enter to display the ROC Key screen.

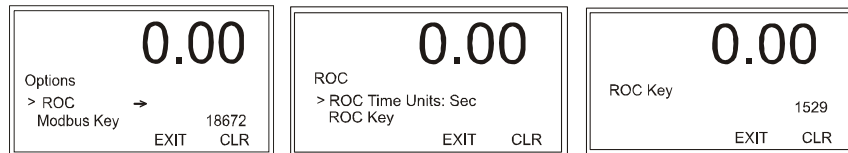

Options  
> ROC → 18672  
Modbus Key  
EXIT CLR


ROC  
> ROC Time Units: Sec  
ROC Key  
EXIT CLR

ROC Key  
1529  
EXIT CLR

- Step 2. Use the left or right arrow to position the cursor and the up or down arrows to select the values; then press Enter to save the entry. (Note: The displayed number is not valid.)
- Step 3. The Rate of Change is now enabled.
- Step 4. Press Exit to return to the Rate of Change Menu.

### Configuring Rate of Change


- Step 1. Select time Base to display the Time Base edit screen. The Time base value can be 1-1800 seconds (default 1).

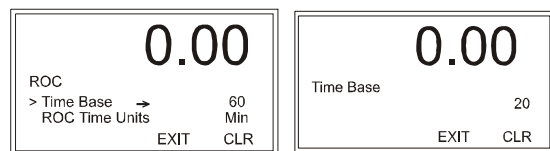

ROC  
> Time Base → 60  
ROC Time Units Min  
EXIT CLR

Time Base  
20  
EXIT CLR

- Step 2. To set the Time Base, use the left or right arrow to position the cursor and the up or down arrow to select the values. Our example uses 20.
- Step 3. Press Enter to save the entry and return to the ROC screen.
- Step 4. With the cursor is in front of ROC Time Units, press the left or right arrows to select the Timebase value and use Enter to set the entry. In our example we selected seconds.

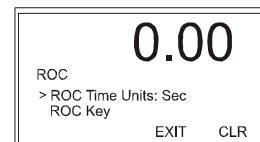

ROC  
> ROC Time Units: Sec  
ROC Key  
EXIT CLR





## Modbus TCP/IP

### Enabling Modbus TCP/IP from the Front Panel


You will need a key number to enable Modbus TCP/IP. You can purchase a key number by contacting the Hardy Service Center or your local Hardy Representative.

- Step 1. Once you have a key number, from the Configuration menu, select Options to display the Options menu.

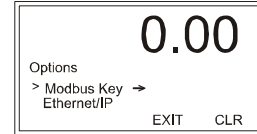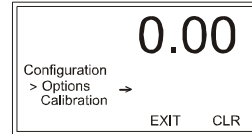

- Step 2. Select Modbus Key to open the Modbus Key edit screen.

- Step 3. Use the left or right arrow to position the cursor and the up or down arrow to select the Modbus TCP/IP Key number; then press Enter to save. (Note: *The key number shown is for illustration only. Your ROC key number will differ.*)

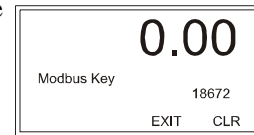


### Installing MODBUS from the Web Page (10 socket max.)


#### NOTE

*MODBUS requires a Key to enable. You can purchase the option with the Key by contacting your local Hardy Process Solutions Representative or Hardy Service Center. If you have not received a key, contact the Hardy Service Center to get the key.*

- Step 1. Click ModBus TCP/IP on the Options Page to display the ModBus Options page.

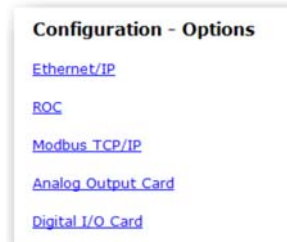

- Step 2. On the ModBus Options page, enter the key number in the Key field, and click Set Parameter to activate the Modbus option.

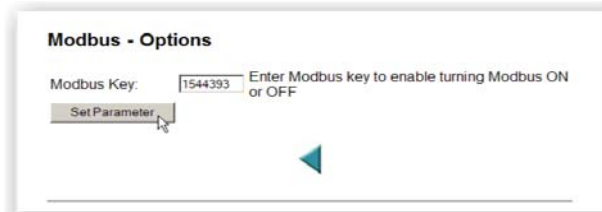

- Step 3. You can now map from your client (PLC) to the HI 4050 module via Modbus.

### Installing the Hardy Modbus-Link Test Package

If you do not have a PLC or other client, Hardy has provided the Hardy Modbus-Link Client to test communications with the HI 4050 module. This client package only communicates with the PLC and is not a full communications package. If you have problems with this test, contact HI Technical Support.

Find a copy of the Hardy Modbus-Link Software on the Documentation CD you received with your HI 4050 Instrument. If you do not have the CD that came with your instrument, download it from the HI 4050 Resources Web page. Double click the Hardy Modbus-Link .exe file to install the software on your PC. Upon completion, a Hardy Modbus-Link icon appears on your Desktop.

MODBUS is an application layer messaging protocol used to support client / server communications between devices connected on different types of buses or networks.

Its services are specified by function codes that are elements of MODBUS request / reply PDUs. MODBUS is implemented for the HI 4050 using TCP/IP over Ethernet.

The Client/Server definitions are as follows:


- Client - The module asking for data.
- Server - The module providing the data.

#### NOTE


*MODBUS is positioned at level 7 of the OSI model and is accessed at a reserved system port 502 on the TCP/IP stack. It will support communication with up to 10 different hosts (sockets).*

### Configuring MODBUS

Step 1. Click the Hardy Modbus-Link icon to open the Hardy Modbus-Link display.

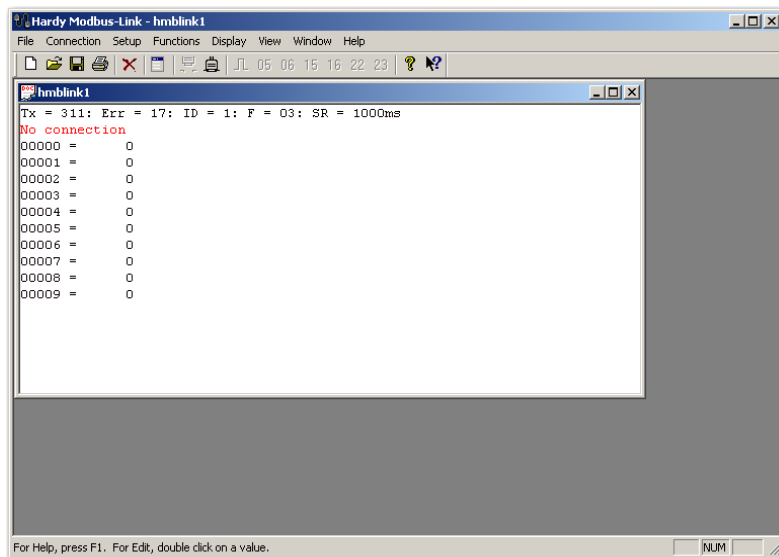


- Step 2. Click Connect in the Connection pull-down menu, to display the TCP/IP Connection form.

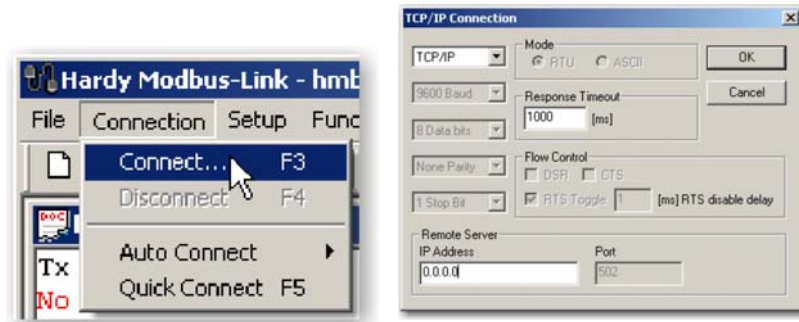

- Step 3. If TCP/IP is not selected, select it from the pull-down list.

- Step 4. Type the address of the HI 4050 module you want to communicate with into the IP Address text box and click OK.

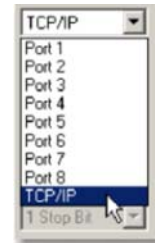

The red “No Connection” disappears and the values at the top of the page start to change.


You are now connected from your PC to the HI 4050 module.



- Step 5. To verify that you have two-way communication, from the Mapping web page of the HI 4050 instrument you want to communicate with, open the Destination Network pull-down menu and select Modbus Float Out (MFO).

- Step 6. Using the default word 0, click Select.



MFO0= appears in the Map: text field

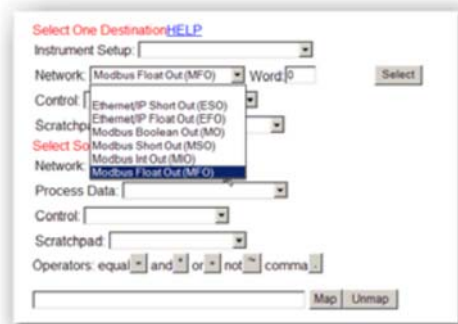

- Step 7. Select Float Variable O (HFO) from the Select Source Scratchpad pull-down list.




- Step 8. Click Select. The Destination and Source appear in the Map: text field. (HFO0).

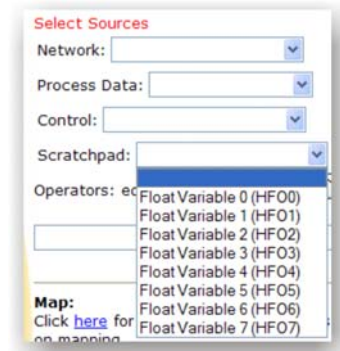



- Step 9. Click Map to complete the mapping (Float Variable O, word 0 to Modbus Float Out, Word 0).




- Step 10. Type a value in the Hardy Float Out (HFO) text field 0. Our example used 555.0000.

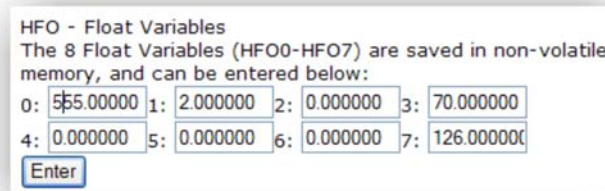

- Step 11. On the Hardy Modbus-Link page Display pull-down menu, select Float Inverse. The value we entered from the Mapping page appears to the right of the "00000 =" which is 555.0000

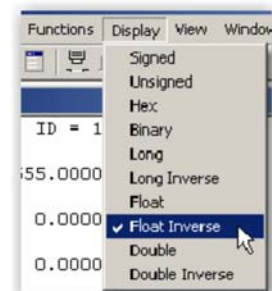


- Step 12. Click button 23 to open the Write multiple registers display.

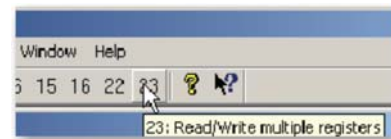

Step 13. Double click the current value.

The Enter Value display appears with the value 555 which was sent from the HI 4050 module.

Step 14. Enter a new number and click OK. When we replaced 555 with 999,

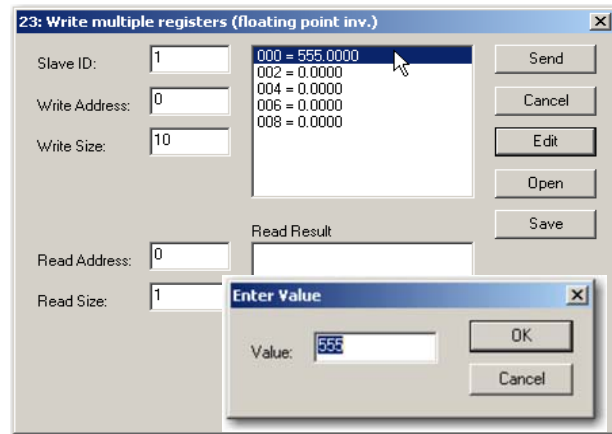


Multiple Registers displayed 999.0000.

Step 15. Click Send. A pop-up shows that the Response from the HI 4050 was received.



Step 16. Click OK.

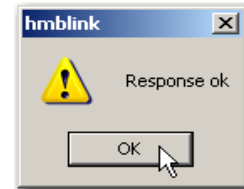

## Configuring MODBUS - TCP/IP Over Ethernet (10 socket max.)

### Error Messages:

- Function Not Supported - Does not allow you to use the selected function. Use a different function.
- Address Error - Wrong IP address of the register you want to send the data. Get and enter the correct IP address, which you can get from your Network Administrator.
- Byte Count Error - The Byte count is incorrect. Enter the correct byte count.
- Value Error - The Value entered does not match the variable type. Enter the correct a value that is equal to or less than the variable type.
- Request Error - Your want to Read and you select Write. Make sure you select the correct Request Error.

## Analog Card Option Configuration

The analog output card has four channels. Channels 1 and 3 produce a 0-10 volt (V) output. Channels 2 and 4 produce a 0-20 milliamp (I) output. The Voltage Low and High and Current Low and High are set to the default values 0-10 Volts output and 4-20 mA output. While there is normally no reason to change these values, they can be set to accommodate other ranges required for a PLC or operating environment.

The configuration objective is normally to set high and low weight values to match the high and low weight specifications in the PLC. The analog card uses these high and low weight values to calculate its weight-related outputs. You can set these values from either the front panel or the Web interface.

The lower half of the Analog Output configuration form on the Web interface shows read-only outputs. The analog input weight values for the four channels are labeled: HFO28, HFO29, HFO30, and HFO31. The card scales these values for a linear output within the range defined by the high or low weight values you set.

HFI2, HFI3, HFI4, and HFI5 are mapping symbols for the output scaling results.

The Loopback Debug Values are estimates only and may not match the actual outputs.

|                        |                 |
|------------------------|-----------------|
| Analog Channel 1       |                 |
| Input(HFO28,read only) | 7.140000        |
| Output(HFI2,read only) | 7.14            |
| loopback debug value   | 9.48 volts      |
| Analog Channel 2       |                 |
| Input(HFO29,read only) | 7.140000        |
| Output(HFI3,read only) | 15.42           |
| loopback debug value   | 20.48 milliamps |
| Analog Channel 3       |                 |
| Input(HFO30,read only) | 0.000000        |
| Output(HFI4,read only) | 0.00            |
| loopback debug value   | 0.00 volts      |
| Analog Channel 4       |                 |
| Input(HFO31,read only) | 0.000000        |
| Output(HFI5,read only) | 0.00            |
| loopback debug value   | 0.00 milliamps  |

## Analog Card Configuration from the Web Interface

- Step 1. From the Home Page click Configuration to open the Configuration page, and select Options to open the options menu.
- Step 2. Click Analog Output Card to open the Analog Output form.

|                                    |
|------------------------------------|
| <b>Configuration - Options</b>     |
| <a href="#">Ethernet/IP</a>        |
| <a href="#">BAC</a>                |
| <a href="#">Modbus TCP/IP</a>      |
| <a href="#">Analog Output Card</a> |
| <a href="#">Digital I/O Card</a>   |

Note that Slot 0 indicates where the Analog Card is installed.

# NOTE

*If you don't want to change the Voltage Low and High and Current Low and High default values, start with the Low and High Weight values for your application.*

*For assistance in configuring the Analog Output Card, click [HELP](#) at the top of the page.*

- Step 3. To Configure Channel1 (Voltage Output), rapidly click in the Chan 1 V LOW field until the entire value is highlighted (which may take a few clicks), then type in the value for your low voltage output.
- Step 4. Follow the same procedure to enter appropriate values for the high voltage output (V HIGH), Low Weight, and High Weight.
- Step 5. Click Set to save the parameters at any time. However if you are configuring more than one channel, you can wait until all the channels are configured.
- Step 6. To Configure Channels 2, 3 and 4, repeat the procedures above. Remember that Channels 2 and 4 are current (I) outputs.

# NOTE

*To refine a reading of say 10.02 where you want an output reading of 10, adjust the 0-10 values to get the correct output. The formula to do this is as follows:*

- (Expected Output/Actual Output) x Expected Output = New Number
- For example:  $(10/10.02) \times 10 = .998 \times 10 = 9.98$
- Reset your input numbers to 0-9.98.
- This formula applies to all four channels.

- Step 7. To assign the input data to the analog output channels being used, go to the Mapping page and follow the Instructions for Mapping in Chapter 6.

### Configuring the Analog Card from the Front Panel

- Step 1. From the Configuration Menu, use the down arrow to select Options, and press Enter to display the Options Menu; select Analog Card to display the Analog Card menu; then select Chan Number.

|   |   |   |
|---|---|---|
| <div>0.00</div> <div>Configuration<br/>&gt; Options →<br/>Calibration</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Options<br/>&gt; Analog Card →<br/>Ethernet / IP</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Analog Card<br/>&gt; Chan Number 1<br/>V/I Out Low 10.00</div> <div>EXIT CLR</div> |
|---|---|---|

- Step 2. Use the right arrow to select the channel (options: 1 or 3 for voltage and 2 or 4 for current), pressing Enter when you finish to save the Chan Number.

#### NOTE

*If you don't want to change the Voltage Low and High and Current Low and High default values, start with the Low and High Weight values for your application.*

- Step 3. For V/I Out Low and V/I Out High, whether the value being configured is voltage or current depends the channel selected in step 4. Select V/I Out Low and use Enter to open the V/I Out Low edit form.

|  |
|--|
| <div>0.00</div> <div>Analog Card<br/>&gt; V/I Out Low → 0.00<br/>V/I Out High 0.00</div> <div>EXIT CLR</div> |
|--|

- Step 4. Use the left or right arrow to position the cursor and the up or down arrow to select the value. When you finish, press Enter to save and return to the Analog Card menu.

|  |
|--|
| <div>0.00</div> <div>V/I Out Low 10.00</div> <div>EXIT CLR</div> |
|--|

The steps for selecting the low and high values for each channel are the same as described above.

- Step 5. Use the down arrow to select Low Weight, and press Enter to display the Low Weight edit page.

|   |  |
|---|--|
| <div>0.00</div> <div>Analog Card<br/>&gt; Low Weight → 0.00000<br/>High Weight 12.00000</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Low Weight 0.000000</div> <div>EXIT CLR</div> |
|---|--|

- Step 6. Use the left or right arrow to position the cursor and the up or down arrow to select the value. When you finish, press Enter.

- Step 7. Repeat the steps above to set the High Weight value.

- Step 8. From the Options Menu, select Map.

- Step 9. Use the right arrow to scroll the Map options, which are: NONE, Gross, Net, or ADV.

|  |
|--|
| <div>0.00</div> <div>Options<br/>Low Weight 12.00000<br/>&gt; Map NONE</div> <div>EXIT CLR</div> |
|--|



ADV is not a selectable option. If displayed, ADV indicates that a mapping was done from the Web page using an option that is not available via the front panel.

Step 10. Use Enter to save your mapping choice.

Digital I/O Option Card

Configuration of the Digital I/O option card is done mainly as a mapping function that is explained in Section 6. However, you can open the screen to the right from the Configuration menu.

- Step 1. From the Configuration menu; select Options to open the options menu; then select Digital I/O Card to open the Digital Input/Output page.
- Step 2. Read-only I/O Board Inputs and Main Board Inputs display at the top of the page. If the input is sending a voltage signal, the status is 1. If there is no voltage signal for the input, the status is 0.
- Step 3. Each of the Outputs refers to a relay associated with a process.

The pull-down options allow you to place a relay in service or take it out of service for setup testing. However, if a relay has been mapped, the mapped activity will override a manual Start or Stop activity set on this page.

Configuration/Options/Digital Input/Output

Center of Zero™

I/O Board Inputs

Input 1 (J1-7) HI0.0 0

Input 2 (J1-8) HI0.1 0

Input 3 (J1-9) HI0.2 0

Main Board Inputs, inverted

Input 1 (J2-1) HI0.4 0

Input 2 (J2-2) HI0.5 0

Input 3 (J2-3) HI0.6 0

Outputs

Output 1 (J1-1) HO0.0 0

Output 2 (J1-2) HO0.1 0

Output 3 (J1-3) HO0.2 0

Output 4 (J1-4) HO0.3 1

Outputs

Output 1 (J1-1) HO0.0 1

Output 2 (J1-2) HO0.1 0

Output 3 (J1-3) HO0.2 1

Output 4 (J1-4) HO0.3 1

**NOTE**

**Warning:** Turning relays ON or OFF during an active process can disrupt the process and result in serious problems.

**Avertissement:** Mettre les relais en état « Allumé » ou en état « Eteint » durant le processus de fonctionnement peut perturber le processus et provoquer des problèmes graves.

- Step 4. To toggle the output ON, click 1, or to toggle the output Off click 0.

- Step 5. You need to map controls to the Digital Card Outputs. For example you might need to map a Setpoint (Setpoint 1 Output HSI2) to Digital Card Output 1 (HO0.0) you need to create this map: HO0.0 = HSI2. Refer to Chapter 6 - Mapping for more instructions.

## PROFIBUS® Configuration


ProfiBus DP operates using a cyclic transfer of data between master(s) and slave(s) on an RS485 network. An assigned master periodically requests (polls) each node (slave) on the network. The HI 4050 is a slave device. All data communication exchanges between a master and the HI 4050 originate from the master device. Each HI 4050 is assigned to one master and only that master may write output data to that HI 4050. Other masters may read information from any slave, but can only write output data to their own assigned slaves.

Because ProfiBus uses a cyclic (periodic) polling mechanism between masters and slaves, it is also deterministic. Therefore behavior of a ProfiBus system can be reliably predicted over time. ProfiBus is designed to guarantee a deterministic response.

The length (and timing) of the I/O data to be transferred from a single slave to a master is predefined in the slave's device data base or GSD file. The GSD files of each device connected via the network (slaves and class 1 masters only) are compiled into a master parameter record which contains parameterization and configuration data, an address allocation list, and the bus parameters for all connected stations. A master uses this information to set up communication with each slave during startup. Slaves can only acknowledge the messages they receive or transfer messages to a master when the latter requests a slave to do so. Slaves are also designated as passive nodes.

### Configuring PROFIBUS From the Web Interface

- Step 1. From the Configuration menu select Options to open the Options menu; then Click on Profibus Card. to open the Click on Profibus Card form.

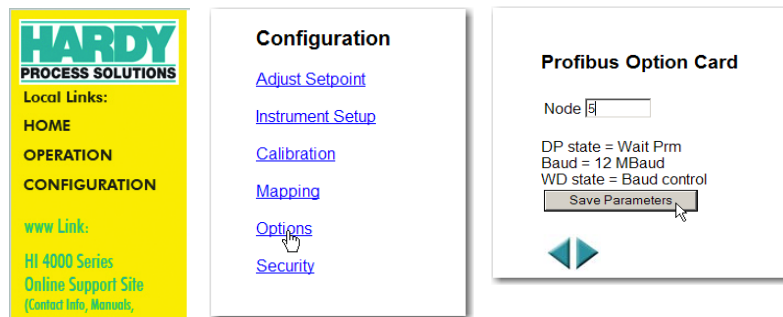

Double click in the Node text field to highlight the current entry. Type in the HI 4050 Node address. **Range:** 1-125 (default 5) Our example uses the default address #5.

#### NOTE

*PROFIBUS Node Address #5 is the lowest number that can be used by a slave device.*

- Step 2. Click Save Parameters to save the entry.

- Step 3. You can also read the communication status of the instrument.
- Step 4. Click Home to return to the Home Page.

### Initialization Process

To be able to add an HI 4050 to a Profibus-DP network, you need a PC and software such as Siemens Step 7™, Simatic Manager or equal, that allows the Profibus-DP PLC and the HI 4050 to exchange data.

### Profibus-DP .GSD File

All devices connected to a Profibus-DP network require a \*.gsd file. The \*.gsd file contains all the parameters including the baud rate, table formats and necessary data required by the network PLC when an HI 4050 is connected to the network.

A copy of the \*.gsd file can be found on the CD that comes with the instrument or at the Hardy Website or at <http://www.profibus.com/libraries.html>.

Whichever Simatic Manager you select, you must go through these three steps:

- Step 1. Connect the HI 4000 Series Instrument to the Profibus DP network and verify the address. (See the Installation Section for Installation and Cabling Instructions. )
- Step 2. Connect the PC to the Trunk Line. Load the configuration properties to the initialization software on the PC and transfer them to the PLC.
- Step 3. Install the \*.gsd file, and map I/O data table properties to the instrument.

### Pre-Initialization Procedures

- Step 1. Inspect the network cables and make sure that the cables have been installed correctly and satisfy the Profibus-DP guidelines for the data transmission baud rate(s) required. (See the Cabling Chapter/Profibus Installation in this manual for Profibus-DP cable specifications and cabling guidelines.)
- Step 2. Select the Node address for the HI 4050. (See below) This can be done before or after Initialization.
- Step 3. Cycle power, or perform the two previous steps before powering up your network. Address selection can only occur after cycling the power. Make sure that the software you use will detect the values as you have set them.

### CAUTION:

**The address should never be changed during operation. If the address is modified while on line, an internal error could be generated and the module disconnected from the network.**

## ATTENTION

**L'adresse ne devrait jamais être changée durant le fonctionnement. Si l'adresse est modifiée pendant la mise en ligne, une erreur interne pourrait être créée et le module sera déconnecté du réseau.**

*Profibus-DP provides a very flexible network solution. In addition to the basic guideline provided in this manual, your installation could require procedures that are beyond the scope of this manual. For more information and to locate lists of links to other sources of Profibus-DP information, check the Profibus website at <http://www.profibus.com>.*


- Step 4. Complete any additional configuration that is required by your PLC for initialization. Our initialization example is for a Siemens PLC. Your PLC initialization requirements may differ.
- Step 5. Install the \*.GSD file for the instrument you connected to the Profibus Network.

### Initialization Procedures


## NOTE

*The examples come from the Siemens Step 7™, Simatic Manager Software. Your software will vary from these procedures. Step 7™ is a trademark of the Siemens Corporation.*

- Step 1. In the Siemens Step 7™, Simatic Manager open the Hardware Catalog.
- Step 2. Click on the “+” to expand the Additional Field Devices Folder.
- Step 3. Click + to expand the General Folder.
- Step 4. Highlight the CPU you selected in the UR dialog box.
- Step 5. Double Click on “HI4000” or drag and drop the “HI4000” folder to the Profibus-DP Network.

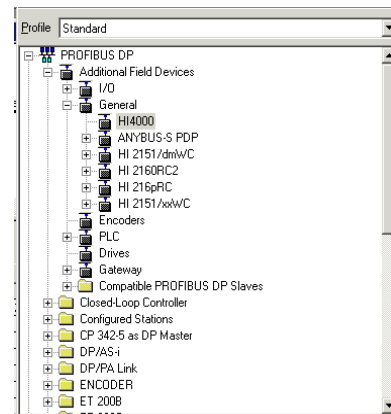

Step 6. This opens the HI 4000 PDP Parameters dialog box where you can set the address of the instrument, if necessary.

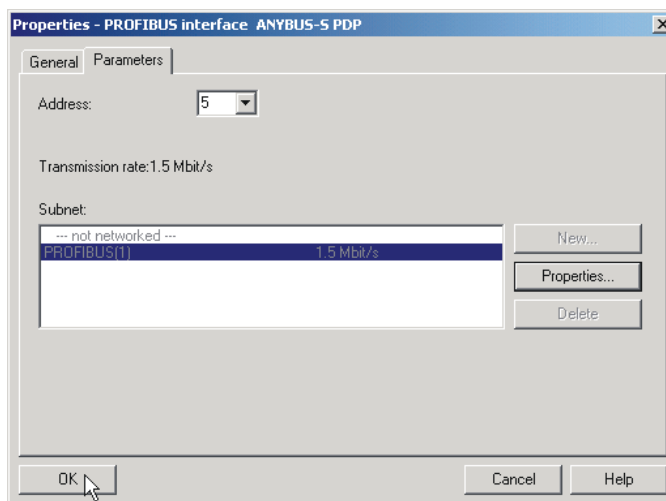




## NOTE

*The HI 4050 Series Input and Output Sizes are expressed in words. 16 words input and 16 words output.*


Step 7. Click OK to set the Node Address.

**Step 8.** The HI 4000 Series module appears in the Profibus Network.

**Step 9.** Click the **Download Icon** to download the configuration to the PLC and open the **Select Destination Module** dialog box.

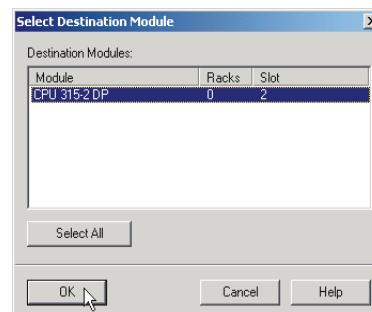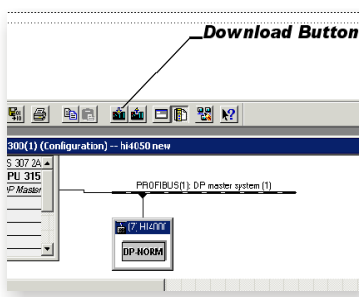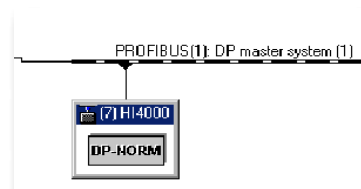


Step 10. Click OK to open the Select Station Address Dialog box; then click OK again. A status box will show the progress of configuration download to the PLC.

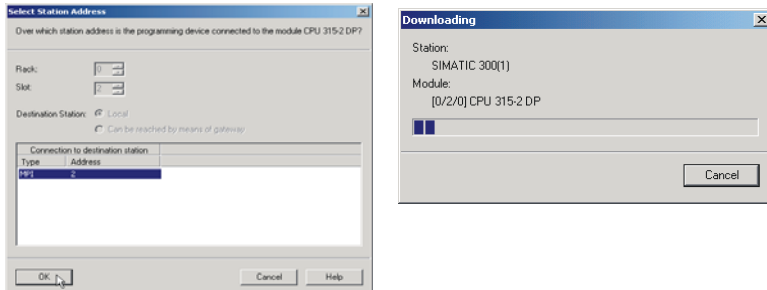


Step 11. When the download is complete the HW Config dialog box should look something like this.

Step 12. Initialization is complete.

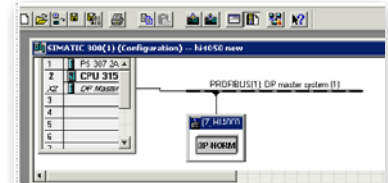


## Configuring Profibus from the Front Panel


Step 1. Select Options from the Configuration menu, then Profibus from the Options menu.

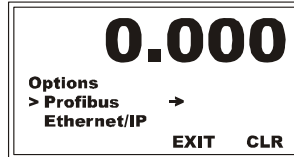


Step 2. Select Profibus Node to open the Profibus Node edit screen.

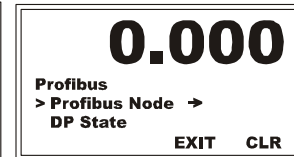

Step 3. Press CLR to clear the current entry and position the cursor, then use the up or down arrow to select the number for the right-most digit.

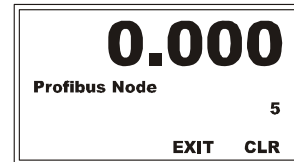

Step 4. Press the left arrow to move the cursor to the next digit, and use the up or down arrow to select the number for the left digit. Our example sets the Node Address at #7.

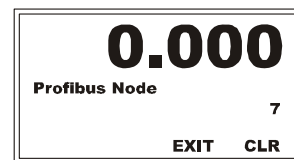


Step 5. Press Enter to save the entry.

Step 6. The other parameters are status indicators and are read only. The status indicators indicate the state of communications between the Master and the HI 4050.


### DP State (Read Only)

- 00 = Status "Wait\_Prm" (HI 4050 waiting for communications from the Master Device.)
- 01 = Status "Wait\_Cfg" (HI 4050 configuring for Data Exchange)
- 10 = Status "DATA\_EX" (HI 4050 Exchanging Data with Master)

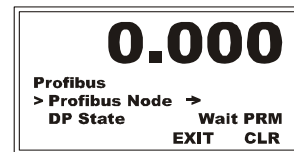

### WD State (Read Only)

- 00 = Status "Baud\_Search". (HI 4050 searching for baud rate.)
- 01 = Status "Baud\_Control". (HI 4050 found the baud rate.)
- 10 = Status "DP\_Control". (HI 4050 communicating at the current baud rate.)

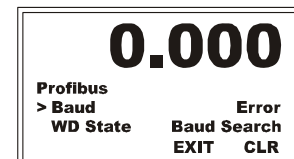

### Baud Rate


Reads the baud rate at which the HI 4050 communicates with the Master Device. If "Error" appears it means that no data is being exchanged between the HI 4050 and a Master device.

Press the Exit button until you return to the Summary display

## ControlNet Option Card

To set the ControlNet Parameters:

- Step 1. For Node, enter the Control-Net address of the HI 4050 (1 to 99). (If the node # you use does not work, try a different #.)
- Step 2. For Words Out, enter the number of 16-bit words (INT) to send the PLC (max 127). This must match the input table size in the PLC.
- Step 3. For Words In, enter the number of 16-bit words (max 127) from the PLC. This must match the output table size in the PLC, which may be either INT or DINT.
- Step 4. On the PLC, use the following parameters:
- Comm Format = Data In
  - PLC Input Assembly Instance = 100
  - PLC Output Assembly Instance = 150
  - PLC Config Instance = 0

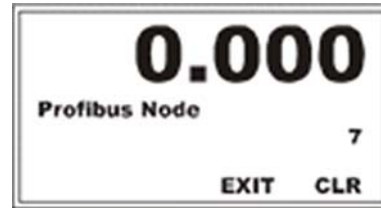

See the ControlNet example in Section 6, *Mapping*.




## Instrument Setup Configuration

From the Home Page click Configuration to open the Configuration page, and select Instrument Setup to open the Instrument Setup form.

The Weight Controller Configuration process sets up the instrument to operate as a scale. This includes configuring scale capacity, WAVERSAVER®, units of measure, motion tolerance and other instrument parameters required for your process. Use the form on the right to set up the parameters from the Web interface. They can also be set from the HI 4050 front panel, as described below.



Except for standard Ethernet TCP/IP communication parameters (IP Address etc.), all parameter configurations are stored in the Secure Memory Module (SMM-SD).

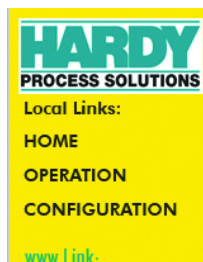

 A web-based configuration form titled "Configuration - Instrument Setup" with the subtitle "Center of Zero™". It includes a "HELP" link and a "Unit" dropdown set to "lb" with a "Change Unit" button. Below are various input fields: "Instrument ID" (HI 4050), "Operator ID" (Mel), "Decimal Point" (1), "Grads" (1), "Number of Averages" (10), "WAVERSAVER®" (1.00 Hz), "Low Pass Filter" (ON), "Motion Tolerance" (10.0), "Zero Tolerance" (10.0), "AutoZero" (OFF), "AutoZero Tolerance" (10.0), "Tare Weight" (0.0), "Scale Capacity" (330.0), and "Certification" (None). A "Save Parameters" button is at the bottom. At the very bottom, there is an "LCD Contrast:" section with "Darker" and "Lighter" buttons and a double-headed arrow.

### Working from the 4050 Display

Step 1. Starting from the Configuration menu, use the down arrow to scroll to Instrument Setup, then press Enter to display the Setup Menu.

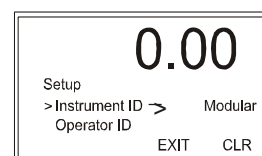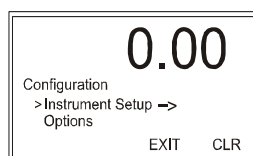

Step 2. Use the up or down arrows to scroll to the parameter to change.




## Parameters Configured

### Unit (of Measure) Parameter

The Unit (of measure) parameter sets the scale to either English or Metric units. The Selections are:



- Pounds (lb) - Default
- Ounces (oz)
- Pounds/Ounces (lb/oz)
- Ton (Ton) Short ton
- Kilograms (Kg)
- Grams (G)
- Metric Ton (t) Long ton

**On the Web form**, from the Units pull-down list, select the weight units to use, then click Change Unit to set the units value. Our example shows pounds (lb)

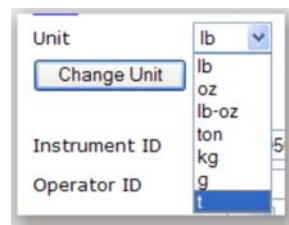

### On the 4050 display:

Step 1. If the cursor is not already in front of Units, press the down or up arrow to select Units.

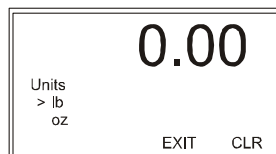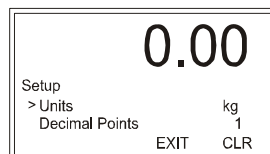

Step 2. Use the Left or Right arrow to select the Unit of measure.

Step 3. Press Enter to save the selection.

### Instrument ID Parameter


The Instrument ID parameter provides unique identification for the Weight Controller.

RANGE: 19 Characters (default MODULAR)

**On the Web page**, enter a name to identify the instrument in the Instrument ID text field. We used "HI 4050."



**On the 4050 display,** use the Down arrow to select Instrument ID, then press Enter to display the Instrument ID edit page.

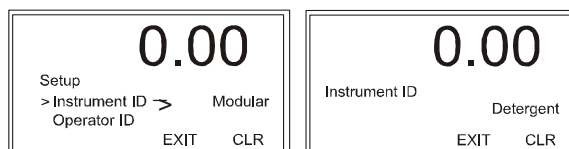

Use the left or right arrow to position the cursor and the up or down arrows change the value. Enter saves the entry.

### Operator ID Parameter


The Operator ID is the ID of the user who is going to operate the Weight Controller or service the instrument. Select three letters or numbers or any combination of letters and numbers that adequately identifies the user.

**On the Web page,** type a name that identifies the operator of this instrument in Operator ID text field.



**On the 4050 display:**

- Step 1. Press the Down arrow to select Operator ID.
- Step 2. Press Enter to open the Operator ID edit screen.

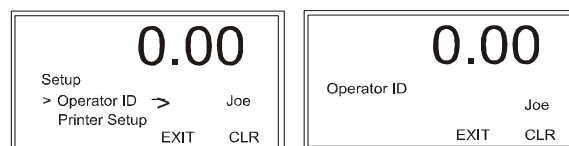


- Step 3. Use the left or right arrow to position the cursor and the up or down arrows change the value
- Step 4. When you have selected all the values, press Enter to save.

### Decimal Point Parameter


- Step 5. Use the Decimal Point Parameter to set the resolution you want for the instrument. Here you set the location of the decimal point for the weight resolution. The higher the number, the farther to the left the decimal point moves and the higher the resolution of the scale. Note that setting more decimal points does affect the overall accuracy of the instrument.

RANGE: 0-5 (default 2)

**On the Web page,** from the Decimal Point pull-down list, select the decimal position for this instrument.

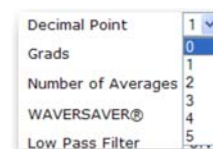

- Step 1. Use the Down arrow to select Decimal Point displaying the current number of digits setting.
- Step 2. Press the Right or Left Arrow buttons to select the Decimal point position, then press Enter to save the selection.

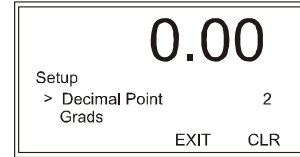


### Graduation Size Parameter

The Graduation Size is the Minimum increment displayed by the instrument. The Base Graduation Number can be calculated by dividing the Total Load Cell Capacity by 10,000.

For example, with two decimal points selected, the graduation size 10 will display increments of .10 engineering units and the graduation size 50 will display increments of .50 engineering units. For a scale with 10,000 capacity, graduation size = 1


RANGE: 1, 2, 5, 10, 20, 50, 100, 200, 500, 1000 (default 1)

**On the Web page**, from the Grads pull-down menu, select the Graduation Size Parameter for this instrument.

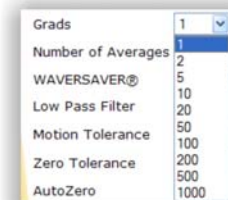

**On the 4050 display:**

- Step 1. Use the Down arrow to select Grads.
- Step 2. Use the Right or Left arrows to select the Graduation Size for the instrument, then press Enter to save the selection.

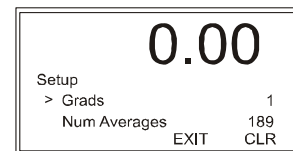

### Number of Averages Parameter

The value you enter for Number of Averages sets the number of weight readings used to compute a sliding average of displayed weight. This helps reduce the effects of material impact and/or vibration if material does not enter or exit the scale evenly. This setting is to aid in ignoring the effects of material impact and/or vibration. Applications requiring very quick weight readings should reduce this setting to its minimum. If the weight is unstable, increase the averages. The Weight Controller does 110 updates per second, which translates to an update approximately every 10 milliseconds. If you average enough weight readings, the weight loss or gain remains smooth. If you average the weight too much you can cause over filling. Also see WEVERSAVER for information on filtering unstable weight readings.


RANGE: 1-250 (default 10)

**On the Web page,** enter the value for the number of readings to factor into the average. Our example (for illustration only) has set 10 for Number of Averages. Yours will vary depending on your application.



**On the 4050 display:**

- Step 1. Use the Down arrow to select Num Averages, and press Enter to display the Num Averages Edit screen.

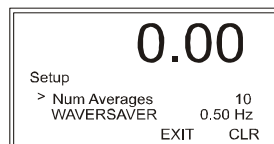

- Step 2. Use the left or right arrow to position the cursor and the up or down arrows change the value

- Step 3. When you have selected all the values, press Enter to save.

### The WAVERSAVER® Parameter

Typically, mechanical noise (from other machinery in a plant environment) is present in forces larger than the weight variations you want to detect. WAVERSAVER® reduces the effects of the vibratory forces that exist in all industrial weight control and measurement applications so the device can better calculate the actual weight. WAVERSAVER enables the Weight Controller to distinguish between actual weight data and mechanical noise, both of which are typically conveyed in the load cell signal. WAVERSAVER can be configured to ignore noise with frequencies as low as 0.25 Hz. One of four higher additional cut off frequencies may be selected to provide a faster instrument response time. The function is user selectable and can be turned off.

RANGE: .25 Hz, .50 Hz, 1.0 Hz, 3.50 Hz, 7.50 Hz, OFF (default 1.0 Hz)

Section 1 describes the benefits of using the WAVERSAVER feature.


**On the Web page,** from the pull-down list, select the value for WAVERSAVER.



**On the 4050 display:**

- Step 1. Use the Down arrow to select WAVERSAVER.

- Step 2. Press the Right or Left Arrow buttons to select the WAVERSAVER setting for your instrument, and press Enter to save the selection.

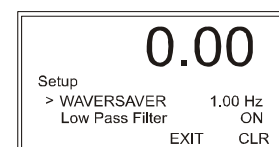


The Low Pass filter can be toggled on or off. When it is on it provides a more stable weight reading but at the expense of the reaction time. Some applications require the additional stability. If reaction time is not critical, leave the Low Pass Filter On, otherwise turn it off.

**On the Web page**, from the Low Pass Filter pull-down list, select ON to turn the filter on or OFF to turn it off. For most applications the Low Pass Filter should remain ON.



- Step 1. Press the down arrow to select Low Pass Filter.
- Step 2. Press the right arrow to toggle between ON or OFF.
- Step 3. Press Enter to save your choice.

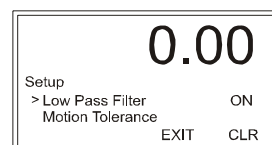


The value you enter for Motion Tolerance sets the amount of deviation to allow for your process. This value must be greater than or equal to the Graduation Sizes. We recommend 3 graduation sizes

Base Motion Number = (Total Load Cell Capacity x 0.0003)

RANGE: .000001 - 999999 (default 10)

Motion Tolerance 10.0

Step 1. After selecting Motion Tolerance with the down arrow on the Setup menu, press Enter to display the Motion Tolerance edit form.

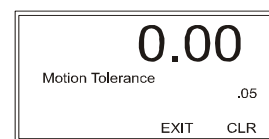

Step 4. Use the left or right arrow to position the cursor and the up or down arrows change the value. Our example uses .05, which is for illustration only. Yours will vary depending on your application.

**Step 5.** When you have selected all the values, press **Enter** to save.

### Zero Tolerance Parameter (Gross Weight)

The value you enter for Zero Tolerance sets the weight unit limit from zero the instrument will accept as gross zero during the zeroing function (when you push the Zero button).


RANGE: .000001 - 999999 . (default 10.0)

**On the Web page**, enter the value in the text box provided. Our example, for illustration only, sets Zero Tolerance to 10.

A web interface showing a label 'Zero Tolerance' followed by a text input box containing the value '10.0'.

### On the 4050 display:

- Step 1. Use the Down arrow to select Zero Tolerance, then press Enter to display the edit form.

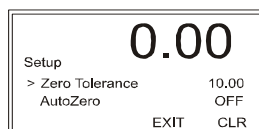A digital display showing '0.00' at the top. Below it, the word 'Setup' is displayed. Under 'Setup', there are two lines: '> Zero Tolerance' and 'AutoZero'. To the right of these lines are the values '10.00' and 'OFF' respectively. At the bottom, there are two buttons labeled 'EXIT' and 'CLR'.A digital display showing '0.00' at the top. Below it, the label 'Zero Tolerance' is displayed. To the right of the label is the value '5.00'. At the bottom, there are two buttons labeled 'EXIT' and 'CLR'.

- Step 2. Use the left or right arrow to position the cursor and the up or down arrows change the value. When you have selected all the values, press Enter to save.

### AutoZero and AutoZero Tolerance Parameters (Gross Weight)


Setting the AutoZero Parameter to ON automates the zeroing function. When AutoZero is ON, if the motion is within tolerance and the value is within the AutoZero tolerance value, the instrument is automatically zeroed every few seconds until you turn off AutoZero. This does not override the Zero button. You can still press the Zero button to zero the HI 4050 at any time, but AutoZero is useful in applications where you are zeroing a scale quite often and don't want to push the Zero button each time.

RANGE: .000001 - 999999 . (default 10.0)

The AutoZero Tolerance parameter sets the weight units from zero that will be accepted as zero by the instrument. Set the AutoZero Tolerance parameter slightly smaller than the Tolerance parameter so that if the AutoZero Tolerance is exceeded for some reason you have a backup to zero the instrument.

RANGE: .000001 - 999999 . (default 10.0)


**On the Web page**, the AutoZero Parameter defaults to OFF. Turning it ON automates the zeroing function. You must then set the value for AutoZero Tolerance.

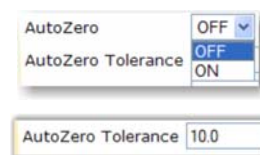Two web interface elements. The top one shows 'AutoZero' with a dropdown menu set to 'OFF' and 'AutoZero Tolerance' with a dropdown menu set to 'ON'. The bottom one shows 'AutoZero Tolerance' followed by a text input box containing the value '10.0'.




#### On the 4050 display:

- Step 1. Use the Down arrow to select AutoZero.
- Step 2. Use the Left or Right arrows to toggle between On and Off, and press Enter to save the entry.

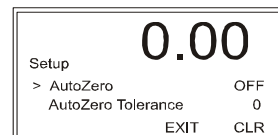

- Step 3. Use the down arrow to select AutoZero Tolerance, and press Enter to display the AutoZero Tolerance edit screen.
- Step 4. Use the left or right arrow to position the cursor and the up or down arrows change the value.
- Step 5. When you have selected all the values, press Enter to save. Our example (for illustration only) shows 4.85 for our AutoZero Tolerance. Yours will vary depending on your application.

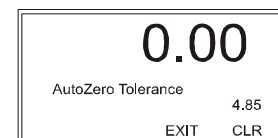

#### Tare Weight Parameter (Net Weight)

The value you enter for Tare Weight allows the user to avoid pushing the Tare button each time he/she weighs something.



RANGE: .000001 - 999999 . (default 0.0)

On the Web page, enter the weight in the text box provided



#### On the 4050 display:

- Step 1. Use the Down arrow to select Tare Weight, then press Enter to display the Tare Weight edit screen.

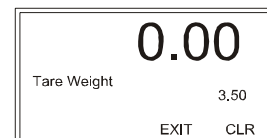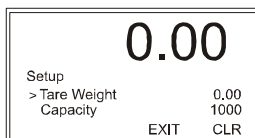

- Step 2. Use the left or right arrow to position the cursor and the up or down arrows change the value.
- Step 3. When you have selected all the values, press Enter to save. Our example shows 3.50, which is for illustration only.

#### Capacity Parameter

Scale Capacity is the scale's nominal operating capacity (the total weight capacity of the scale system). If this value is exceeded by six graduations, dashes appear on the front display. Communications to and from optional devices are not effected.

RANGE: .000001 - 999999 . (Default 999999)

On the Web page, enter the capacity in the text box provided



#### On the 4050 display:

Step 1. Use the down arrow to select capacity, then press Enter to display the Capacity edit screen.

|               |         |
|---------------|---------|
| 0.00          |         |
| Setup         |         |
| > Capacity    | 1000.00 |
| Instrument ID | Modular |
| EXIT          | CLR     |

|          |         |
|----------|---------|
| 0.00     |         |
| Capacity |         |
|          | 1500.00 |
| EXIT     | CLR     |

Step 2. Use the left or right arrow to position the cursor and the up or down arrows change the value.

Step 3. When you have selected all the values, press Enter to save. Our example, for illustration only, uses 1500.00.

#### Certification Parameter

The Certification parameter allows you to select the Certification to apply. If you select US NTEP or Canada, you can no longer tare with a negative gross weight.

#### NOTE

*Selecting either of these parameters sets the instrument to meet the certification standard, but it does not generate a certification. To obtain NTEP or Canada certification, you must have the appropriate agency come and certify the instrument.*

RANGE: NTEP, MC, None. (Default None)

**On the Web page**, for Certification, select the certification type from the pull-down list.

Click Save Parameters when you have finished this screen.

|                 |             |
|-----------------|-------------|
| Certification   | None        |
| Save Parameters | None        |
|                 | NTEP 10000d |
|                 | MC 3000d    |

#### On the 4050 display:

Step 1. Use the Down arrow to select Certification and click Enter to open the Certification edit page.

|                 |         |
|-----------------|---------|
| 0.00            |         |
| Setup           |         |
| > Certification | NTEP    |
| Instrument ID   | Modular |
| EXIT            | CLR     |

|               |      |
|---------------|------|
| 0.00          |      |
| Certification |      |
|               | NTEP |
| EXIT          | CLR  |

Step 2. Use the Left or Right arrows to scroll the options, and press Enter to save.

#### LCD Contrast Parameter

Note that the Instrument Configuration Setup page allows you to change the contrast on the HI 4050 display by clicking the Darker or Lighter buttons.

|               |        |         |
|---------------|--------|---------|
| LCD Contrast: | Darker | Lighter |
|---------------|--------|---------|

To set the LCD Contrast Parameter from the 4050 display:

Step 1. From the Setup menu press the down arrow to select CONTRAST.

Step 2. Press the left or right arrow button to increase or decrease the contrast and press Enter to save.

|            |     |
|------------|-----|
| 0.00       |     |
| Setup      |     |
| > CONTRAST |     |
| Unit       | lb  |
| EXIT       | CLR |

## Printer and Time Setup Parameters

### Printer / Scoreboard Setup

The Print parameters can output values, e.g., the Gross, Net and Tare with a Rate of Change Option and weight units (lb, kg etc.), to either a Printer or a Scoreboard display.

**Print Mode:** For all modes, the information sent to the printer includes terminal etc., the current time/current date, and the mode.

The mode choices are:

- Gross, Net or Tare
- All (Gross, Net, Tare)
- ROC (Rate of Change)
- Scoreboard: Outputs to a device that displays weight data in large print.

#### NOTE

*See your Network Administrator if you don't know the correct values for Baud Rate, Parity, and Data Bits.*

**Baud Rate:** RANGE: 300, 1200, 2400, 4800, 9600 (default), 19200

**Parity:** RANGE: NONE (default), ODD, EVEN

**Data Bits:** RANGE: 7 OR 8 (default)

### Setup From the Web Interface

Step 1. Click the right green arrow at the base of the Instrument Setup form to open the Configuration - Printer form.



Step 2. Select the print mode, baud rate, parity, and data bits from the pull-down lists.

Step 3. Click Save Parameters when you finish.

### Setup From the 4050 Interface

Step 4. Use the down arrow to select Printer Setup, and press Enter to display the Printer Setup menu.

|                 |     |
|-----------------|-----|
| 0.00            |     |
| Setup           |     |
| > Printer Setup | >   |
| Time            |     |
| EXIT            | CLR |

Step 5. Select Printer Mode.

Step 6. To set the Printer Mode (If the option is enabled), use the Left or Right arrows.

|                |            |
|----------------|------------|
| 0.00           |            |
| Printer Setup  |            |
| > Printer Mode | >          |
| Baud Rate      | Gross 1920 |
| EXIT           | CLR        |

|                |                 |
|----------------|-----------------|
| 0.00           |                 |
| Printer Setup  |                 |
| > Printer Mode | >               |
| Baud Rate      | Scoreboard 9500 |
| EXIT           | CLR             |

#### NOTE

*If the Scoreboard is configured, the Print button does not function.*

Step 7. Select Baud Rate.

Step 8. Press the left or right arrows to set the Baud Rate, then press Enter to save the entry.

|               |           |
|---------------|-----------|
| 0.00          |           |
| Printer Setup |           |
| > Baud Rate   | >         |
| Parity        | 1920 NONE |
| EXIT          | CLR       |

Step 9. Select Parity.

Step 10. Press the left or right arrows to set the Parity, then press Enter to save the entry.

|               |        |
|---------------|--------|
| 0.00          |        |
| Printer Setup |        |
| > Parity      | >      |
| Data Bits     | NONE 8 |
| EXIT          | CLR    |

Step 11. Select Data Bits.

Step 12. To change the Data Bits value, press the left or right arrow to toggle between 8 and 7, then press Enter to save your selection.

|               |         |
|---------------|---------|
| 0.00          |         |
| Printer Setup |         |
| > Data Bits   | >       |
| Printer Mode  | 8 Gross |
| EXIT          | CLR     |

Step 13. Press Exit to return to the Setup Menu.


### Configuring Date and Clock

You can set Hour, Minute, Month, Day and Year parameters here. These settings are the times stamps for the alarms. You can also select Greenwich Mean Time.

#### NOTE

*To set up Greenwich Mean Time, see Appendix A*

Step 1. Click the right green arrow at the base of the Printer Setup form to open the Configuration - Date and Time form.



### Configuration - Date and Time

Enter Time and Date parameters for the fields below.

Center of Zero™

**Set Date/Clock**

Minute - mm

Hour - hh

Day - dd

Month - mm

Year - yyyy

time zone  ▼

**Save Parameters**

- Step 2. Enter the current hour, minute, day, month, year, and time zone in the appropriate text fields.
- Step 3. Click Save Parameters to save the Date and Clock parameters.

Step 1. Press the Down arrow to select Time.

0.00

Setup  
> Time →  
Ethernet

EXIT CLR

Time  
> Timezone PST (GMT- 8h)  
Time - Year 2009  
EXIT CLR

- Step 1.** Press Enter to display the Time Setup Menu with the cursor in front of Time Zone.

- Step 2. Press the Left or Right arrows to select the time zone in your location.  
RANGE: 24 zones (Default PST -8H)

- Step 3.** Press Enter to save the zone and display the time screen with the cursor in front of Time-Year showing the currently set value.

- Step 4. Press Enter to display the Time - Year edit screen.

Time  
> Time - Year      2009  
Time - Month      1  
EXIT      CLR

0.00

Time - Year

2009

EXIT CLR

- Step 5. Use the left or right arrow to position the cursor and the up or down arrows change the value. When you have selected all the values, press Enter to save.

RANGE: YYYY (four digits no default)

- Step 6.** Press the Down arrow to select Time - Month, and press Enter to display the Time - Month edit screen.

0.00

Time

>Time - Month > 0

Time - Day 0

EXIT CLR

0.00

Time - Month 7

EXIT CLR

Step 7. Use the left or right arrow to position the cursor and the up or down arrows change the value. When you have selected all the values, press Enter to save and display the next screen.

RANGE: (1 - 12 with no default)

Step 8. Press the Down arrow to select Time - Day, and press Enter to view the Time - Day edit form.

|              |      |     |
|--------------|------|-----|
| Time         | 0.00 |     |
| > Time - Day |      | 0   |
| Time - Hours |      | 7   |
|              | EXIT | CLR |

|            |      |     |
|------------|------|-----|
| Time - Day | 0.00 |     |
|            |      | 13  |
|            | EXIT | CLR |

Step 9. Use the same procedure described for setting the month to set the day.

RANGE: DD (1-31 with no default)

Step 10. Press the Down arrow to select Time - Hours, and press Enter to display the Time - Hours edit form.

|                |      |     |
|----------------|------|-----|
| Time           | 0.00 |     |
| > Time - Hours |      | 7   |
| Time - Minutes |      | 31  |
|                | EXIT | CLR |

|              |      |     |
|--------------|------|-----|
| Time - Hours | 0.00 |     |
|              |      | 13  |
|              | EXIT | CLR |

Step 11. Use the same procedure described for setting the month to set the hour using the 1-24 hour format.

RANGE: HH (1-24 with no default)

Step 12. Press the Down Arrow button to select Time - Minutes, and press Enter to display the Time - Minutes edit form.

|                  |      |                |
|------------------|------|----------------|
| Time             | 0.00 |                |
| > Time - Minutes |      | 32             |
| Timezone         |      | PST (BMT - 8h) |
|                  | EXIT | CLR            |

|                |      |     |
|----------------|------|-----|
| Time - Minutes | 0.00 |     |
|                |      | 31  |
|                | EXIT | CLR |

Step 13. Use the same procedure described for setting the month to set the current minutes.

RANGE: MM (1-60 with no default)

## Set Points

A set point value is a threshold weight or level based on the Unit (of Measure) you select during system configuration. It may be set in either net or gross weight units. Up to four setpoints are available for optional use. This subsection describes the attributes you can assign to a setpoint during setup configuration.

However, setpoints are used mainly for mapping digital I/O communications between the HII 4050 and network devices (e.g., PLCs). You define the use of a setpoint value based on how you apply that value within a mapping equation. See Section 6 for mapping information. Also, some setpoint target values may be changed while the system is operating to accommodate changes in the operation. See Section 7 for information on resetting setpoints during system operation.


## Parameters

### Deadband Limit, Preact Limit, and Type

The Deadband limit is the difference between the set point and the reset. It is used to prevent rapidly fluctuating setpoint states once the set point is reached. For example, with a set point value of 1000 pounds and a deadband set to 5 pounds, the relay would close at 1000 pounds but not open until the weight dropped to 995 pounds.

The preact value is the difference between the set point and the trip point. It is used as a compensation value when filling a vessel. If set to zero, there is no compensation.

You need to select the Type. Gain in Weight is used if a setpoint is a high trip limit. Loss in Weight and deadband is used for a low trip limit, as shown in the pictures below.

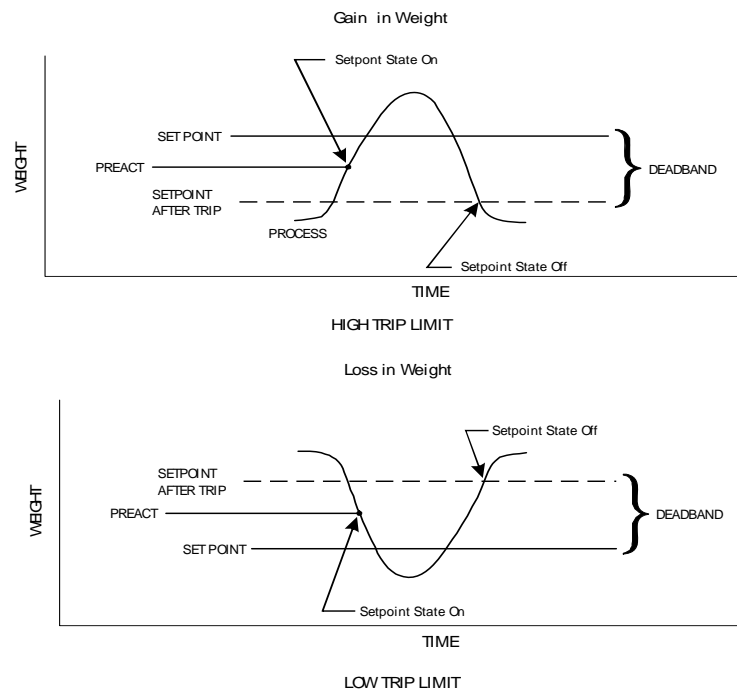

### Mode

Specifies which weight source to use as the setpoint input (GROSS, NET, or ROC).

### Target Weight

Setpoint target weight. A setpoint ON/OFF status change is based on this value combined with the effect of implementing Deadband and Preact limits.

### Type

The options determine which formula to apply:

**Gain in Weight:** The setpoint turns on when the weight is greater than the setpoint target minus the preact and off when the weight is less than the target minus the deadband or

**Loss in Weight:** The setpoint turns on when the weight is less than the setpoint target plus the preact and off when the weight is greater than the setpoint plus the preact

### Entering Set Points from the Web Page

From the Configuration menu, click Adjust Setpoint to open the Setpoint form. The purpose of each parameter on this form is described above. This section describes only the procedure for setting the values.

The Save Parameters button lets you save parameters either individually or after you have entered/selected all of the parameter values.

Step 1. To select the Setpoint to configure, use the pull-down list below the Help link. Our example has selected Setpoint 1, which appears in the text field.

Step 2. Use the pull-down lists to select the Mode and Type. Our example shows *Gross* for mode and *Loss in Weight* for Type.

Step 3. Enter the values for Target weight, Preact, and Deadband in their respective edit boxes. Our example shows a Target weight of 180.00 lbs., a Preact limit of 5.00 lbs., and a Deadband limit of 8.00 lbs..

Step 4. Click Save Parameters to save the Setpoint parameters to non-volatile memory. All Set Points are configured the same. To configure other Setpoints, repeat the procedures in this section.




Note the Setpoint Input number displayed below the Save Parameters button. This is read only and indicates the Setpoint you are currently configuring. The high or low is an indication of the output condition of the set point.


### Entering Set Points from the Front Panel

All four set points are configured the same way. The procedures is.

- Step 1. To select the setpoint to configure, starting from the Configuration Menu, use the down arrow to select Setpoints and press Enter to open the Setpoint menu..

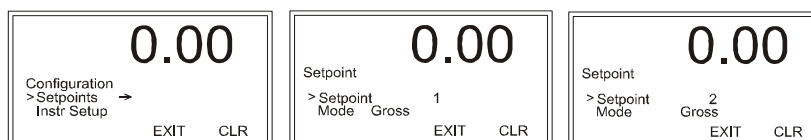


- Step 2. Use the left or right arrow to select the Setpoint. Our example shows Setpoint 2. Press Enter to save the selection. Each time you save a Setpoint value, an “Entry Accepted” message briefly appears and you are returned to the Setpoint menu. If the Entry is not accepted, an error message will indicate the reason. For help with the error message, see Chapter 8, Troubleshooting.

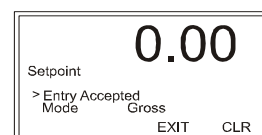


- Step 3. If necessary, use the down arrow to select Mode; then use the Right or Left arrow to toggle between Gross, Net or available Rate of Change modes. Our example shows Gross.



- Step 4. Press Enter to save the selection and return to the Setpoint menu, where you next select Type.

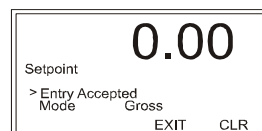

- Step 5. Use the Right or Left Arrows to toggle between Loss in Weight and Gain in Weight; then press Enter to save you choice and return to the Setpoint menu.

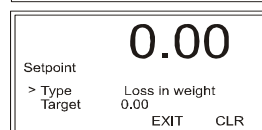

- Step 6. The same procedure is used to set all remaining values on the Setpoint menu:

- Select the value (Target, Preact, or Deadband) and press Enter to activate the edit form. Each value is a weight in the units you selected earlier for Units.
- Use the left or right arrow to position the cursor and the up or down arrow to select the value.
- Press Enter to save and return to the Setpoint menu.



Step 7. For Target, our example shows 100.00 for target weight.

|  |   |
|--|---|
| <div>0.00</div> <div>Setpoint</div> <div>&gt; Target → 0.00</div> <div>Preact 0.00</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Target</div> <div>100.00</div> <div>EXIT CLR</div> |
|--|---|

Step 8. Our example uses a Preact limit of 5.00.

|  |   |
|--|---|
| <div>0.00</div> <div>Setpoint</div> <div>&gt; Preact → 0.00</div> <div>Deadband 0.00</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Preact</div> <div>5.00</div> <div>EXIT CLR</div> |
|--|---|

Step 9. Our example uses a Deadband limit of 80.

|  |  |
|--|--|
| <div>0.00</div> <div>Setpoint</div> <div>&gt; Deadband → 80.00</div> <div>Input 0.00</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Deadband</div> <div>80.00</div> <div>EXIT CLR</div> |
|--|--|

Step 10. Press the down arrow to select Input. The read-only Input value is the weight on the scale in the setpoint mode (Gross, Net or Rate of Change) selected.

|  |                             |
|--|-----------------------------|
| <div>0.00</div> <div>Setpoint</div> <div>&gt; Output</div> <div>Setpoint</div> <div>EXIT CLR</div> | <div>LOW</div> <div>1</div> |
|--|-----------------------------|

Step 11. Select Output, which is also read-only. This value shows the input as either high or low relative to the Target weight. If the target weight is lower than the input, Output reads LOW. If the target weight is higher than the setpoint, Output reads HIGH.

|   |                                |
|---|--------------------------------|
| <div>0.00</div> <div>Setpoint</div> <div>&gt; Input</div> <div>Output</div> <div>EXIT CLR</div> | <div>0.00</div> <div>LOW</div> |
|---|--------------------------------|

## HI 4050 Security

The security system can be used to:

- Protect the entire Web interface and front panel from unauthorized access
- (front panel only) Limit access to selected functions by those who have basic access

To gain access to protected interfaces and functions, the user must enter a security code. Note that Web page security can be assigned to use require either the medium or high level code for access, but not both, while security for the front panel can be set to one level and access to specific functions via the front panel can be set do a different level.

### Configuring HI 4050 Security from the Web Page

Step 1. From the Configuration Page select Security to open the Security page.

The text field allows only short integers. Enter only numbers (in any combination).

#### Configuration

[Adjust Setpoint](#)

[Instrument Setup](#)

[Calibration](#)

[Mapping](#)

[Options](#)

[Security](#)

#### Configuration - Security

[HELP](#)

High Security Code

Medium Security Code

Front Panel TARE/ZERO Security

Front Panel Calibration Security

Web Page Security

Be sure to write down the codes you use and store them in a secure location in case you need to refer to them again.

Step 2. Type in the High Security and Medium Security codes in the appropriate text boxes. To NOT set High and/or Medium Security Codes, enter 0.

Step 3. For the field Front Panel TARE/ZERO Security, use the pull-down list to select the level of security for taring and zeroing the instrument from the front panel.

Step 4. Use the pull-down lists in the same way to set the levels of security for Front Panel Calibration Security and Web Page Security.

Step 5. When you finish, click Save Code to save the security settings.

## Setting Parameter Security

Now that you have created a High and Medium Security Code you can now use a dollar sign notation to set security on any of the parameters you want. If you want to require a password for changing units you can enter one dollar sign \$ for Medium Security Code or two dollar signs \$\$ for High Security Code. This can be done by editing the Parameter Dump.


For example: If you want a high security code for Units, enter the following:

00000001 \$\$Unit=0 (lb)


Step 1. From the Home page click Operation to display the Operation page, and click Diagnostics to display the Diagnostics page

Step 2. Click the Parameters hypertext link to list the parameter configurations.

Step 3. Click next to the Parameter text for which you want to set a security code.

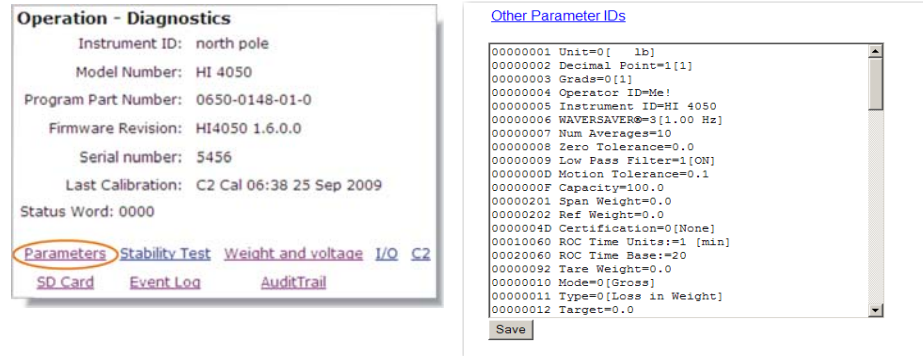


Step 4. Add two dollar signs for High security or one (1) dollar sign for Medium security. Our example shows two (High security).

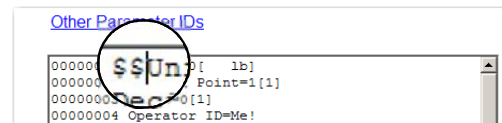

Step 5. Click the Save button to save the security changes.

Step 6. Click the back arrow to get back to the Home Page.

Step 7. A user wanting to change the Unit parameter must know the High Security Code password.




## NOTE



If you have not set a Medium or High Security Code and enter dollar signs for a parameter(s) the instrument disregards the security code. You must enter a High or Medium security code before entering the dollar signs.

## Configuring Security from the Front Panel

Step 1. From the Configuration Menu press the down arrow to select Security. Verify Password 0 appears if you have set a High or Medium password for Configuration.

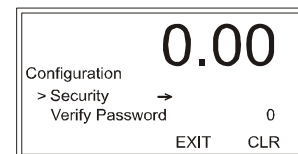

Step 2. Press Enter to open the Security Menu; then select High Password to display the High Password editing form.

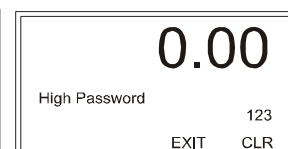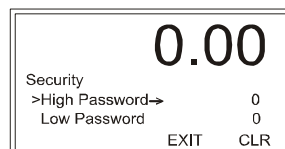

- Step 4.** Use the Down arrow to select Medium Password, and press Enter to display the Medium Password edit form.

```

0.00
Security
> Medium Password      →      0
Tare/Zero sec          NONE
EXIT      CLR

```

0.00

Medium Password 456

EXIT CLR

- Step 6.** To set security for the Tare/Zero functions, press the down arrow to select “Tare/Zero Sec.

0.00

Security  
>Tare/Zero sec MEDIUM  
Calib Sec NONE  
EXIT CLR

- To Tare or Zero the instrument you need a password. When you Tare or Zero the instrument, Verify Password appears.

Zero  
> Verify Password →  
EXIT CLR

0.00

Verify Password

456

EXIT CLR

- Step 9.** Use the password procedure described above for all Sections that are assigned a password. For example, you can assign a password to the Calibration Section and to the Web Page.


Security  
>Calib Sec  
Web Sec

0.00

→ HIGH  
MEDIUM  
EXIT CLR

The IP Setup program comes on the installation disk or it can be downloaded or run from the Hardy Instruments Web site (See *Software Downloads for your HI-4050* above). To run the program, you must be on the same network as the HI-4050 and your firewall must be set to allow the process.

When you run the the IP Setup program from a network computer, it will find the HI-4050 and allow you to set its IP address.

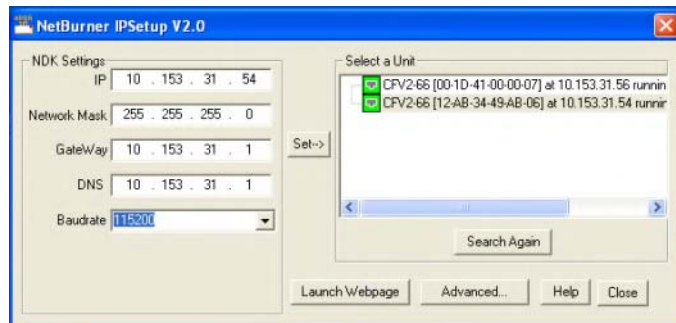

# Chapter 5

## Calibration

.....

Chapter 5 describes calibration procedures. For the Weight Controller to give precise readings, it must be routinely calibrated both during operation and when it has not used for an extended period of time. It is important that users and service personnel be familiar with the procedures in this chapter before installing or operating the HI 4050 Weight Controller.

All calibration is done in the Gross mode. Be sure to follow all the procedures completely to insure that the weights read by the controller are accurate.

### Pre-Calibration Procedures

#### Mechanical Check Procedures

Check to determine if the load cells have been installed properly. Refer to your load cell I&M manual for proper installation instructions. On some load cells an arrow indicates the direction of applied load. If the arrow points in the wrong direction, change the position of the load cell so that it is mounted in the direction of the applied load.


Check for Binding on the Load Cell or other parts of the system.

**CAUTION - Binding on a Scale/Vessel or Load Cell does not allow the load cell free vertical movement and may prevent the instrument from returning to the original zero reference point.**

**ATTENTION – La reliure sur une Scale/Vessel ou Load Cell ne permet pas à la Load Cell de faire des mouvements verticaux et peut éviter à l'appareil de revenir au point original de référence zéro.**

A load cell must be mounted so that 100% of the load (Vessel + Contents) are vertically passing through a load cell.

- Visually check to see that nothing is binding the load cell or other parts of the weighing system.

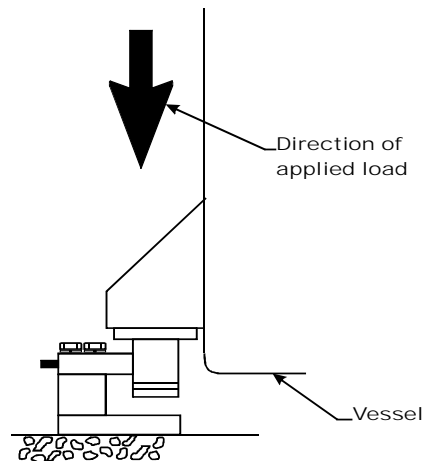

- Make sure that nothing is draped over the scale/vessel or the load cell, such as a hose, electrical cord, tubes, or other objects.
- Check to see that nothing comes in contact with the scale/vessel other than service wires and piping that have been properly mounted with flexible connectors.

### Electrical Check Procedures


Check to see that there is power to the Weight Controller.

- If there is power to the controller the front panel display should be lit.
- If the display appears with a value the unit is ready for calibration.

The 4050 supplies 5 VDC excitation to as many as eight 350 ohm load cells/points, and the expected output from each load cell/point depends on the mV/V rating of the load cell/point and weight.

Typical Load Cell/Point Input/Output Measurements (EXC & SIG outputs)

- A 2 mV/V load cell/point will respond with a maximum of 10 mVDC at full weight capacity where the system includes the weight of the vessel and the weight of the product as measured by the load cell/point.
- If the load cell/point weight capacity is rated at 1000 pounds, the load cell/point output will be 10 mVDC at 1000 pounds, 7.5 mVDC at 750 pounds, 5 mVDC at 500 pounds and so on.
- A zero reference point will vary from system to system depending on the “Dead Load” (weight of the vessel and appurtenances only, with no product loaded) of the vessel. The example below uses a dead load of 500 lbs.

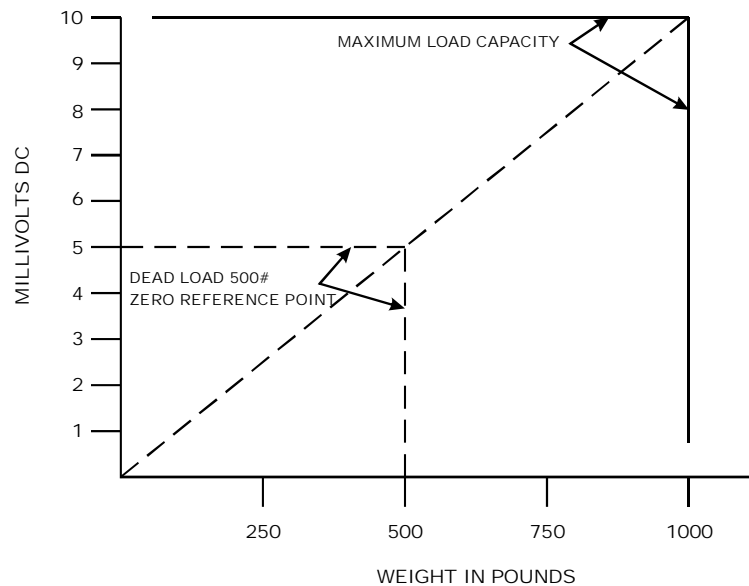



Based on this example, the operating range for this scale is 5-10 mVDC with a 500 pound weight. Understand that after zeroing the instrument the 0 reading on the instrument refers to the zero reference point and not absolute 0 mVDC or absolute 0 weight.

**NOTE**

*Load cell/point measurements can be checked with a digital voltmeter at the J1 connector on the rear panel or at the summing box of the HI 4050 or use Integrated Technician if you are using the IT Junction Box.*

*Allow the instrument to warm up for about 15 minutes before doing the calibration procedures. Mechanically exercise the scale using maximum load several times before final calibration.*

## Calibration Procedures

### C2 Calibration

C2 Electronic Calibration calibrates a scale system electronically without using certified test weights. It uses up to eight load sensors, a junction box, interconnect cable and an instrument with C2 capabilities, such as the HI 4050 Weight Controller. Digital information within an HI C2-certified load sensor details its unique performance characteristics. The HI 4050 Weight Controller reads the performance characteristics of each load sensor and detects the number of load sensors in the system.

Before running C2 calibration, run all of the pre-calibration procedures. Make sure you have configured the HI 4050. This includes setting the units, decimal point, scale capacity, averages etc. For instructions please see Chapter 4, Configuration.

#### Reference Weight

Reference Weight is the total live load that is currently on the scale. The calibration process uses a reference weight, which is normally zero (no weight on the scale), but can be any known weight on the scale. With nothing on the scale, the Reference Weight is 0.00. With 5 lbs on the scale, the Reference Weight is 5.00 lbs.

#### Gravitation Correction

Objects weigh about 0.5% less at the equator than they weigh at each pole because the force of gravity is less at the equator than at the poles. For example an object weighing 100 pounds at the North Pole on a spring scale would weigh 99.65 pounds at the equator. Depending on the latitude of your location, your scales would measure somewhere in between. The table below shows the gravitation correction factor for various cities around the world. Mexico City (1.002102) is the lowest and Oslo (0.998726) and Helsinki (1.001405) are the highest.

In general if your location is between the 45th parallel and the equator, gravity correction is greater than 1.0. For example, at these latitudes, because the gravity is less, you are adding, 1.0006 for an error that is .06%). For locations between the 45th parallel and the North or South Pole your correction factor will be less than 1.0. For example .9994 for an error that is -.06%.

# NOTE

*Ensure that the scale system is clean and ready to receive product. This step establishes the gross zero reference.*

*You must perform a C2 Calibration after setting the Gravity Correction or the correction factor won't work.*

| City         | Grav. Accel | City        | Grav. Accel | City           | Grav. Accel |
|--------------|-------------|-------------|-------------|----------------|-------------|
| Amsterdam    | 0.999369    | Istanbul    | 1.000406    | Paris          | 0.999048    |
| Athens       | 1.000684    | Havana      | 1.001872    | Rio de Janeiro | 1.001884    |
| Auckland NZ  | 1.000782    | Helsinki    | 1.001405    | Rome           | 1.000326    |
| Bangkok      | 1.002392    | Kuwait      | 1.001405    | San Francisco  | 1.000702    |
| Brussels     | 0.999503    | Lisbon      | 1.000615    | Singapore      | 1.00269     |
| Buenos Aires | 1.001004    | London      | 0.999445    | Stockholm      | 0.99877     |
| Calcutta     | 1.00191     | Los Angeles | 1.001028    | Sydney         | 1.00104     |
| Cape Town    | 1.00104     | Madrid      | 1.000461    | Taipei         | 1.001741    |
| Chicago      | 0.99922     | Manila      | 1.000461    | Tokyo          | 1.000886    |
| Copenhagen   | 0.999075    | Mexico City | 1.002102    | Vancouver BC   | 0.999653    |
| Nicosia      | 1.00093     | New York    | 1.000433    | Washington DC  | 1.000601    |
| Jakarta      | 1.002631    | Oslo        | 0.998726    | Wellington NZ  | 0.999399    |
| Frankfurt    | 0.999579    | Ottawa      | 1.000007    | Zurich         | 0.999821    |

From the Home Page, click Configuration to display the Configuration menu; then click Calibration to open the Calibration page.

From the Home Page, click Configuration to display the Configuration menu; then click Calibration to open the Calibration page.

**Configuration**

- [Adjust Setpoint](#)
- [Instrument Setup](#)
- [Calibration](#)
- [Mapping](#)
- [Options](#)
- [Security](#)

Configuration - Calibration

Instrument ID: APP Pharm #5 Batch

Method 1: C2 Calibration

Load Sensor Number:1

Ref Weight

12.0

Gravity Correction

1.000000

Do C2 Calibration

Method 2: Calibration - Zero Cal

Ref Weight

12.0

Do Cal Low

Method 2:Calibration - Span


Span Weight

100.1

Do Cal High

- Step 1. In the “Ref Weight” text field, enter the reference weight for your application.

- Step 2. (optional) If you want to enter the Gravity Correction Factor, see the table above, then enter the Correction Factor number you selected from the table in the Gravity Correction field .



**Method 1: C2 Calibration**

Load Sensor Number: 1

Ref Weight

Gravity Correction

- Step 3. Click the “Do C2 Calibration” button.
- Step 4. Wait a few seconds and the results will appear. If the Calibration was successful a Cal completed OK appears and the Load Sensor Number will read 0.
- Step 5. This message appears if no load points are connected to the 4050. Check the cable and connectors of the load point(s) and re-calibrate.

**Cal completed OK**

[Back](#)

**Cal failed: A to D converter error**

[Back](#)

Step 6. This message appears if no C2 load points are connected to the 4050. Either do a traditional calibration or connect C2 load sensors to the instrument.

**C2 Cal failed: no C2 sensors found**

[Back](#)

Step 7. Click [Back](#) to return to the Calibration page.

### C2 Calibration from the Front Panel

*The example settings are for illustrations only. Your setting requirements will vary.*

Step 1. From the Configuration menu, use the down arrow to select Calibration, and press Enter to display the Calibration menu. Select C2 Cal, and press Enter to display the C2 Calibration Menu with the cursor in front of Num C2.

|  |   |   |
|--|---|---|
| <div>0.00</div> <div>Calibration<br/>&gt; C2 Cal<br/>Trad Cal</div> <div>→</div> <div>EXIT CLR</div> | <div>0.00</div> <div>Configuration<br/>&gt; Calibration<br/>Test</div> <div>→</div> <div>EXIT CLR</div> | <div>0.00</div> <div>C2 Cal<br/>&gt; Num C2<br/>Ref Weight</div> <div>→</div> <div>EXIT CLR</div> <div>0.00<sup>1</sup></div> |
|--|---|---|

Step 2. The read-only Num C2 lists the number of C2 load cells on the system detected by the HI 4050. Verify that the displayed number matches the actual number installed. If not, check to ensure that each load cell/point cable connection is securely fastened and that each load cell/point cable is not broken.

On the HI 4050 web page, select Operations > Diagnostics > C2 and Weight and Voltage to determine which load cell/point is malfunctioning.

Step 3. Press the down arrow to select Ref Weight (Reference Weight) and press Enter to display the Ref Weight edit form.

|   |  |
|---|--|
| <div>0.00</div> <div>C2 Cal<br/>&gt; Ref Weight<br/>Gravity Correction</div> <div>→</div> <div>EXIT CLR</div> <div>0.00<br/>1</div> | <div>0.00</div> <div>Ref Weight</div> <div>10.00</div> <div>EXIT CLR</div> |
|---|--|

Step 4. Use the left or right arrow to position the cursor and the up or down arrow to select the value.

Step 5. When you finish press Enter to save the Reference Weight and return to the C2 Cal menu.

|  |
|--|
| <div>0.00</div> <div>C2 Cal<br/>&gt; Gravity Correction<br/>C2 Ca</div> <div>→</div> <div>EXIT CLR</div> <div>1<br/>Do Cal</div> |
|--|

Step 6. Select Gravity Correction to open the edit page if you want to enter a gravity correction.

Step 7. Use the left or right arrow to position the cursor and the up or down arrow to select the value, and press Enter to save. Our example shows 1.006.

|  |
|--|
| <div>0.00</div> <div>Gravity Correction</div> <div>1.006</div> <div>EXIT CLR</div> |
|--|

Step 8. Use the Down arrow to select C2 Cal, and press Enter to set the C2 Calibration.

Step 9. A “Cal Completed OK” briefly appears on the screen indicating the C2 calibration was successful.



A “Security Violation” message briefly appears if you lack the security level required to do a calibration.

A “Cal Failed” message briefly appears with the error number if the C2 Calibration was not successful. Chapter 8, Troubleshooting lists corrective actions.

## Traditional Calibration

Traditional Calibration is the method of calibration that uses test weights. We recommend that the span total 80 to 100% of the scale live load capacity and the weights be distributed uniformly on/in the scale.

### Load Check

Step 1. Put a load (weight) on the scale or vessel. For a full load test you can put 80% to 100% of the expected weight you will see in your process on the scale or vessel.

Step 2. Check to see if the weight reading changes on the display in the proper direction.

For example, if the display reads 100 pounds and a 20 pound load is placed on the vessel or scale, the display should read 120 or some value over 100.

If the display reads 80 pounds and a 20 pound load is placed on the vessel or scaled, the reading is going in the wrong direction and indicates some problem with the system. (See Chapter 8, Troubleshooting for corrective action)

If the display is reading improperly or shows no change there is something wrong with the configuration wiring or the load cells.

Step 3. If the display changes in the proper direction, remove the weight and proceed to calibrate the Weight Controller.

### Traditional Calibration from the Web page

Step 1. Traditional Calibration requires a zero point and the physical placement of test weights on the scale. To set the Zero Value, if all “live load” weight is removed from the Scale, the Zero Value should be 0.00. If any weight is on the scale when setting this value, the weight must be equal to the amount of load on the scale.

Step 2. Wait 12 seconds or more.

Step 3. Click in the Ref Weight text field and enter the reference weight you want. In our example we entered 0 lbs. If you want the reference weight to be 5.0 lbs., enter 5.0.

Step 4. Click the Do Cal Low button to do the Trad Cal Zero. A “Cal Completed OK” message appears briefly if the calibration was successful. An Error number appears if the calibration was not successful. See the Error list in Chapter 8 for help in correcting the error.

Step 5. To set the Span Weight, place a certified test weight on the scale.

Step 6. In the Span Weight text field, enter the amount of live load weight placed on the scale.

Step 7. Click the Do Cal High button. A “Cal Completed OK” message appears briefly if the calibration was successful.

Step 8. An Error message appears if the calibration was not successful. See the error list in Chapter 8, for help in correcting errors.

Cal failed: not enough ADC counts between high and low  
Back

Step 9. The scale is now calibrated.

### Traditional Calibration from the Front Panel

Step 1. From the Configuration menu, use the down arrow to select Calibration, then press Enter to display the Calibration menu. Select Trad Cal and press Enter to open the Trad Cal menu; then press Enter to open the Reference Weight edit form.

Step 2. Set the reference weight equal to the weight on the scale. Normally, you would remove all weight “live load” from the Scale to obtain a Ref Weight of 0.0. Wait 12 seconds or more for the reading to stabilize.

Step 3. Use the Down arrow to select “Cal Low Do Cal, and press Enter to save. A “Cal Completed OK” message appears briefly if the calibration was successful.

|             |        |
|-------------|--------|
| 0.00        |        |
| Trad Cal    |        |
| > Cal Low   | Do Cal |
| Span Weight |        |
| EXIT        | CLR    |

Step 4. An Error number appears if the calibration was not successful. See Chapter 8, Troubleshooting, for help with errors.

Step 5. Press the down arrow to select Span Weight, and press Enter to open the Span Weight edit page showing the last Span Weight.

Step 6. To set the Span Weight, place a certified test weight on the scale.

Step 7. Use the left or right arrow to position the cursor and the up or down arrow to select the value. If a 10 lb. weight is used, enter 10.00. Press Enter to save.

|                 |        |
|-----------------|--------|
| 0.00            |        |
| Trad Cal        |        |
| > Span Weight → | 10     |
| Cal High        | Do Cal |
| EXIT            | CLR    |

|             |     |
|-------------|-----|
| 0.00        |     |
| Span Weight |     |
|             | 10  |
| EXIT        | CLR |

Step 8. Use the Down Arrow button to select Cal High, then press Enter to do the Cal High. A “Cal Completed OK” message appears briefly if the calibration is successful. An Error number appears if the calibration fails. See the Error list in Chapter 8, Troubleshooting for help with error correction.

|            |        |
|------------|--------|
| 0.00       |        |
| Trad Cal   |        |
| > Cal High | Do Cal |
| Ref Weight | 0.00   |
| EXIT       | CLR    |





# Chapter 6

## Mapping

.....

### About Mapping

Mapping allows you to set up certain monitoring and control activities to meet your process requirements without programming. HI 4050 mapping is more flexible than the typical I/O addressing used in a PLC. Since the HI 4050 does not use predefined I/O addressing, you can tailor custom mappings to meet the unique requirements of your application. Whether the input is digital data to be routed to a display (requiring the DIO card option) or a setpoint signal used to trigger a command to a PLC, mapping is often the easiest way to achieve the desired result.

### Glossary of Mapping Terms

**Assignment Statement** - The assignment statement tells the computer to change the value stored in the memory address named as a variable on the left side of an = sign. (The = sign is called an assignment operator). For example:  $i = a + b$ , means get the values stored in memory locations  $a$  and  $b$ , add them together, then store the sum in location  $i$ .

**Destination** - This is the destination memory address to which data will be moved. left side of the equation. See also Source.

**I/O Interface** - The section of the instrument that communicates with the external input.

**Input Contact** - Inputs interface selector and limit switches, push buttons, and sensors to the HI 4050. An address assigned to each input identifies the location of the input device.

**Input table** - Defined in the section *Input and Output Tables*.

**Local Mapping** - See the section *Local Input*.

**Network Mapping** - This is mapping to and from network communication devices.

**Node Number** - This is the physical address of a device in a network.

**Output table** - Defined in the section *Input and Output Tables*.

**Setpoints** - Setpoints are for optional use in mapping digital I/O or other communication values. A set point value is a threshold weight or level. It may be set in either net or gross weight units. Up to four setpoints are available. Section 4 describes how you assign a set of attributes to a setpoint, but you define the purpose of a setpoint based on how you apply that setpoint within a mapping equation.

**Source** - This is the memory address of the data (right side of the equation) you want to assign to the destination.

**Word** - When mapping the value selected for Network on the Mapping page, you can specify a value for Word. Data passed to a table must be formatted to match the allocated space. Words are groups of bit locations that can be identified by a sequence number. The default word 0 indicates that data sent to that memory location will occupy the allocated space starting from the first available bit. Entering a different value in the Word field allows you to specify a different starting point for storing the data input. This may be done to avoid overriding data that already exists in certain locations. For example, with ControlNet and RIO some tables have assigned word 0 (or both 0 and 1) to other uses, so they should not be used for a new mapping. You may need to track where information is stored. For example, if both weight and Setpoint 1 are assigned to Word zero in the same table, the overlapping input values would override one another. Note too that Int and Float consume two words, so both the word selected and the word to follow must be available for mapping.


## How Mapping Works

Mapping (Addressing I/O) creates assignment statements. The destination is on the left side of the = sign and is a memory address (variable). The Source is the data on the right side of the = sign at a memory address. The = sign assigns the data on the right side of the assignment statement to the memory address on the left side of the assignment statement. Any reference to the right side of the assignment statement refers to the data only and not the address, even though the address is listed.

Memory Address (Variable) = Data (Values, states)

## Input and Output Tables

To transfer values from node to node (e.g. the HI 4050 and PLCs) during an I/O scan, each node has an **Input Table**, where incoming values from other nodes are received, and an **Output Table** that contains the values to be read by other nodes. The HI 4050 inputs can be weight data, current states, etc., and the output can be commands or data to be used or displayed by other nodes. The input and output tables are data arrays where data are stored (i.e. a set of memory locations of tailored sizes based on the type assigned to the variable and having an address). Mapping specifies what to do with HI 4050 input.

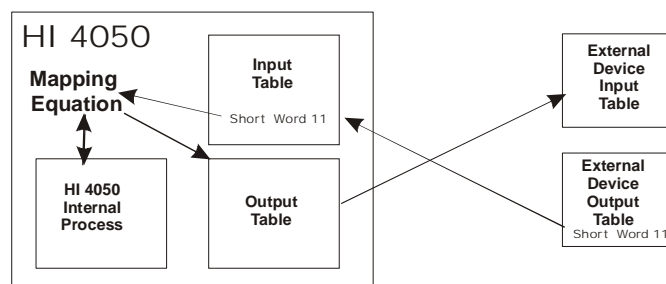

Often, more than two devices are involved, so separate input and output tables having different addresses may be set up for data exchanges with each device.


The HI 4050 scans through the I/O tables 110 times a second and reads any values they contain. If state or other values are stored in the tables, the firmware processes the data and outputs it to an output device or the screen. If nothing is stored to output, no output is sent. When an I/O scan occurs, the state of each input is transferred from the input point to the input table for the receiving device, as shown in the graphic below.

Mapping an input to a destination assigns the value of the input in the input table to an output table address. For example: **Tare = Input #3** means assign the state (Open (0) or Closed (1)) of Contact #3, contained in the Contact Closure input #3 memory address, in the input table and move it to the Tare address in the output table.

- HO - Hardy output table
- DO - DeviceNet output table
- EO - Ethernet/IP output table

- HI - Hardy input table
- DI - DeviceNet input table
- EI - Ethernet input table

This is mapping where the input side of the equation is a digital signal entering the HI 4050 via a connector (other than a network connection feeding into an input table).



The output may be mapped to an HI 4050 internal process or one of its output tables.

Remember: Local Inputs = User Switches.

### Volatile and Non-Volatile Memory

The HI 4050 output tables and input tables use volatile memory. This means, when you power off the HI 4050, you lose the data. The Addressing I/O (Mapping) is saved in non-volatile memory and is not lost when you power off.

## Mapping to an Output

In English we might say: Connect Gross Weight to Ethernet/IP Float Out.


- Ethernet/IP Float Out is the Destination.
- Gross Weight is the Source.

In Assignment Statement form this mapping would look like this:

- Destination = Source or
- Ethernet/IP Float Out (EFO) = Gross Weight (HF10)

From the Web Browser let's go through the process:

Step 1. From the HI 4050 Home Page, click Configuration to view the Configuration menu.

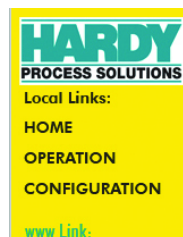


Step 2. Select Mapping to view the Configuration Mapping Setup form. The pull-down menus list both Destination and Source setup options.

A screenshot of the 'Configuration Mapping Setup' form. At the top, it says 'Select One Destination' followed by a 'HELP' link. Below this are four pull-down menus labeled 'Instrument Setup:', 'Network:', 'Control:', and 'Scratchpad:'. Underneath these is a section titled 'Select Sources' in red, followed by another set of four pull-down menus labeled 'Network:', 'Process Data:', 'Control:', and 'Scratchpad:'. Below the source menus are 'Operators: equal', 'and', 'or', 'not', and 'comma' buttons. At the bottom of the form is a large text input field, and to its right are 'Map' and 'Unmap' buttons.


### Example #1 Mapping to a Network Output

Step 1. For our destination, from the Network pull-down list we select an option based on three factors:

- Type of network, e.g., CNET (Control Net), "Ethernet/IP, Modbus, etc.
- Message data type based on the number of bits to be sent or received, e.g., Int, Float, short Int, or Boolean (see Data Types below).
- Whether the value is an input or an output. Note that the listed options for destination show mainly output options.

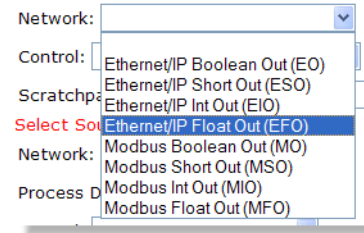


Step 2. A Word box and Select button appears to the right of the Network box. Select the word (location within the register to begin the value) and click Select. Avoid using a word that is already in use for that table.

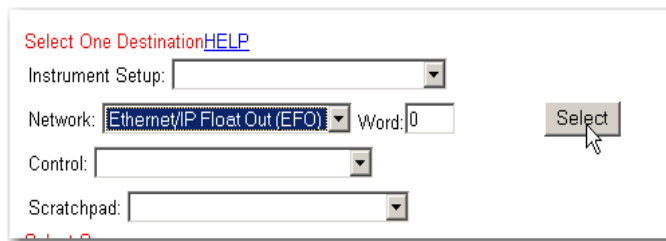


### NOTE

An address such as DFO2 means the following. DFO = *DeviceNet Float Out*. 2 = Word 2.

Step 3. An address appears in the text box below. You must scroll down to see it. Since we selected Ethernet/IP Float Out, the destination address is EFO0 followed by =.

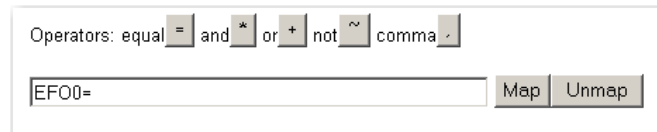

Step 4. As our source, we select Gross Weight from the Process Data pull-down list.

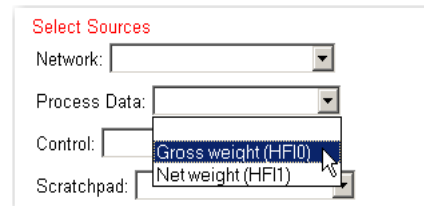

Step 5. A Select button then appears to the right. Click Select to use Gross Weight as the Source.

Step 6. This completes the assignment statement in the Mapping text box: “EFO0=HF10”

Step 7. Click Map to complete the Gross Weight to Ethernet/IP Float Out equation. The Gross Weight that is stored in the input table is now assigned to the Ethernet/IP Float Out output table and to the Ethernet/IP Network. The Map list, shown below, shows the new mapping.

## Data Types

This description should help you choose the correct data type for mapping, e.g., Int, Float, short Int, or Boolean.

All registers being transferred are integer. The mapping selection type specifies only the data format within the selected word location. It does not indicate the type of register being used. All HI-4050 data locations (registers) are configured in 16-bit words.

- When you map a Boolean value, you use only one bit within the specified word, but you must specify the bit within the word that communicates the on/off or yes/no value.
- If you map as a Short Int, you will use one word.
- If you map as an Int or float, you will use two word locations. The selection of Int or Float will specify the format of the data within the two words.

## HI-4050

The setup size of the communications registers in the HI-4050 differ by network type. Packet size determines how much data can be transferred in each send or receive activity.

- **DeviceNet:** setup length in Bytes
- **EIP:** setup length in Bytes
- **RIO:** does not specify, but is in 16 bit Words
- **Modbus:** does not specify, but is in 16 bit Words

- **Profibus:** is 16 bit words

### Receiving Device (PLC, computer, etc.)

Depending on the its capabilities of your receiving device, you may have other choices than those shown. Some communication options are not available with some PLC platforms.

### RS Network for DeviceNet:

Defaults to DINT (32-bit word) in RS Networkx, but can be setup differently.

### Control Logix & Compact Logix PLC setup:

- EIP:** setup length is SINT (8 bits)
- DeviceNet:** DINT (32-bit word)
- RIO:** defaults to INT (16 bit word.)

### SLC & PLC5 setup:

- EIP:** INT (16 bit word.). (This needs special logic programming to communicate. See WebTech question #1387 for more information.)
- DeviceNet:** defaults to INT (16 bit word.)
- RIO:** defaults to INT (16 bit word.)

### Siemens 315 PLC:

Profibus defaults to bytes

### Example #2 Mapping an Input

We next connect a remote switch for use in Tare operations, so we must map User Switch 1 (1 of 3 inputs to the HI 4050) to Tare. The assignment statement is:

- Destination = Source
- Tare (HO2.0) = User Switch 1 (HI0.4)

- Step 1. Select Tare on the Control pull-down menu. A Select button appears.
- Step 2. When you click Select, the Control text box displays the destination address.
- Step 3. From the Control pull-down list in the Source Section, select User Switch 1. A Select button will appear.

Select One Destination [HELP](#)

Instrument Setup:

Network:

Control:

Scratchpad:

Select Sources


Network:

Process Data:

Control:

Scratchpad:

Step 4. Click Select to display the Source address in the Map text field.

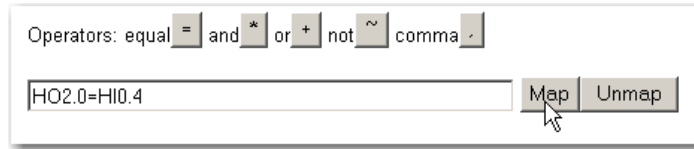

Step 5. The Mapping Assignment Statement is complete. Tare (HO2.0) = User Switch 1.

Step 6. Click Map to map the Input Contact #1 to Tare.



## Advanced Mapping

### Boolean Mapping

In a Boolean equation, the destination (left side of the equation) is a Boolean term. It can have the value 0 (FALSE) or 1 (TRUE). The HI 4050 supports three Boolean operations:

- AND - The symbol for “AND” in a Boolean Assignment Statement is “\*”.
- OR - The symbol for “OR” in a Boolean Assignment Statement is “+”.
- NOT - the symbol for “NOT” in a Boolean Assignment Statement is “~”.

The Boolean tables are arrays of short (2-byte) integers. An individual Boolean variable in the table is located by its word offset and its bit offset. Boolean tables are given 2 letter names as follows:

- DI - is the DeviceNet input table.
- DO - is the DeviceNet output table.
- HI - is the Hardy input table.
- HO - is the Hardy output table.

DeviceNet input tables and output tables are mapped to physical external devices using a DeviceNet configuration software like Rockwell Software’s RS NetWorx.<sup>®</sup>

### NOTE

*RS NetWorx<sup>®</sup> is a registered trademark of the Rockwell Corporation.*

A Boolean variable is addressed with the syntax below:

[tablename][word offset].[bit offset]

Example: DI0.3 is bit #3 in the DeviceNet input table, word #0.



### Example #3 Mapping an Network Input to a Local Output

If you have the Digital I/O card and you want a PLC to send yes/no instructions to an HI 4050, you will have to map the local output to a network input. Here is the process:

Step 1. From the Mapping page, under Destination click on the Control pull-down menu and select Digital Card Output (HO0.0).

Step 2. Click on the Select button to set the Destination. The DIO1(HO0.0)” address appears on the left side of the Assignment Statement.

Step 3. From the Networks pull- down, select a boolean (yes/no) option as the Source for the Assignment Statement.


Step 4. In the Word text box, if the default location is not already in use, accept it.

Step 5. Click on the Select button to assign the source to the right side of the assignment statement. Click the Map button. The new mapping will appears below the Map text field. This sets the digital output #1 to high/low from the input selected.


**NOTE:** HI 4050 network input is the source for the data from PLC output. The PLC can send instructions to the network input(source) on the HI 4050 and in turn to the HI 4050 output (destination).

### Example #4 Mapping a Switch


- Step 1. To Map the control source (Digital Input 1) to a Control Source (Tare), return to the Configuration menu and select Mapping.
- Step 2. From the Control pull-down menu, select Tare (HO2.0).

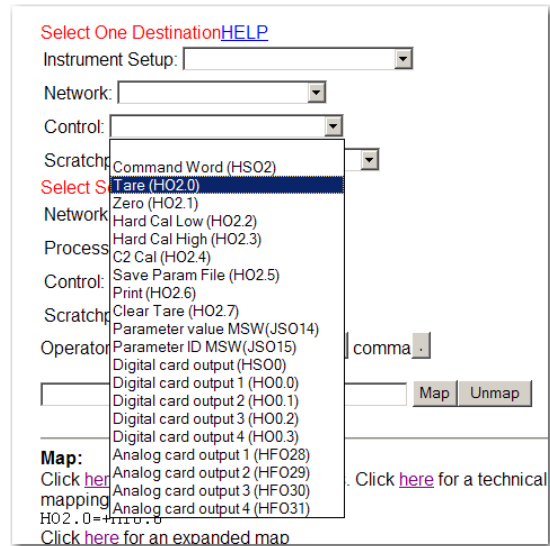

- Step 3. Click Select. Tare (HO2.0) appears in the mapping field.
- You will need to send a transition signal from low to high each time you want to Tare, Zero, or any other function.

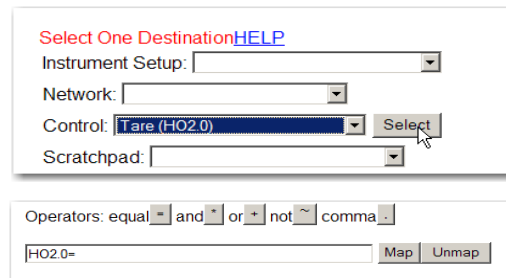

- Step 4. To Map the inputs on the Main Board, select User Switch 1, 2 or 3 as the Source. A Select button will appear next to the Control field.
- Step 5. Click Select to display the full mapping in the Map field.
- Step 6. Click Map.

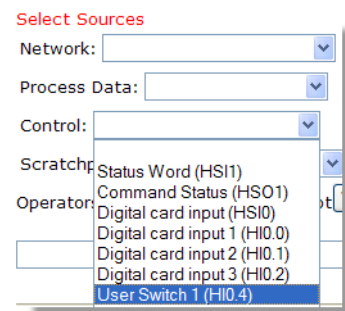

## Analog Mapping

In an analog equation the Destination value is an analog term. The equation can have different values in different formats, e.g. 16-bit integer, 32-bit integer, and 32-bit float. The HI 4050 supports three analog operations. The symbols are the same as the Boolean operations, but with different meaning.

- Multiply. The symbol for "multiply" is '\*'
- Add. The symbol for "Add" is '+'
- Negate. The symbol for "Negate" is '~'

Analog tables are given three-letter names as follows:

DFI, DFO, DSI, DSO, DII, DIO all refer to DeviceNet tables, where the item is a float, a short integer, or a 32-bit integer, depending on the second letter in the table name.

- S - 16-bit signed integer
- F - float
- I - 32-bit signed integer

An analog variable is addressed with the syntax below:

[tablename][offset]

The offset is an offset in words in the case of the network tables. The offsets in Hardy tables have various predefined meanings.

When an analog equation is evaluated, all terms are converted to float. The final result is then converted to the type of the destination.

## Mixed Mapping

In an analog equation, the term on the left side of the = sign is an analog variable. In a Boolean equation, the term on the left side is a Boolean variable. It is permissible to use analog variables in Boolean equations and vice versa. A mixed equation is Boolean if its left side is a Boolean term and Analog if its left side is an analog term.

A Boolean variable in an analog equation is converted to 1.0 or 0.0.

An analog variable in a Boolean equation is TRUE if it is greater than zero and FALSE if it is less than or equal to zero.

## Special (Command) Mapping

A command interface can be used to read or write a parameter value. The table CMD appears only on the left side of a "command" equation. The right side has 1 or 2 terms. The first one defines (in words) where the command data comes from the table and offset, and the second term defines the table and offset where the response to a command is written.

### Setting up the Command Interface Mapping

Use an equation of the form  $CMD0 = (in\_table) * (out\_table)$

In\_table is an input table defining where the command is written.

Out\_table defines where the replay data is written.

Example:  $CMD0 = DSI0 * DSO0$

This equation says the command will be written to the DeviceNet input table at word offset 0 and the replay data is written to the DeviceNet output table at word offset zero.

The upper two bytes of PARAMETER ID (JSO15) and the upper two bytes of the parameter value (JSO14) can also be mapped, which removes the need to do steps 1 and 2 above. Instead, you would write the 0000 and 0001 into JSO15 and JSO1, respectively.

Example:  $JSO15 = DSI2$  and  $JSO14 = DSI3$

By doing this you can set four-byte parameter values using a single command rather than the three commands required above.

**The Command Interface** The HI 4050 may receive commands over any of its network interfaces. A command consists of four-bytes, which it receives through its network input data. The instrument responds with a four-byte response.

To read the value of any parameter, send the four-byte PARAMETER ID. The byte order is LITTLE ENDIAN (i.e., least significant byte first). Verify that the upper two bytes are set correctly. To verify what they should be, either see the parameter list at the end of this section or look on the OPERATION/DIAGNOSTICS/PARAMETERS web page to find the parameter IDs. Use the special parameter ID (0x4001 or 0xC001 with the upper bit set) to set the upper bytes. The value the instrument returns for the parameter will be either integer or float.

When writing the value of a parameter, the PARAMETER ID is four bytes long, and the parameter value is also four bytes long if it is a floating-point number. However, each command is only four bytes long, while most integer valued parameters are only two bytes long. Also the most significant two bytes of a PARAMETER ID is usually zero.

To set the value of a two byte parameter with a four byte PARAMETER ID, send these four bytes:

- byte 0: The least significant byte of the PARAMETER ID
- byte 1: The next byte of the PARAMETER ID but with the highest order bit set.
- bytes 2,3: The value you want to set the parameter to.

For example, to set the value of NumAverages to 3, if the first two-bytes are set to 0, send this hex command <0x8007><0x0003>.

Here the <0x0007> is the lowest 2 bytes of the PARAMETER ID or NumAverages which becomes 0x8007 after you set the most significant bit and <0x0003> is the value you want to set the parameter to.

If the parameter is 4 bytes long, as all floating-point values are, you must first set the upper 2 bytes. A special PARAMETER VALUE (0x4000 or 0xC000 with the upper bit set) does this. Also if the upper two bytes of the PARAMETER ID are not zero, use the special parameter ID (0x4001 or 0xC001 with the upper bit set) to set the upper bytes.

All write commands are 1-shots

The first two bytes of the response to a write command are an echo of the first two bytes of the command. The next two bytes are either the TWO MOST SIGNIFICANT bytes of the parameter or, if the parameter was in fact a command like ZERO or TARE, a status code indicating whether the command succeeded or failed.

If the PARAMETER ID is not valid, the instrument will return four zero bytes.



A parameter writing example: Setting Setpoint 2 Target to 1.0

Setpoint 2 Target has a PARAMETER ID of 0x00010012 (hexadecimal). The number 1.0 in float format is 0x3F800000.

- Step 1. Set the upper two bytes of the parameter value with the command <0xC000><0x3F80>
- Step 2. Set the upper two bytes of the PARAMETER ID with the command <0xC001><0x0001>
- Step 3. Write the Setpoint 2 Target with the command <0x8012><0x0000>

## Performing a Parameter List (Dump)

- Step 1. Select Operation on the Home Page to open the Operation menu.
- Step 2. Select Diagnostics to open the Diagnostics Page.
- Step 3. Click Parameters to display a list of the parameters and their settings.

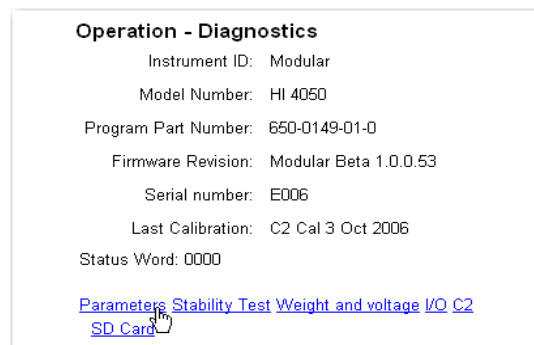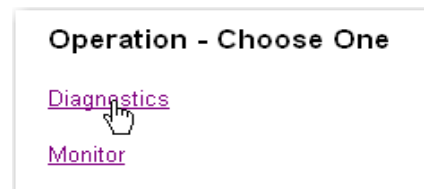

|                                  |   |
|----------------------------------|---|
| 00000001 \$Unit=4[kg]*           | 0001002A Data bits:=1[8]                    |
| 00000002 \$\$Decimal Point=0[0]* | 0002002A Parity:=0[NONE]                    |
| 00000003 \$\$Grads=0[1]*         | 0003002A Printer Mode=2[TARE]               |
| 00000004 Operator ID=Me!         | 000002F2 scratchpad=3.000000                |
| 00000005 Instrument ID=Modular   | 000102F2 scratchpad=1.000000                |
| 00000006 WAVESSAVER@=3[1.00 Hz]  | 000202F2 scratchpad=1.000000                |
| 00000007 Num Averages=15         | 000302F2 scratchpad=3.000000                |
| 00000008 \$Zero Tolerance=5      | 000402F2 scratchpad=3107.000000             |
| 00000009 Low Pass Filter=1[ON]   | 000502F2 scratchpad=3110.000000             |
| 0000000D Motion Tolerance=1      | 000602F2 scratchpad=0.000000                |
| 0000000F Capacity=125            | 000702F2 scratchpad=0.000000                |
| 00000201 Span Weight=1           | 00000036 DNET Baud=2[500k]                  |
| 00000202 Ref Weight=0            | 00010036 DNET Node=3                        |
| 0000004D Certification=0[None]   | 00020036 DNET Bytes In=32                   |
| 00000092 Tare Weight=1           | 00030036 DNET Bytes Out=32                  |
| 00000010 Mode=0[Gross]           | 00020037 EIP key=1288042                    |
| 00000011 Type=0[Loss in Weight]  | 00000037 EIP Bytes In=256                   |
| 00000012 Target=3                | 00010037 EIP Bytes Out=256                  |
| 00000013 Preact=0                | 00000208 Calibration Date=C2 Cal 3 Oct 2006 |
| 00000014 Deadband=0              | 00000203 Cal Low Counts=768413              |
| 00010010 Mode=1[Net]             | 00000204 Cal High Counts=795421             |
| 00010011 Type=0[Loss in Weight]  | 00000205 Cal Span Factor=3.623863085522E-05 |
| 00010012 Target=0                | 00000206 Zero Counts=768413                 |
| 00010013 Preact=0                | 00000209 Cal Zero Counts=768413             |
| 00010014 Deadband=0              | 0000020A ITECH=768291 770281 770549 770941  |
| 00020010 Mode=0[Gross]           | 772737 5 1                                  |
| 00020011 Type=0[Loss in Weight]  | 0000001D zone=3[PST(GMT-8h)]                |
| 00020012 Target=0                | 000002F0 MAP:=HFO27=+HFO0, HFO1=+HSI2,      |
| 00020013 Preact=1                | HFO4=+WSI0, EFO0=+HFI0, HO2.0=+HI0.4,       |
| 00020014 Deadband=1              | DFO2=+HFI1, HO2.1=+DFI2                     |
| 00030010 Mode=0[Gross]           | 00000300 Display Mode=0                     |
| 00030011 Type=0[Loss in Weight]  | 00000301 Display Line=1                     |
| 00030012 Target=0                | 0000002D High Security Code=1               |
| 00030013 Preact=0                | 0001002D Medium Security Code=2             |
| 00030014 Deadband=0              | 0000002E FPSecurity=2[HIGH]                 |
| 0000001A AutoZero=0[OFF]         | 0000002F Calibration Security=0[NONE]       |
| 0000000E AutoZero Tolerance=0    | 00000030 Web Page Security=1[M]             |
| 0000002A Baud Rate:=4[9600]      |   |

# Chapter 7

## Operation

.....


Chapter 7 contains step-by-step instructions for operating the Hardy Process Solutions HI 4050 Weight Controller. The procedures include complete instructions for operating the Weight Controller from the front panel and from the Web page. Operating procedures primarily include Taring and/or zeroing the instrument and creating setpoints. We highly recommend reading the procedures before operating the Weight Controller. Being familiar with the operating procedures insures that the Controller will provide trouble free service.

### Getting Started

Before operating the Hardy HI 4050 Weight Controller, check to make sure the following procedures have been performed:

- Power and Load Point cables properly installed.
- Communication cables properly installed.
- Calibration Performed.

### The 4050 Front Panel

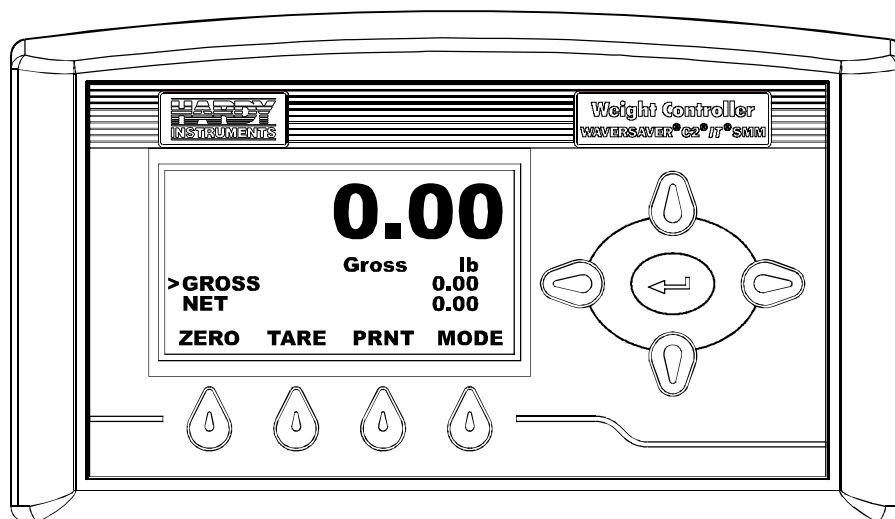

## Overview

The Front Panel Display is a five-line Graphic LCD. The Summary screen displays the current weight in the selected mode (Gross, Net or available Rate of Change) and the selected engineering units (lb, oz, lb/oz, kg, g, Ton, t (Metric Ton)). The screen displays the menus for Configuration, Calibration, Test and Operation.


## Button Functions

Four buttons below the screen activate the functions named on the screen above each button. These functions vary depending on the screen selected.

For example to Zero the instrument, press the button directly below the ZERO function.

### Up/Down - Left/Right Buttons

The Up or Down arrow s move the cursor vertically allowing the user to scroll through a list or menu. Use them to move from one sub-menu to another or to increase / decrease displayed values. The Left / Right arrow buttons move the cursor horizontally left or right.

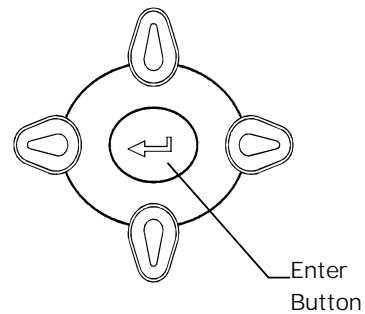

### Enter Button


Press Enter to display the Menus and Sub-Menus or to enter the configured values or selected items form a pick list into non-volatile memory.

### Exit Button

Exit returns to the previous menu. The Exit button only appears when you enter a menu, it does not appear on the Summary Display.

### Clear Button

Clear (CLR) clears the total Alphanumeric Entry and repositions the cursor for the first entry. It is a good idea to clear an existing parameter value before entering a new value to avoid making mistakes. CLR only appears when you enter a menu. It does not appear on summary or operation displays.

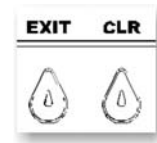

### Zero Button

Use the Zero button in Gross mode to zero the selected scale to within the tolerance level. Use of this function should not exceed the value entered for zero tolerance.

### Tare Button

Tares the selected scale. The Tare button sets the Net Weight equal to 0. In Net Mode (i.e. a channel displays Net in the Summary display) the weight changes to 0.00. In Gross mode the Gross Weight does not change; however, the Net weight is changed to 0.00.



### Print Button


The Print button prints the Gross, Net and Tare weights to an attached printer. If the Rate of Change option is activated, the print button prints the ROC as well. If the Scoreboard is activated, the Print button does not function.

### Entering Alphanumeric Values

To enter a number, letter, or punctuation mark, use the Up or Down arrows. Move the cursor to where you want to enter the value. Press the Up or Down arrows until the letter or number you want appears. Press the Right or Left buttons to move the cursor to the next position. The two punctuation marks are the period (.) and the minus (-) sign.

## Starting Up for the First Time

When the HI 4050 Weight Controller first powers, a Summary display shows the weight in Gross or Net mode. To change from Gross, Net or ROC (Rate of Change) mode, use the Mode button.

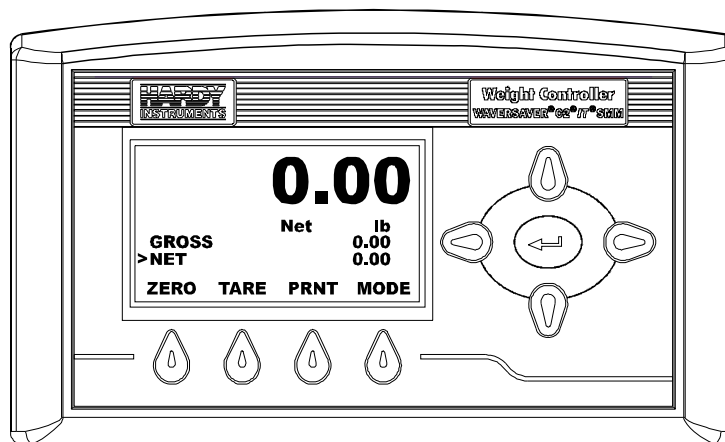

**WARNING** After configuring your system and turning the instrument off, make sure that the SMM-SD is installed correctly before powering up. If the SMM-SD is not installed, the instrument returns to a default condition which probably does not meet your process requirements and could result in product/property damage or personal injury.

**AVERTISSEMENT – Après avoir configuré votre système et mis l'appareil sous hors-tension, assurez-vous que le SMM-SD est installé correctement avant de le remettre sous tension. Si le SMM-SD n'est pas installé, l'appareil retournera dans les conditions à défaut, ce qui probablement ne correspondra pas à vos exigences de fonctionnement et pourra endommager le produit ou provoquer des blessures personnelles.**

- Step 1. To Tare the Scale, press the Tare button. If the Tare is successful, you will get a message: "Tare OK." If the Tare is unsuccessful, you will get a message "Tare Failed." Check the Motion Tolerance parameter. Chapter 4 provides configuration instructions for the Motion Tolerance Parameter.
- Step 2. To Zero the Scale, press the Zero button. If the Zero is successful you will get a message: "Zero OK." If the Zero is unsuccessful, you will get a "Zero Failed" message. Check the Zero and AutoZero Tolerances parameters. Instructions for Zero Tolerance and AutoZero Tolerance Parameter Setup is in Chapter 4.
- Step 3. To Print Gross, Net, Tare, or All, depending what you configured when setting the Print parameters, press the Print button.

## Set Points Configuration

### About Set Points


Operators may need to reset a setpoint target weight. For example, if a packaging operation switches from 10 pound bags to five pound bags, you would change a setpoint target weight from ten to five. Target weight is one of several values on the setpoint web page, but in most cases, operators will not be asked to change the other values.

#### Target

This is the target weight for your application. You may be asked to reset this value if a production activity changes.

## Entering Set Points from the Web Page


Click Configuration on the Home Page to open the Configuration menu, and select Adjust Setpoint to open the Adjust Setpoint page.

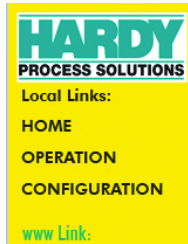


**Step 1.** If your system uses more than one setpoint (up to four may be used), you will need to know which one you should change. To select the Setpoint to configure, use the pull-down list below Help. In our example we selected Setpoint 1, which appears in the text field.



**Step 2.** Select the Mode from the pull-down list. In our example we selected Gross.

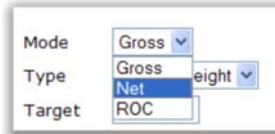


**Step 3.** From the Type pull down list, select the Type of control you want for your application. In our example we selected "Loss in Weight."



**Step 4.** Enter the Target weight for your application in the Target field. Our example shows 180.0 lbs.




**Step 5.** In the Preact text field, enter the Preact value for your application. Our example uses 5.00 lbs.



**Step 6.** In the Deadband field, enter the value for your application. Set points deactivate at the set point plus the deadband. Set the deadband larger than the preact to prevent rapidly fluctuating setpoint states. In our example we entered 8.00 lbs.



**Step 7.** Click Save Parameters to save the Setpoint parameters.

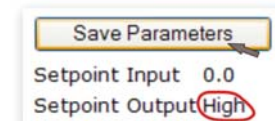


Note the Setpoint Input number displayed below the Save Parameters button. This is read only and indicates the Setpoint you currently configuring. The high or low is relative to the Target weight. If the target weight is lower than the Set Point, Output reads HIGH, and vice versa.

## Entering Set Points from the Front Panel


All four set points are configured the same way. The procedures is.

- Step 1. To select the setpoint to configure, starting from the default Summary Display, press Enter to open the Configuration Menu, and use the down arrow to select Setpoints. (Note: *The arrow on the right of Setpoints indicates that it is also a menu.*) With Setpoints selected, press Enter to open the Setpoint menu, then use the left or right arrow to select the Setpoint. Our example shows Setpoint 2.

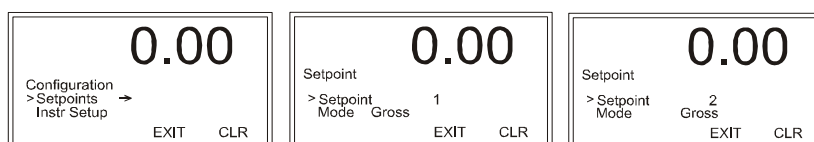


- Step 2. Mode; then use the Right or Left arrow to toggle between Gross, Net or available Rate of Change modes. Our example shows Gross.


- Step 3. Use the Down arrow to select Target; then press Enter to display the Target edit form.

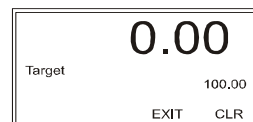

- Step 4. Use CLR to clear the existing value and position the cursor for entering the first digit. Use the Up or Down arrows to scroll the number or decimal point.

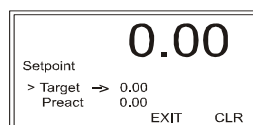

- Step 5. Use the Left arrow to move to the next digit and the Up or Down arrows to scroll the number or decimal point. The weight is in the units you selected for “Units” when you configure the instrument. Our example shows 100.00 for target weight.

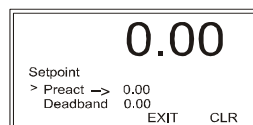

- Step 6. Press Enter to save the target weight.

- Step 7. “Entry Accepted” appears briefly and the Setpoint Menu returns.

## Chapter 8

# Troubleshooting

.....

Chapter 8 provides procedures for troubleshooting the electrical, mechanical and firmware elements of the HI 4050 and for using Hardy's Integrated Technician (IT<sup>®</sup>) software utility to isolate problems. Flow charts provide troubleshooting steps for the weight controller, load cells, and cabling. Chapter Eight also provides

### Disassembly and Reassembly Notes, Warnings and Cautions

**WARNING - EXPLOSION HAZARD - DO NOT REPLACE COMPONENTS UNLESS POWER HAS BEEN SWITCHED OFF OR AREA IS KNOWN TO BE NON-HAZARDOUS.**

**AVERTISSEMENT – Risque d'explosion- Ne pas remplacer les composants à moins que la source d'alimentation soit éteinte ou que la zone est classifiée non dangereuse.**

**WARNING - EXPLOSION HAZARD - DO NOT DISCONNECT EQUIPMENT UNLESS POWER HAS BEEN SWITCHED OFF OR THE AREA IS KNOWN TO BE NON-HAZARDOUS**

**AVERTISSEMENT – Risque d'explosion – Ne pas déconnecter l'équipement à moins que la source d'alimentation ait été mise en position « éteint » ou que la zone soit classifiée non dangereuse.**

Always disconnect the power cord before disassembling.

- Ensure that any disassembly is done in a clean, well ventilated, properly controlled static environment.
- Ensure that the assemblies and sub-assemblies are well supported and insulated when doing any repairs on the HI 4050 Weight Controller.
- Place small fasteners, connectors and electrical parts in closed containers so as not to lose parts during reassembly.
- Read the disassembly instructions before any disassembly begins. If any of the instructions for disassembly are unclear, contact Hardy Instruments, Technical Support Department for additional information and assistance.

- Do not disconnect any electrical plug, connector or terminal unless an identification tag is present or one is attached. Always note where the connector or plug was attached to the electrical component or wiring harness.
- Always install complete hardware groups (Screws, Washers, Lock Washers, Spacers, Etc.) back to the original point of removal.
- Always replace broken or damaged modules or hardware immediately!
- Always check to be sure that no loose parts are sitting on printed circuit boards or electrical connectors or wires when disassembling or reassembling.
- Always protect printed circuit boards from electrostatic discharge (ESD). Always use approved ESD wrist straps and anti-static pads.
- Always perform a final inspection after completing any reassembly to be sure that all fasteners are tight, all connectors are secure and there are no loose parts on any of the printed circuit boards in the Weight Controller.
- Always follow proper safety procedures when working on or around the Weight Controller.

This chapter describes several tests that can shorten the time for troubleshooting. Most problems require the use of two or more tests to determine the cause.

If a problem is isolated to a load cell, it may not mean the load cell is the damaged component. Mechanical imbalances and system piping stress (lack of piping vibration isolators, cables draped over pipes etc.) can make a load cell seem to be the problem.

If you are in doubt as to how to resolve a problem or if you need assistance, look for Hardy Process Solutions Web-tech at <http://www.hardysolutions.com>. Web-tech is updated often and is available 365 days a year 24/7. It contains several frequently asked questions to aid you in troubleshooting, and it provides a form for requesting additional information and answers to questions, with no waiting on hold.

Customer Service is available from 6:30AM to 5:30 PM Pacific Standard Time. For direct factory support call Hardy Instruments Customer Service at:


- 1** Factory Technical Support in the US and Canada: 1-800-821-5831, Ext.9550.
- 2** Technical Support outside the US and Canada: 1-858-278-2900 Ext.9550.

## Error Messages

- A/D Failure Error! - Internal Electronics Error, Retry.
- A/D Convert Error! - Load Cells input out of range.
- Motion Error! - Check Motion Tolerance Settings and Retry
- Trad Cal Error! - Error occurred during calibration, re-calibrate.
- C2 Cal Error! - Error occurred during calibration, re-calibrate.
- Too Lo Error! - Verify that the load cell signal level is 0-15 mV. Verify that there is enough weight on the scale. Perform Span than go back and Zero.
- Too Hi Error! - Verify that the load cell signal level is 0-15mV. Verify that there is enough weight on the scale. Perform Span than go back and Zero.
- No C2 Sensor! - Instrument did not detect a C2 Load Sensor


- CAL Failed! - Too few counts between Zero and Span.
- C2 Caps Unequal! - Different load cell capacities (For example 50 lbs capacity load cell and 100 lbs capacity load cell on one system. Make the load cells even by removing the uneven load cell and replacing it with a load cell that is equal to the others capacity.
- HI/LO Too Close! - Zero and Span are not more than 1,000 counts from each other or there is no change or negative change. Reset either so the counts are more than 1,000 counts of each other.
- Function Error! - Pressed a function button and the Function did not work. Try again. Cycle power.
- Not Allowed! - Value entered is outside the range allowed. Try another value.
- Security Violation! - User signed in with a password that does not allow performance of a certain function or entry to certain menus. Security level of the user identified in the User ID, too low for the menu or function.
- Over-range - Weight over the setpoint target.
- Need Cal with ITJBOX - IT summing card is not installed. Install an IT summing card then do a Calibration with the card installed to access the IT information.

## Trouble Shooting Using Integrated Technician (IT<sup>®</sup>)

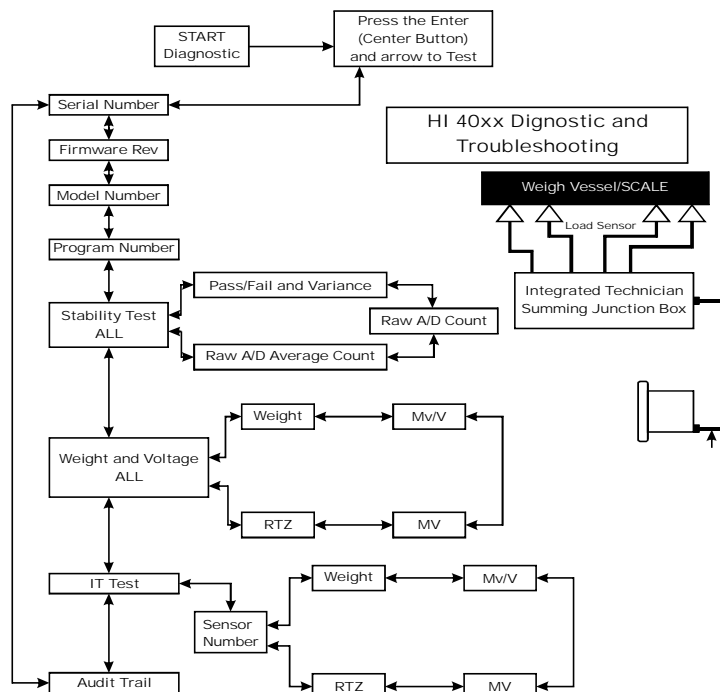

A more detailed explanation of each section of the test follows below:

## Stability Test ALL

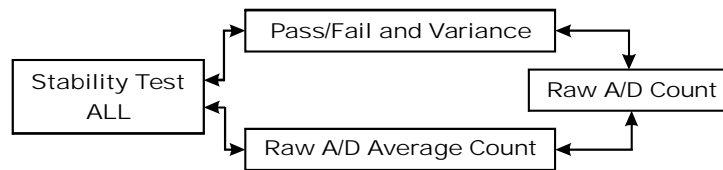

See Stability Test under the System and Load Cell Tests >Integrated Technician section of Chapter 8 for details.

## PASS/FAIL and Variance Test

This test computes the variation of the A/D counts. The results show the variance and indicate pass or fail. The test is valid to help break down the problem into smaller divisions. Unstable test results can be caused by an internal A/D processor fault, grounding, power connection, EMI/RFI above specified CE limits, or noisy load cell input.

### Raw A/D Count

These numbers reflect a weight change at the smallest measurement, the internal analog-to-digital converter computer register.


### Raw A/D Average Counts

These numbers also reflect weight change at the smallest measurement, the internal analog-to-digital converter computer register - except that this reading is averaged using the AVERAGES setting parameter from the controller's configuration. Using the maximum number of internal averages and the 10ms update equals a maximum delay of 2.55 seconds

## Weight and Voltage ALL

This test section looks at the readings from ALL the load cells to test overall system performance and signal voltage readings. This test works for all varieties of load cell connection systems.

Further investigation to isolate system problems requires the use of hand tools and multi-meters or the Integrated Technician Summing Junction Box and using the IT<sup>®</sup> Test section.

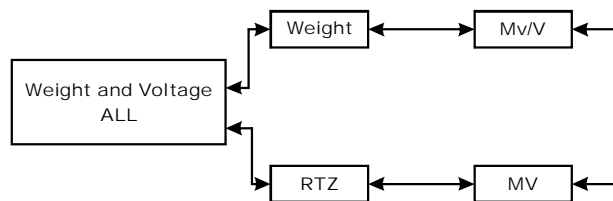

### NOTE

IT<sup>®</sup> is a registered trademark of Hardy Process Solutions.



**Weight** This displays the amount of force seen by all load cells installed in the summing junction box. Further investigation to isolate system problems will require the use of hand tools and Multi-meters or the Integrated Summing Junction box and using the IT test section.


**mV/V** are DC voltage signals between 0-30 mv/v

**mV** DC voltage signals are between 0-15 millivolts. Overloads and negative millivolt readings are not shown as actual readings but 15.3 for over voltage and 0.0 for negative voltage. You will need to use a multimeter with a 200 or 300mVDC range to view the out of range voltages. Millivolt/Volt equals the output from a load cell per each volt of excitation. The HI 4050 reads the load cell output in mV/V which is a higher resolution (4 decimal places) reading than a mV reading, thereby providing more sensitivity to enable you to troubleshoot the condition of the load cell in question under certain conditions. Load Cells are rated in Millivolts/Volts.

### RTZ (Return to Zero) Test

This check is to see if the scale returns to a zero reading condition when it is empty. Run this test only when the scale is empty. When the scale is calibrated at the **ZERO** or Reference zero, there is a **WAIT** period during which the **WEIGHT** readings are collected. After a valid calibration has been completed, the test compares the original weight reading with collected and current readings. If the difference is more than the combined Motion and the Zero Tolerance parameters the test will fail.

### IT Test

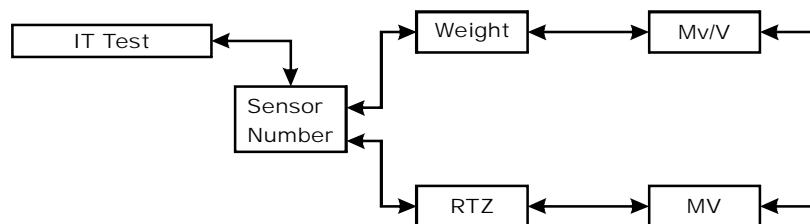

If your system has an Integrated Technician Summing Junction box, the IT test can help identify individual load cell problems up to a maximum of four load cell selections.

**Sensor Number** Indicates which sensor is under test. Using the up or down arrow selects the target sensor to be tested.

#### NOTE


*Warning: Do not install your HI 215IT summing board in areas susceptible to high vibrations. The relays on the board can chatter and affect your weight readings.*

#### Audit Trail


A list of parameters and successful calibration events is logged into the audit trail section. Event listings are formatted with a time and date stamp. Log entries cannot be erased and are stored in the Secure Memory Module.

## Audit Trail


## General Troubleshooting Flow Chart Index

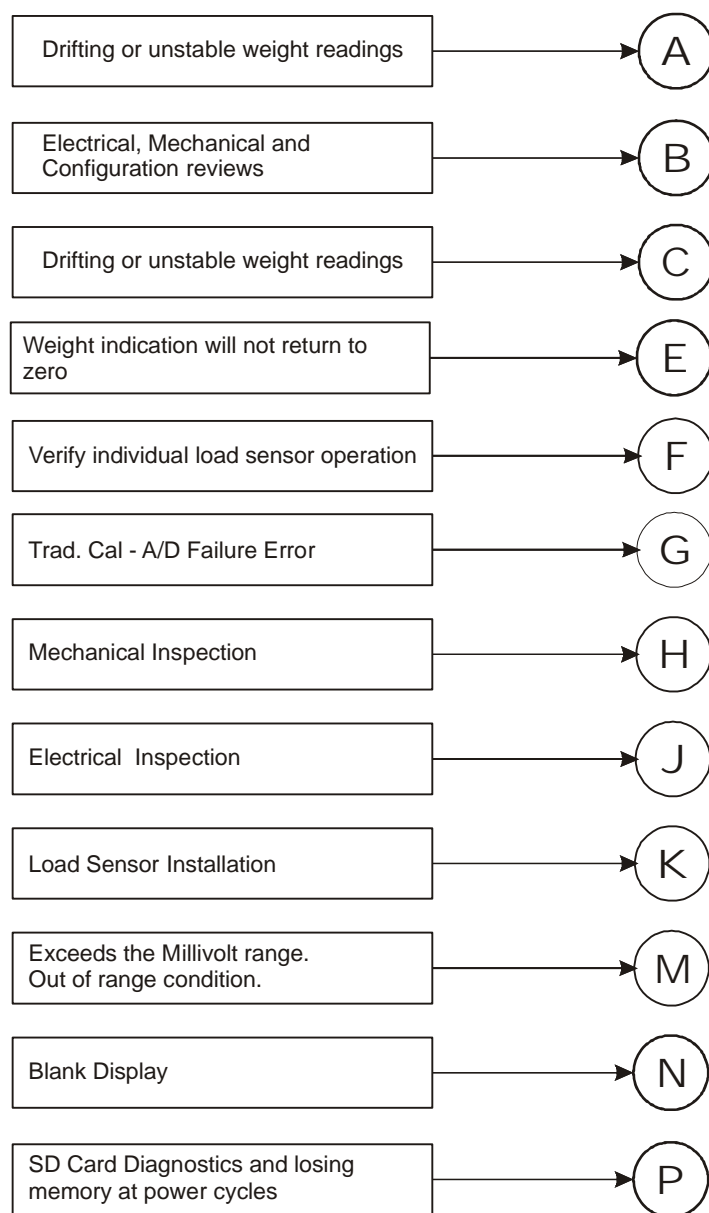


## A - Guidelines for Instabilities on Formerly Operating Systems

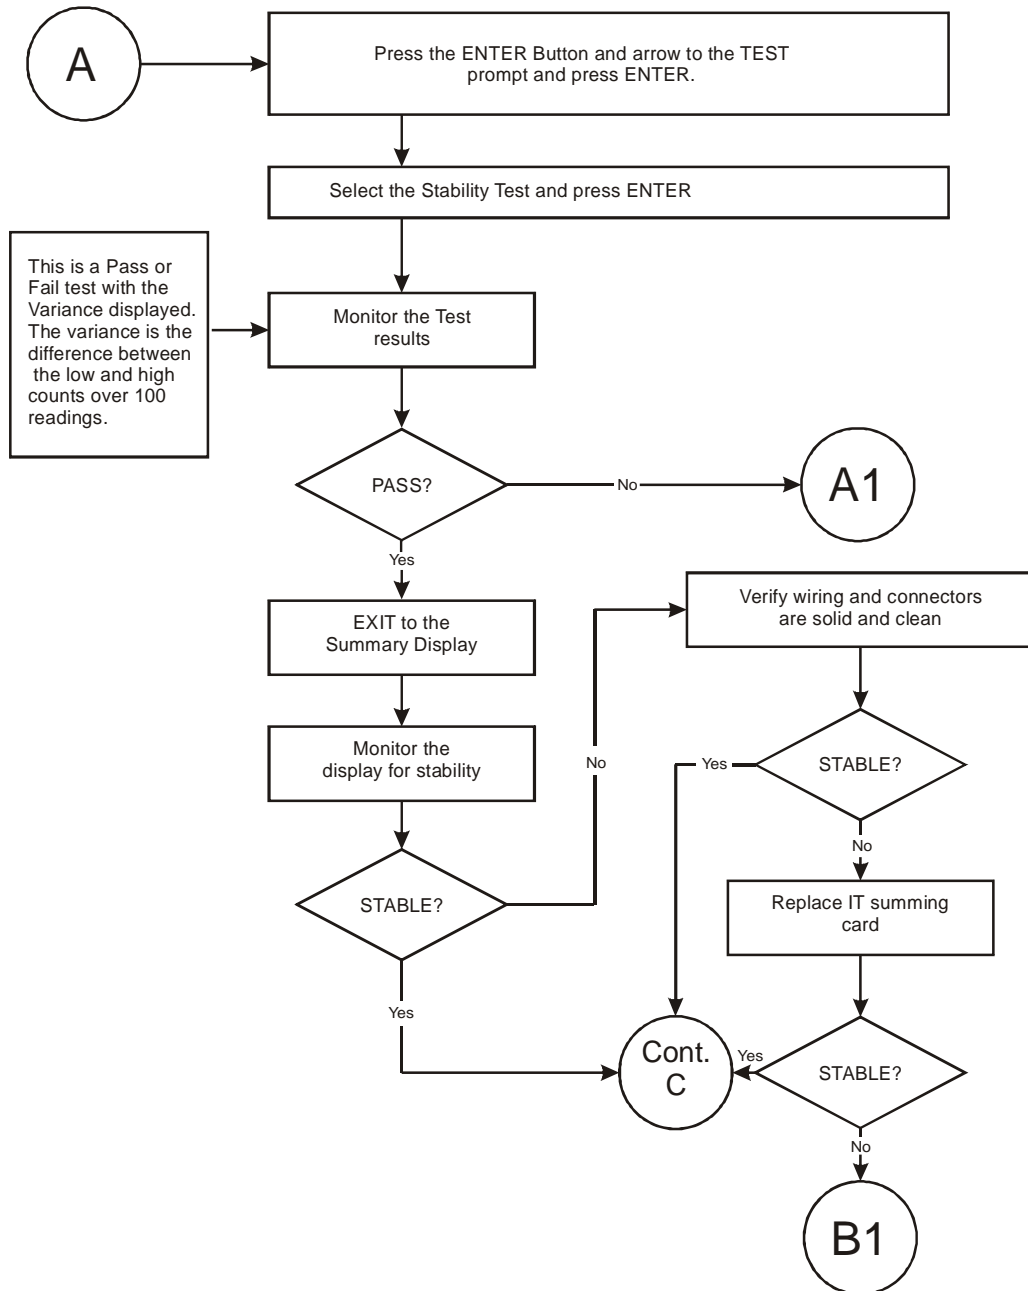


## A1 - Guidelines for Instabilities on Formerly Operating System (Cont'd)

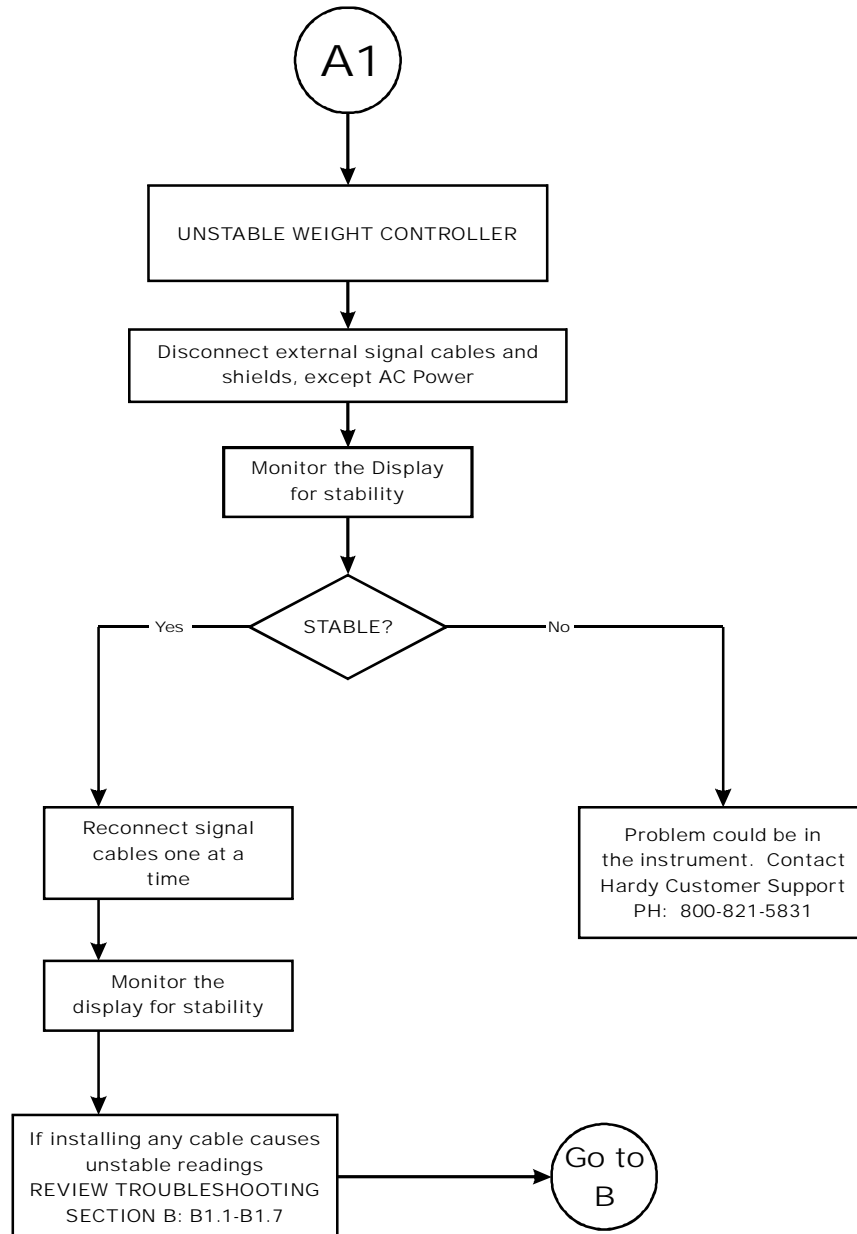


## B - Guidelines for Instabilities on Formerly Operating Systems (Cont'd)

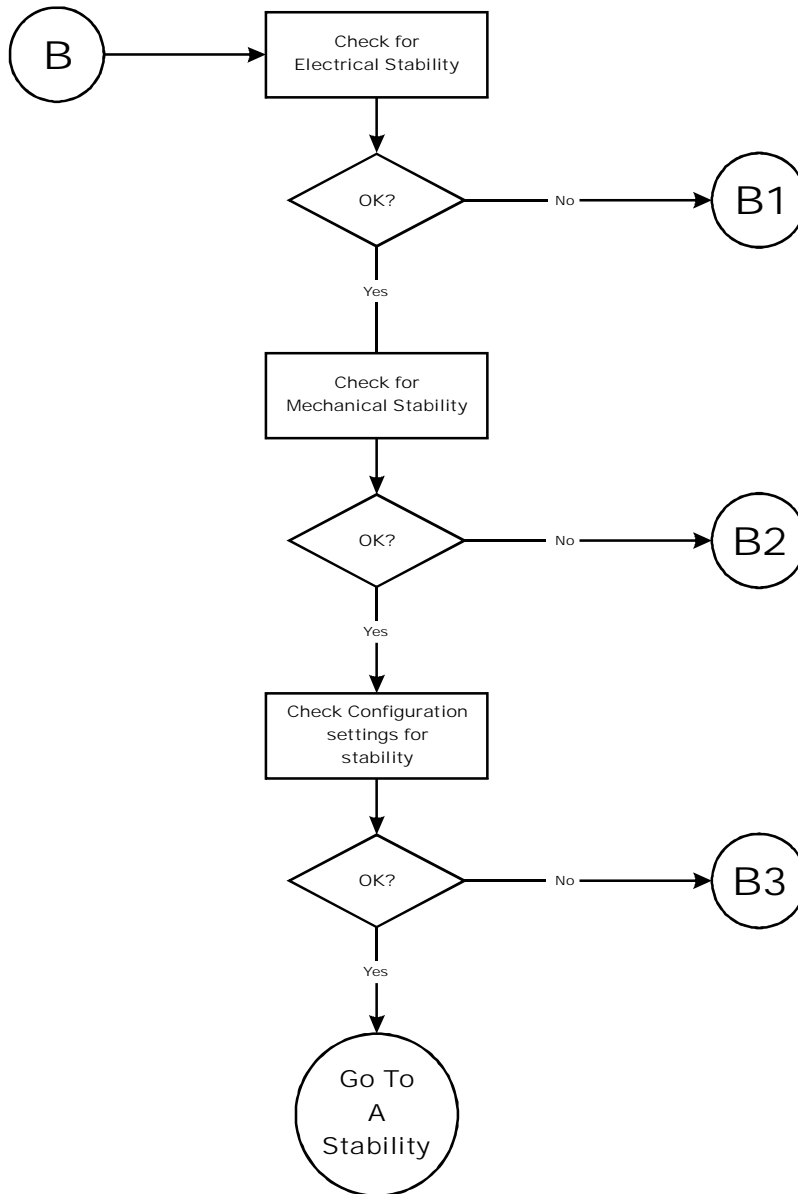

## B1 - Guidelines for Instabilities on Formerly Operating Systems (Cont'd)

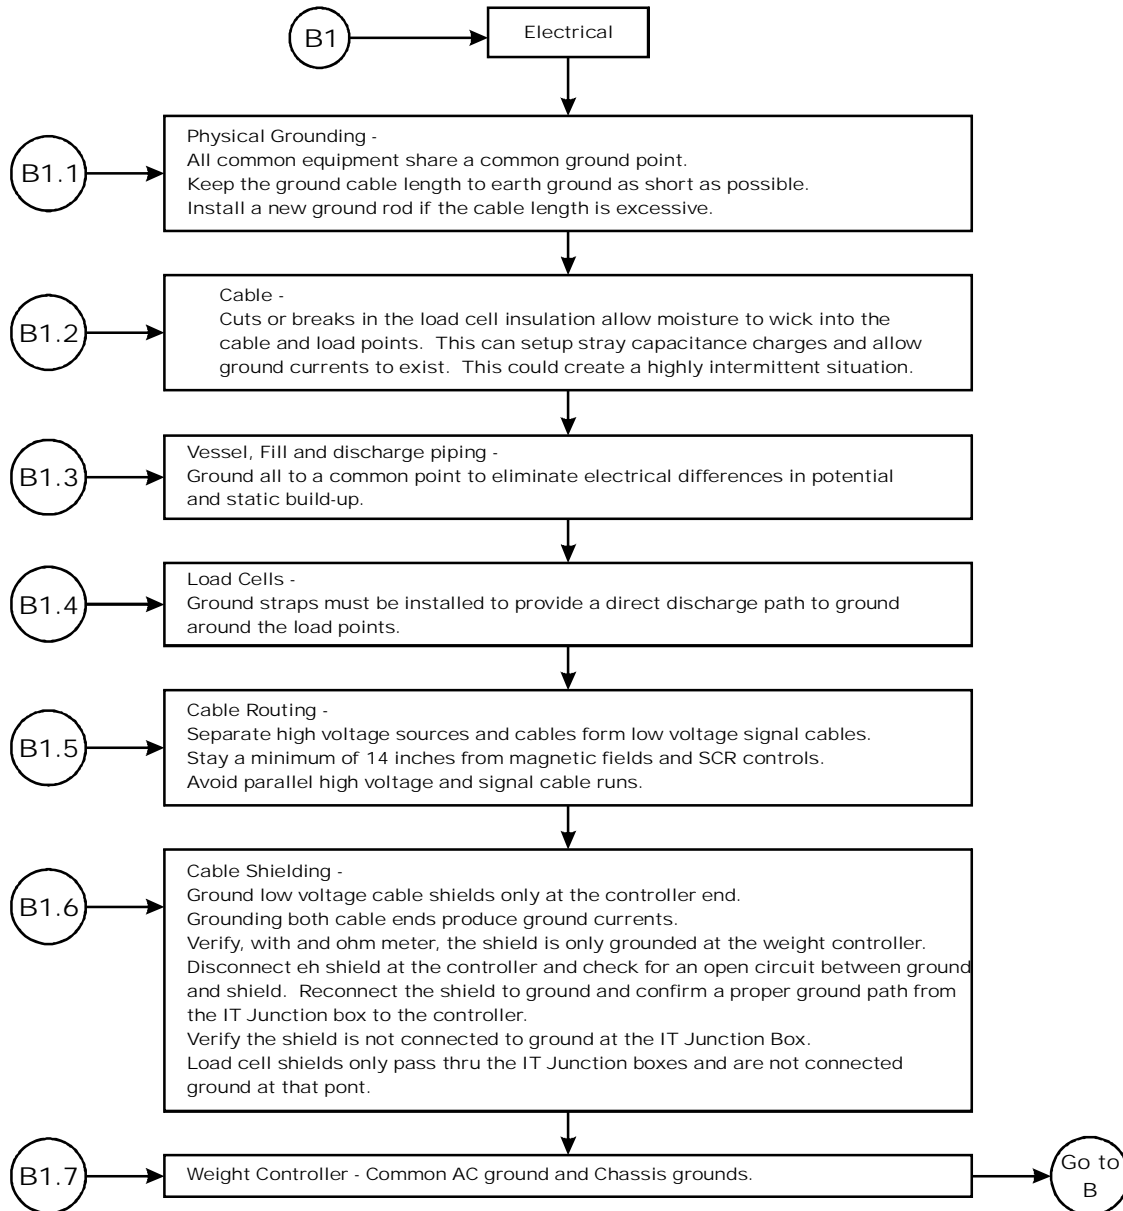


## B1 - Guidelines for Instabilities on Formerly Operating Systems (Cont'd)

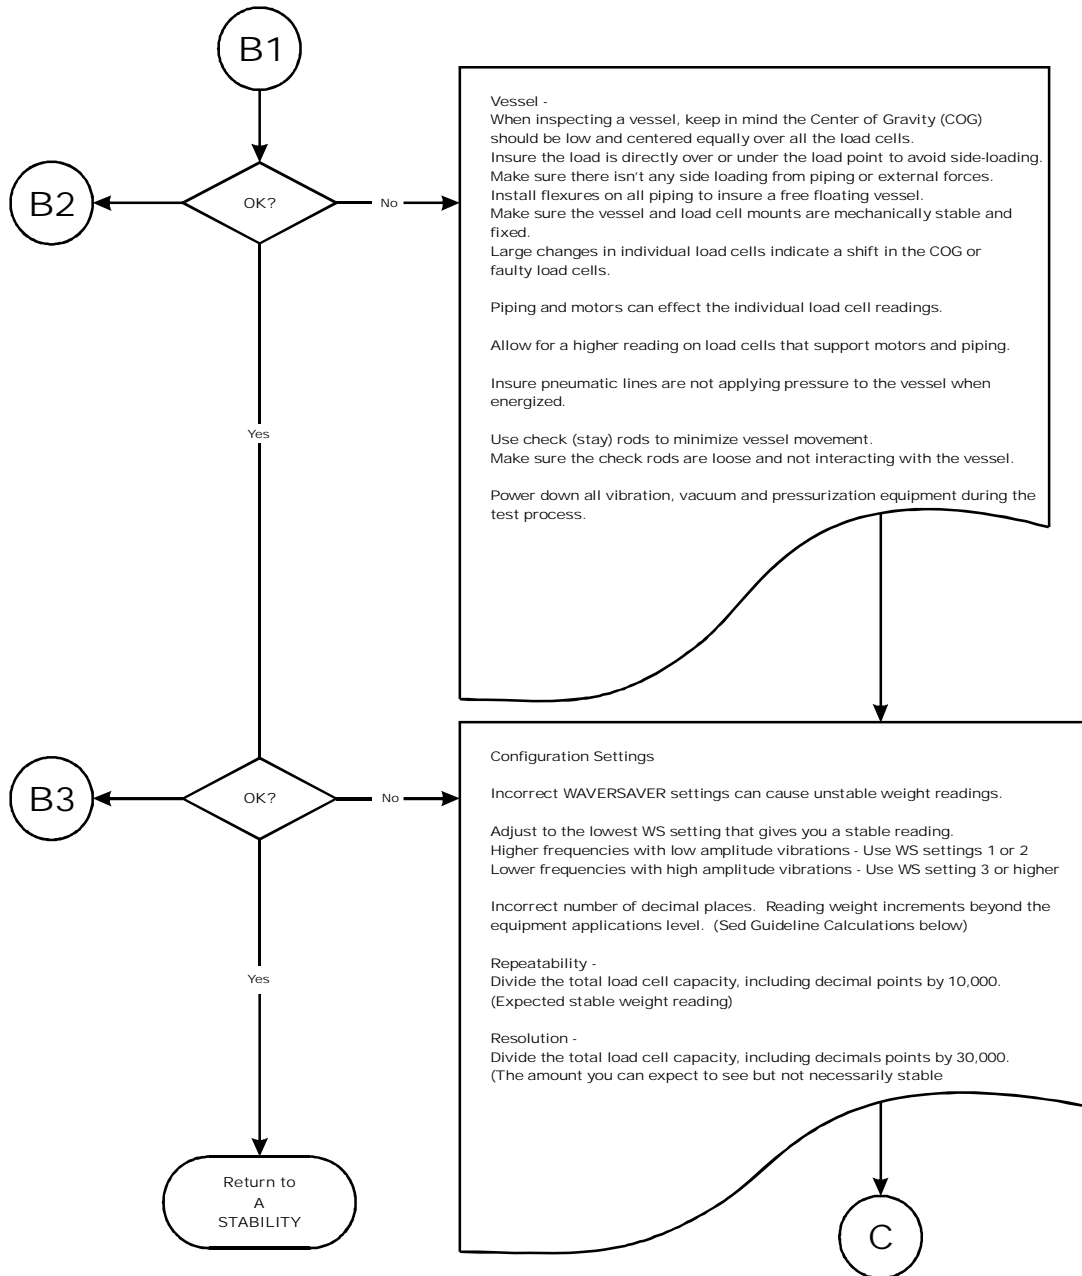




## C - Guidelines for Instabilities on Formerly Operating Systems

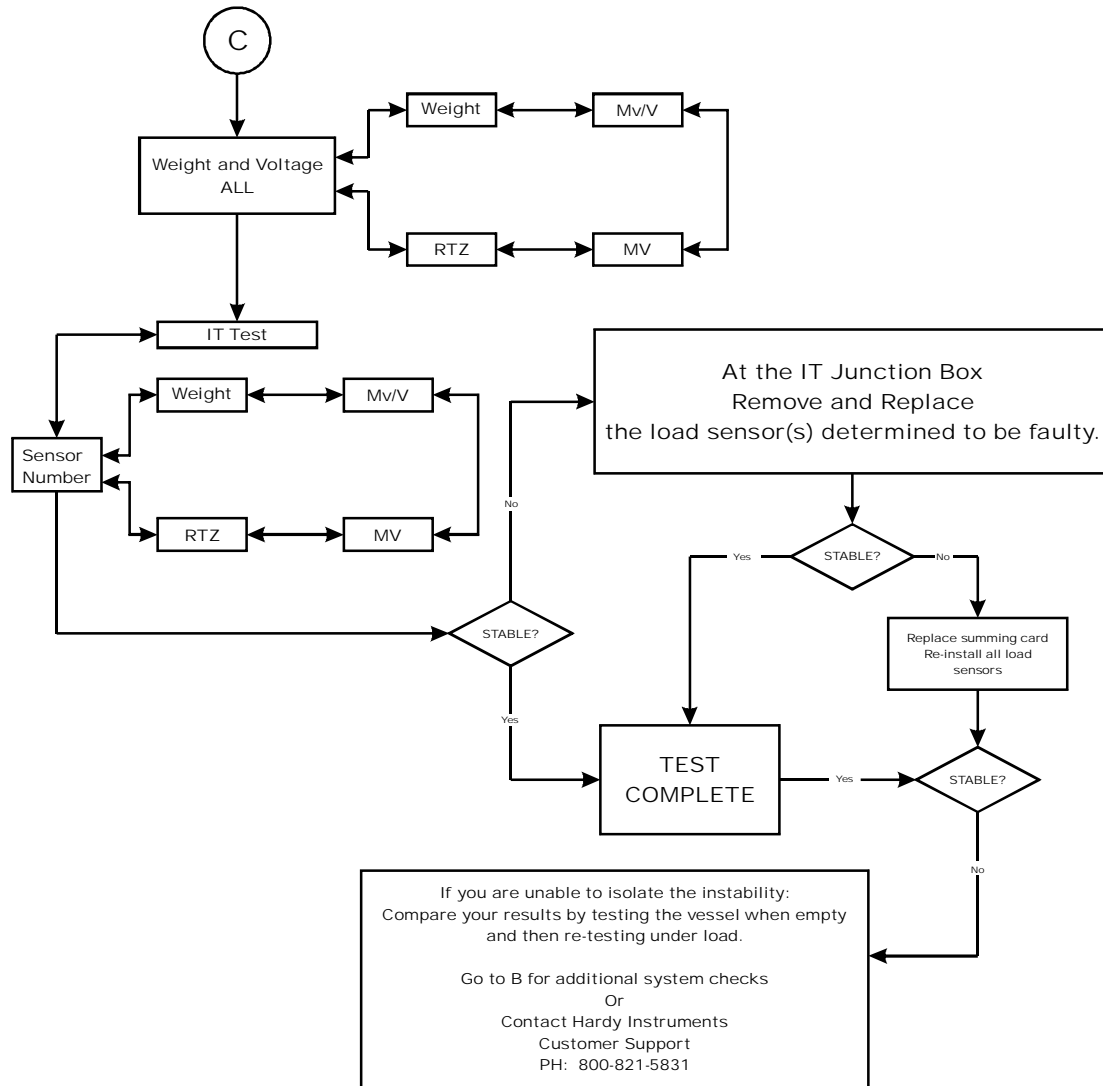


## E - Non-Return to Zero (Must be connected to an IT<sup>®</sup> Summing Box)

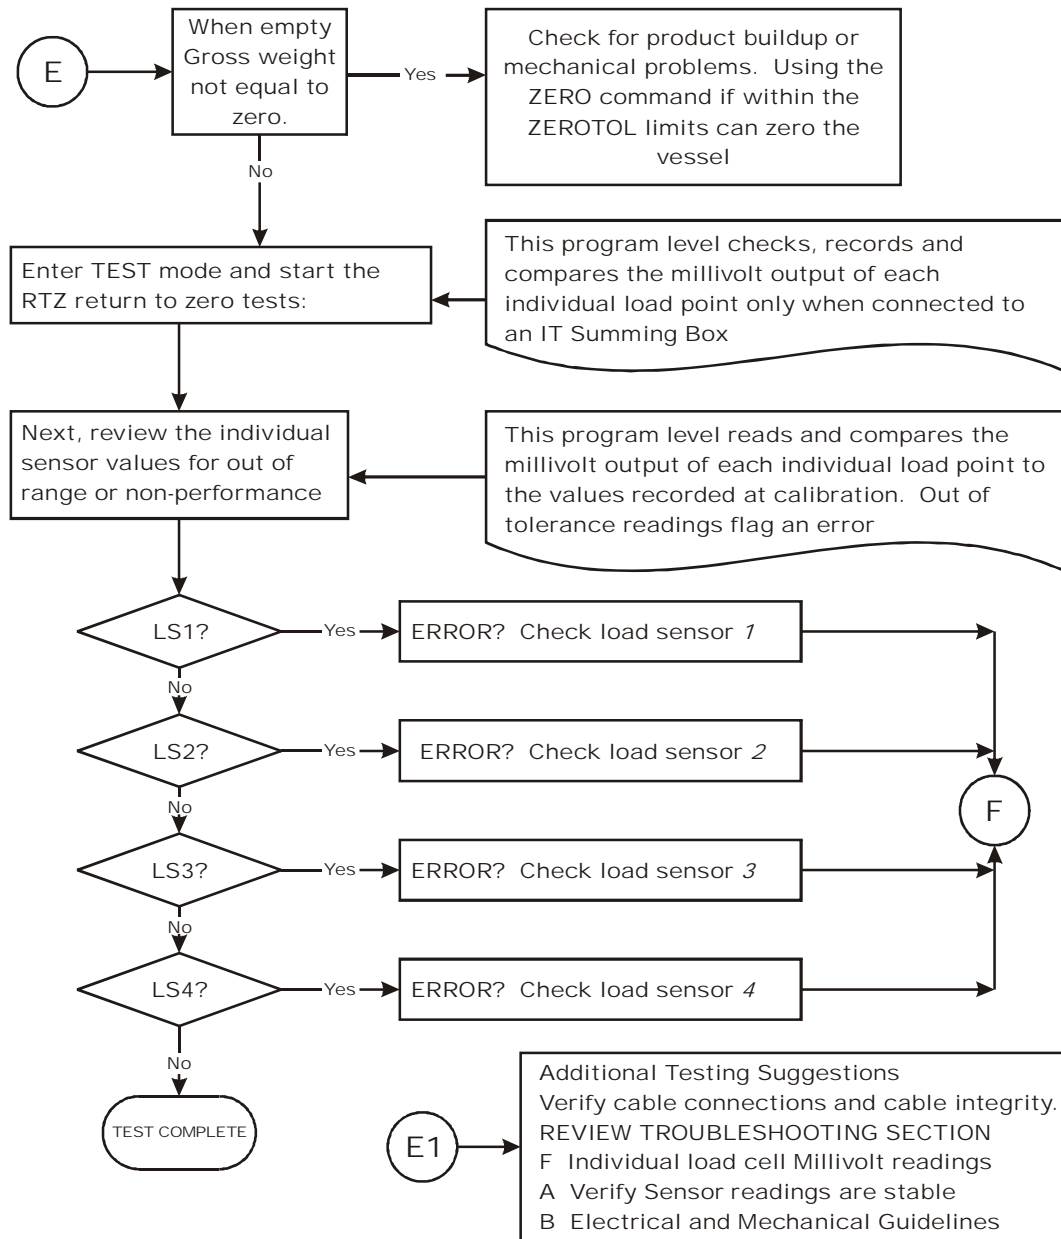

## F - Verify Individual Load Cell Millivolt Readings


- Testing an individual load cell signal output requires an IT Summing Junction box or millivolt meter.
- Use the load cell certificate to verify the millivolt per volt (mV/V) rating:

**Example:** 3mV/V load cells produce approximately 15mV at full load. That is 5 volts excitation x 3 mV/V. A scale capacity of 1,000 lbs. with 100 lbs. of deadload when empty, the load point mV reading should measure 1.5mV.

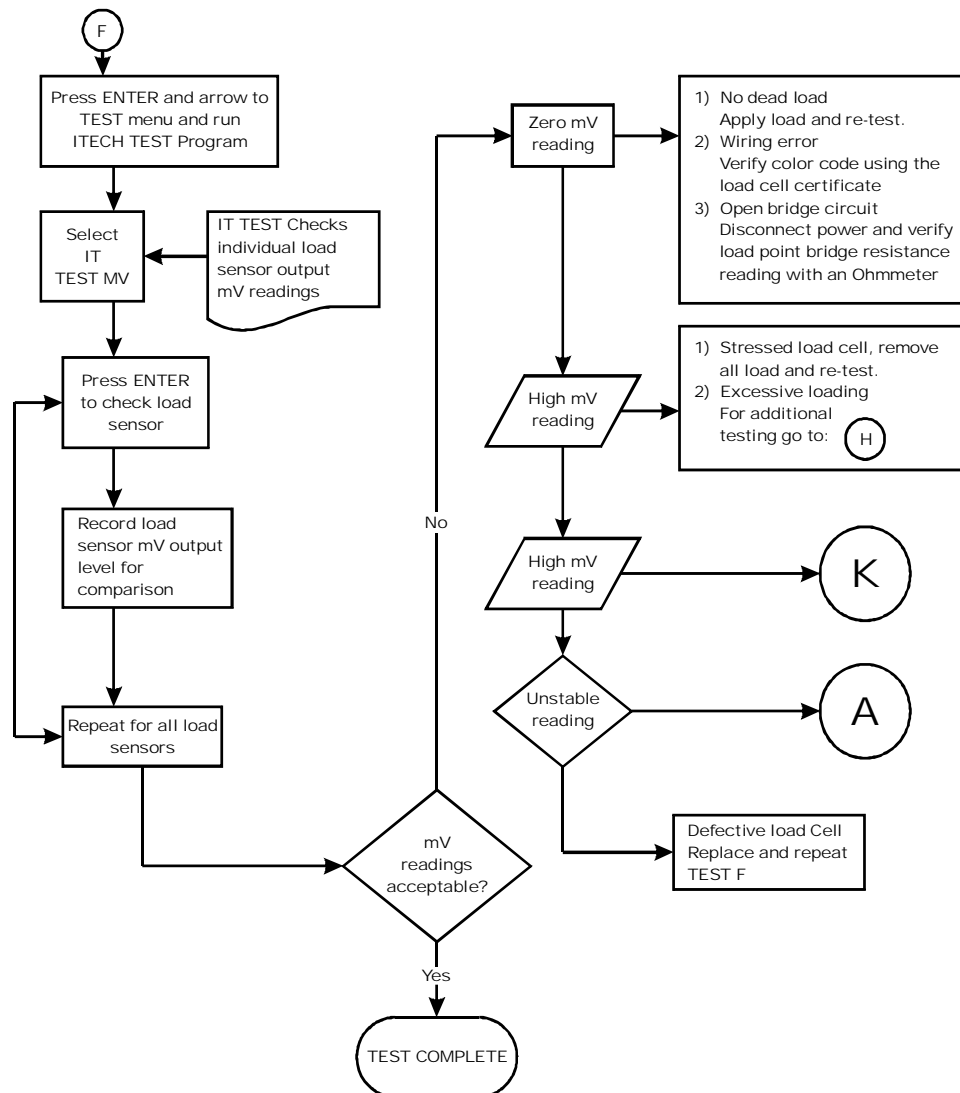


## G - Calibration Failed: Not Enough Counts Between ZERO and SPAN


- This error only occurs at the SPAN parameter.

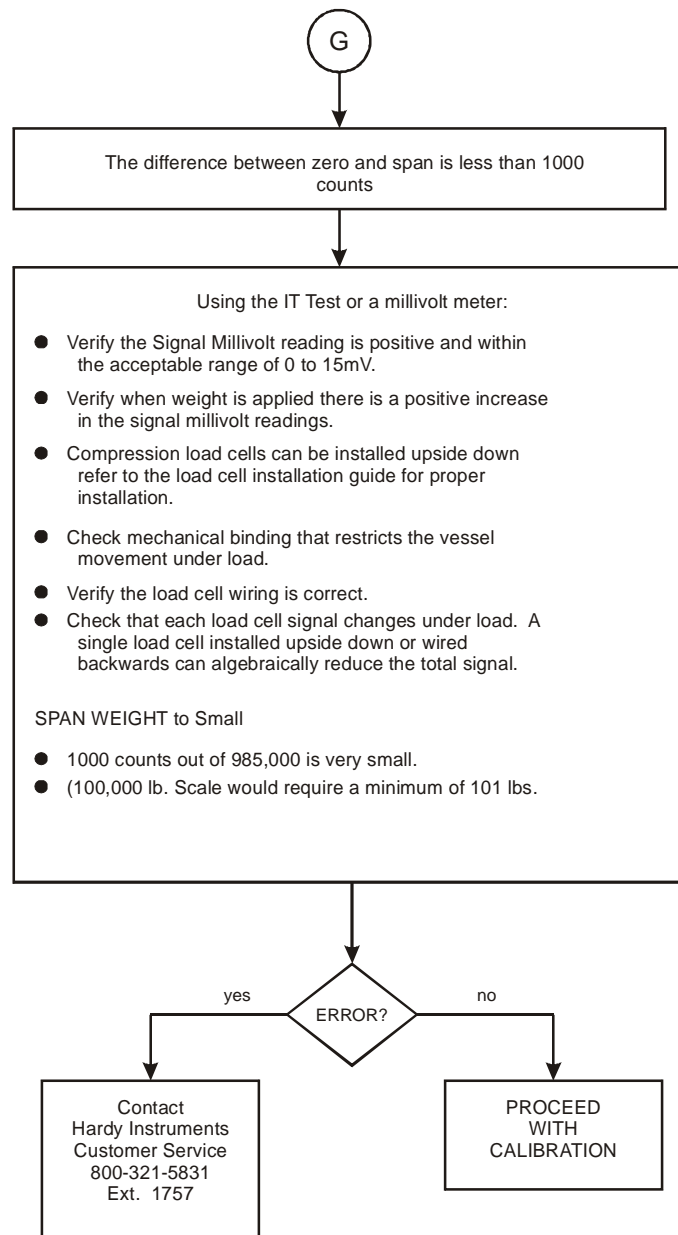


## H - Mechanical Inspection

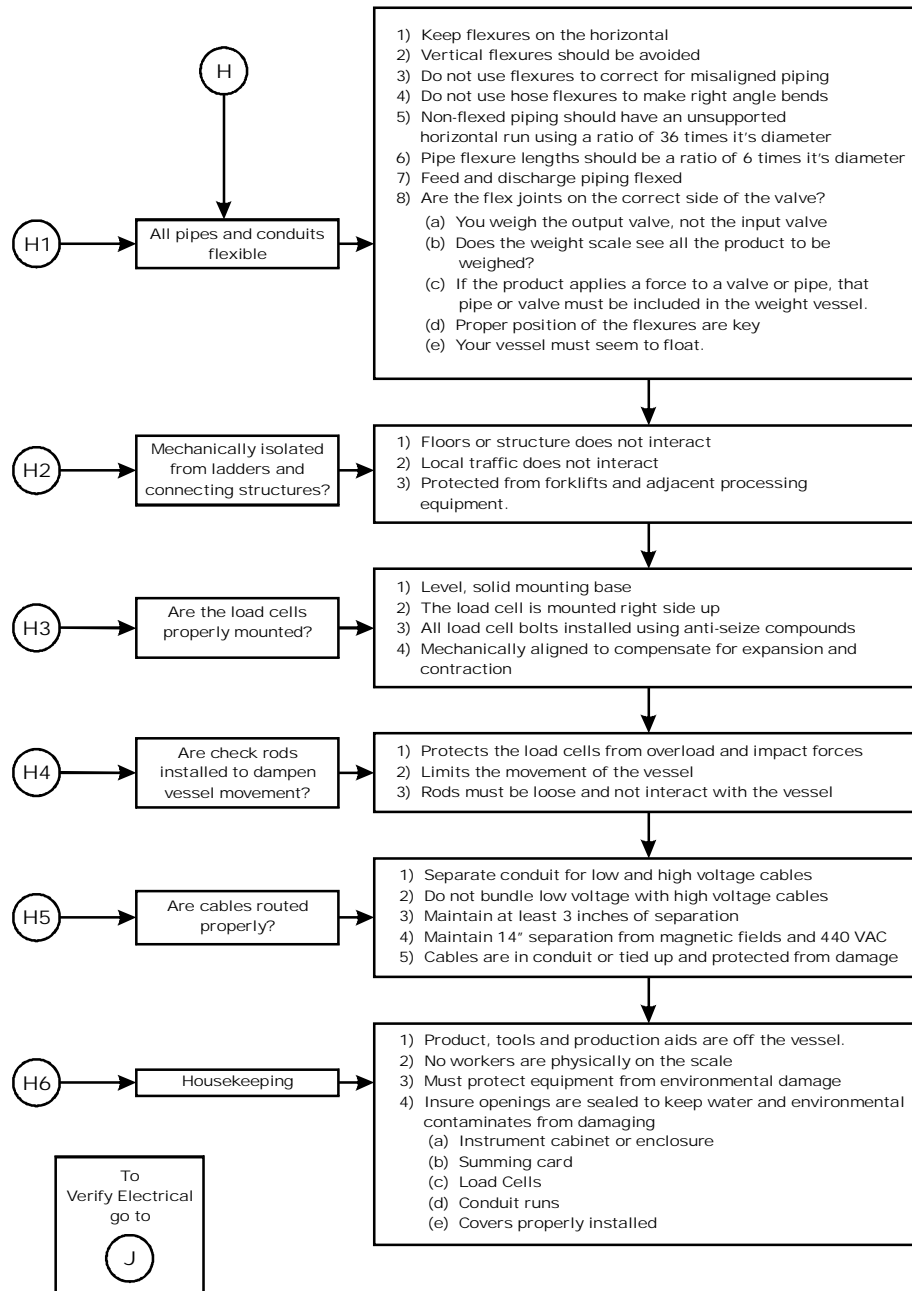


## J - Electrical Inspection

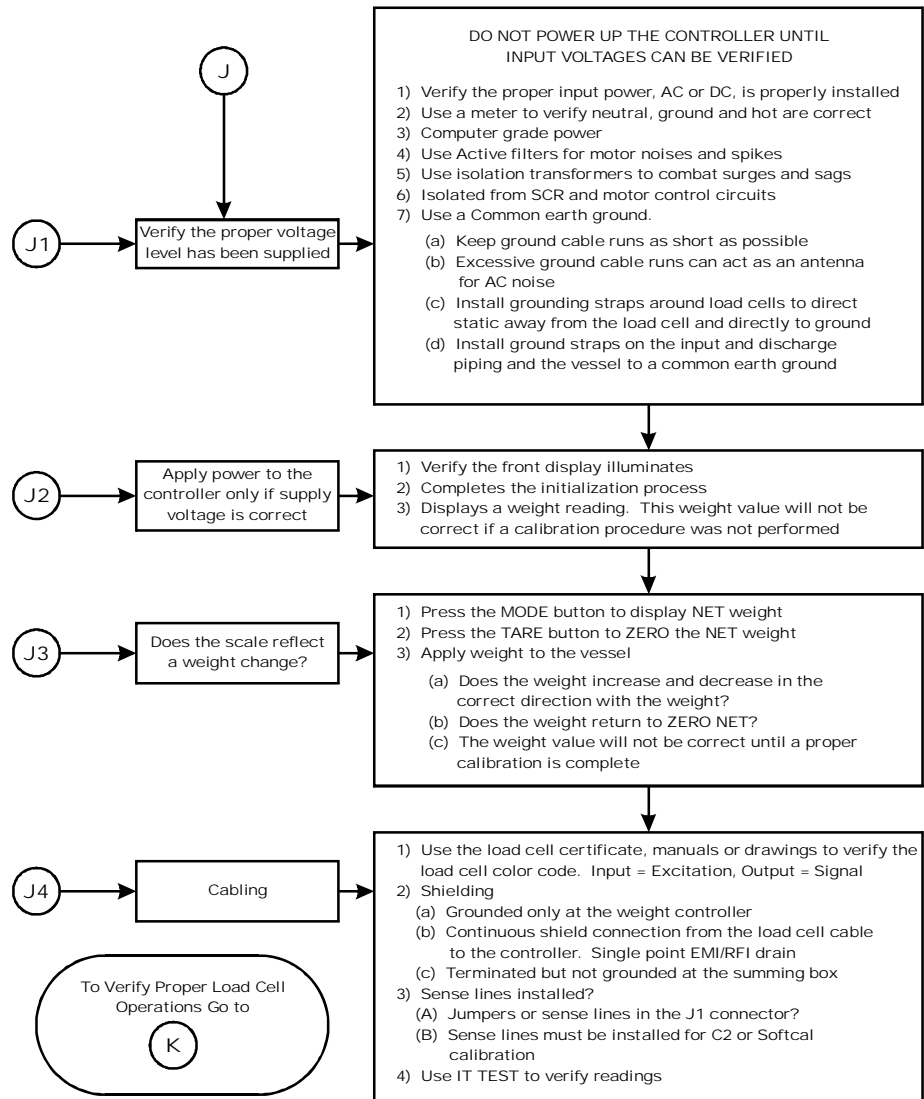

## K - Load Sharing and Load Sensor Checkout

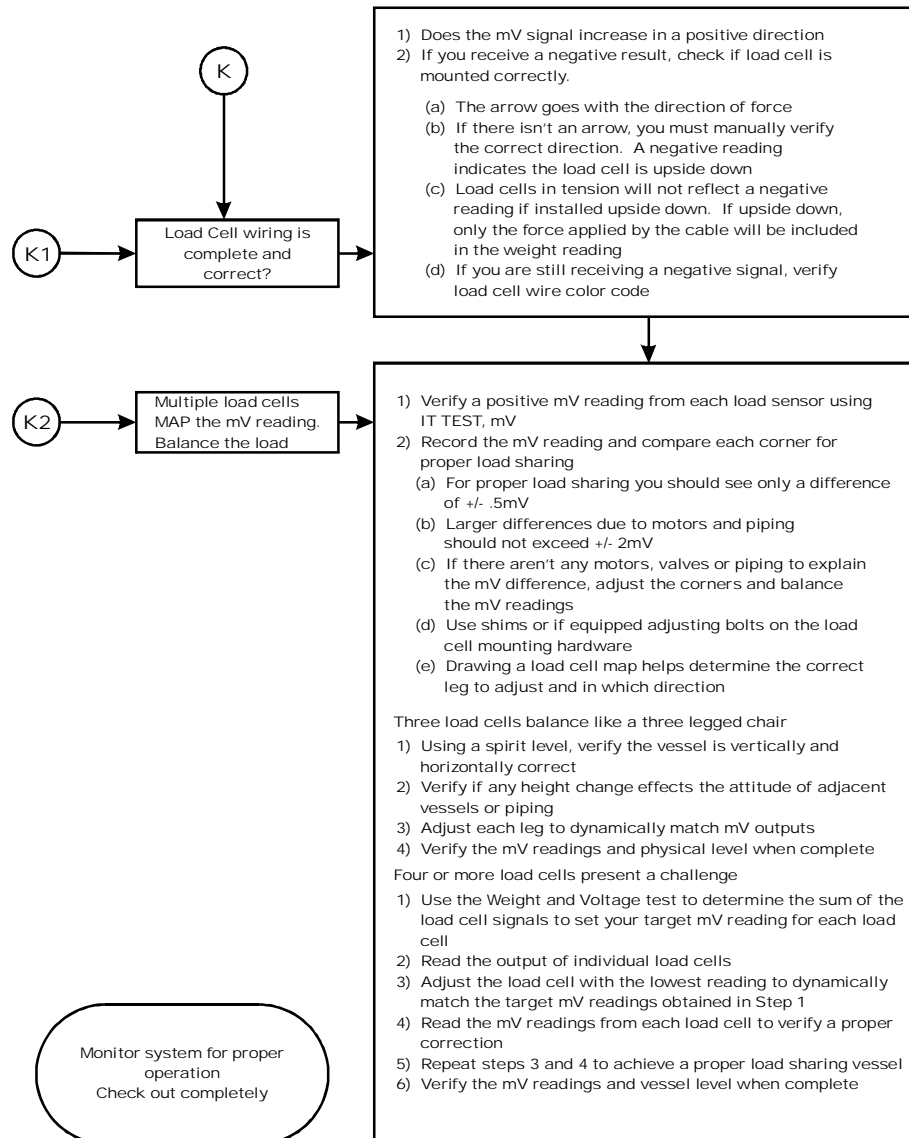


## M - (\*\*\*\*\*) or (- - - - -) ERROR

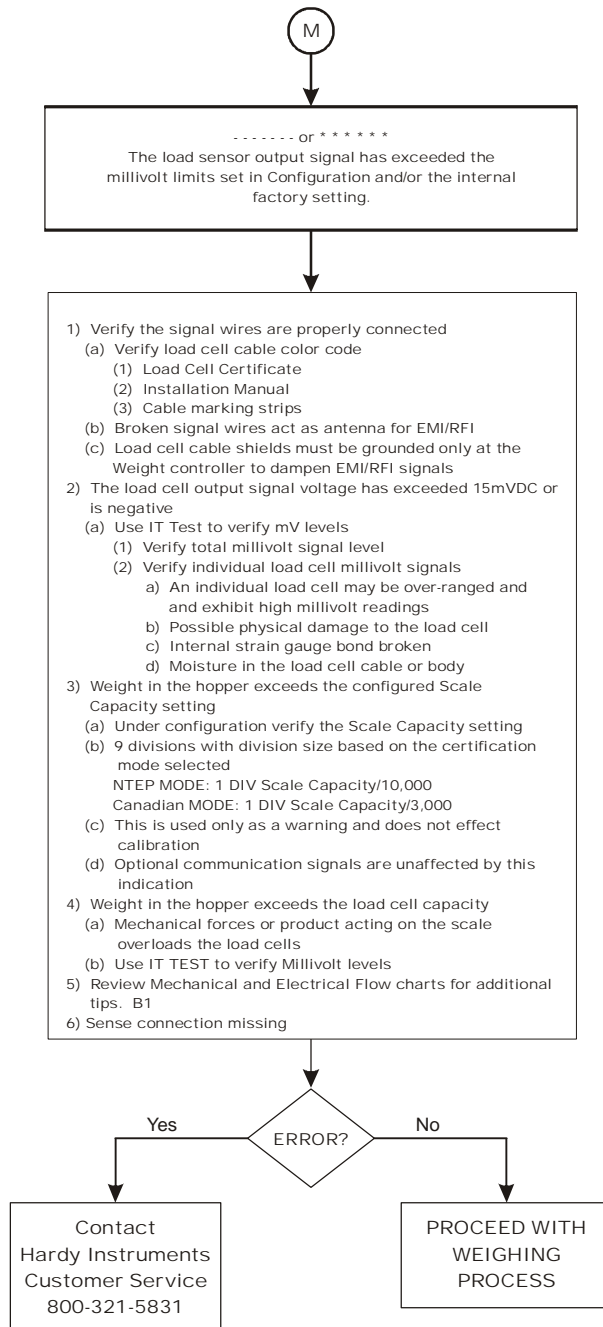




## N - Weight Controller's Front Display is Blank

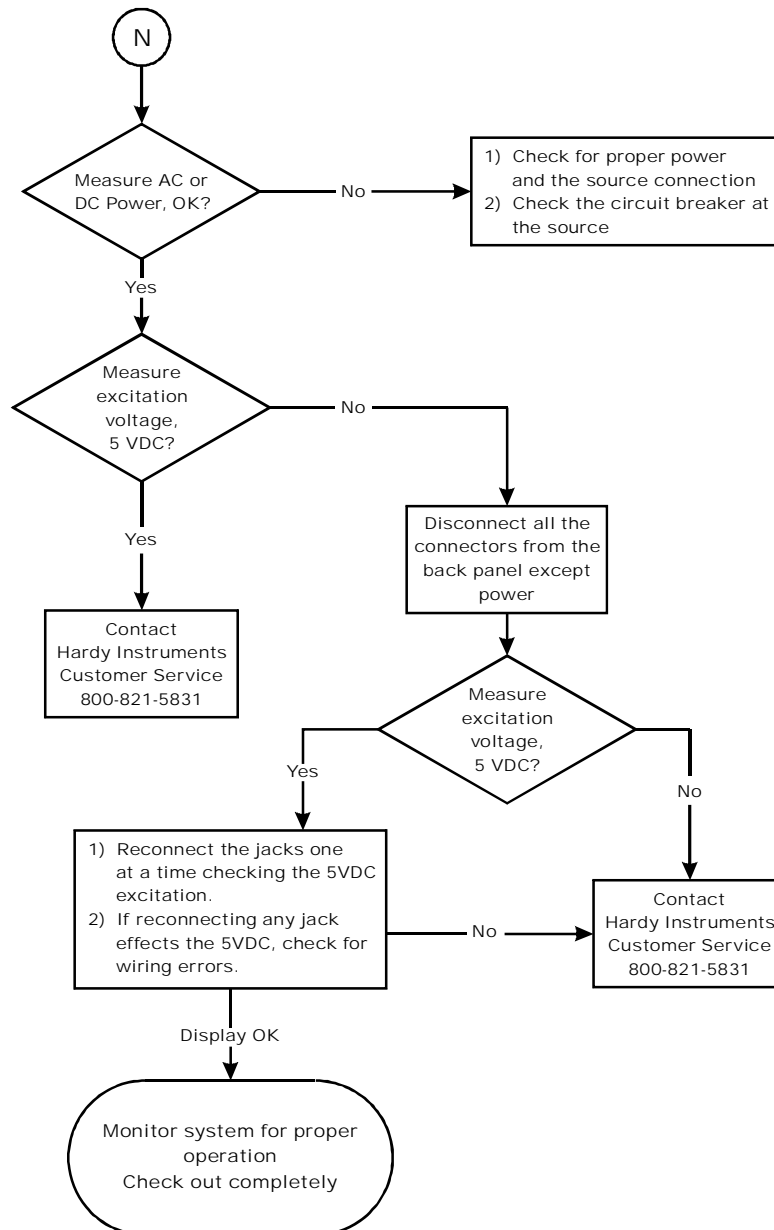

## P - SD Card Diagnostics and Losing Memory at Power Cycles

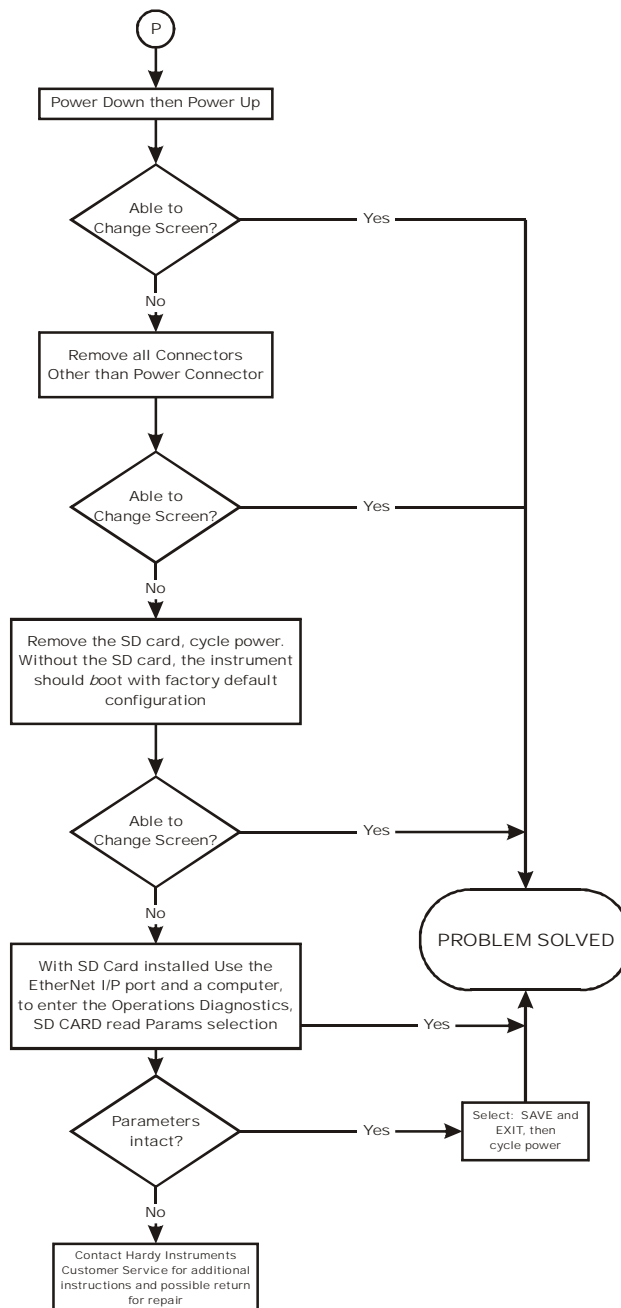

## Tests and Diagnostics

The Test and Diagnostics menus provide an expanded view of how the weight controller and scale are working. You can run several tests from either the test links on the Web Diagnostic page or the front panel Test menu. Each test is described in its own subsection below.


You can also obtain information that a Hardy representative may ask for if you make a request to Technical Support. For example, for the last calibration, you can see the type of calibration and when it was done. You can also check the graduation size, operator ID, and other configuration information, and you can learn the serial number, model number, firmware revision number.

### Diagnostic testing from the Web page


Step 1. From the Home Page click on Operation. The Operation Choose One page appears.



Step 2. Click Diagnostics to view the Operation-Diagnostics Page.

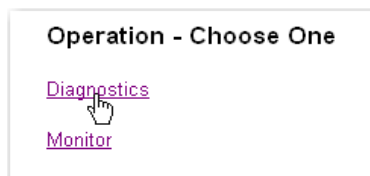


The page lists the Instrument ID, Model Number, Program Part Number, Firmware Revision, Serial Number, Last Calibration and Status Word at a glance.

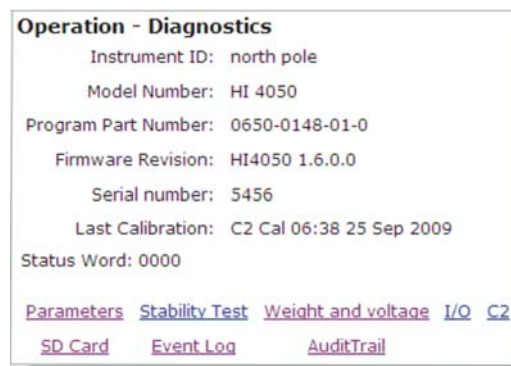


### Diagnostic testing from the front panel

From the Configuration menu, use the down arrow to select Test and press Enter to open the Test Menu. This menu lists the tests you can run.

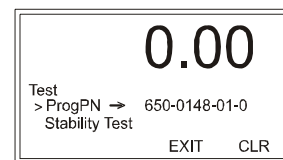


It also lists the same read-only options as the Web-interface Operation-Diagnostics page, including serial, model, and firmware revision numbers, etc.

Use the down arrow to select the option. If an arrow follows the options, press Enter to see the display.

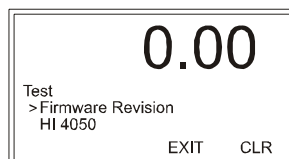

ProgPn# = Program Part Number. This is the part number of the firmware. To see the entire part number, select ProgPN and press Enter.



## NOTES

*The values entered in the Test Menu are for illustration purposes only. Your values will vary.*

*To download the latest firmware version, see the HI 4050/Downloads site at: [http://www.hardysolutions.com/4000\\_support/downloads/4000downloads.php](http://www.hardysolutions.com/4000_support/downloads/4000downloads.php).*

*For more extensive information about the Weight Controller and scale operation see Operation/Diagnostics in the System Integrity Check and Fault Determination from the Web Page section below.*


## Parameters

Parameters is the first listed hyper-link at the base of the Operation-Diagnostics page. Click that link to display the Parameters page. Note the scroll bar on the right of the list.

The steps below explain how you can duplicate the configuration of one HI 4050 to use in configuring another HI 4050 or for sending a copy of your parameters to [hardysupport@hardysolutions.com](mailto:hardysupport@hardysolutions.com)

To copy the parameters:

- Step 1. Right click in the parameter list.
- Step 2. Click Select All.
- Step 3. Right click again.
- Step 4. Click Copy.

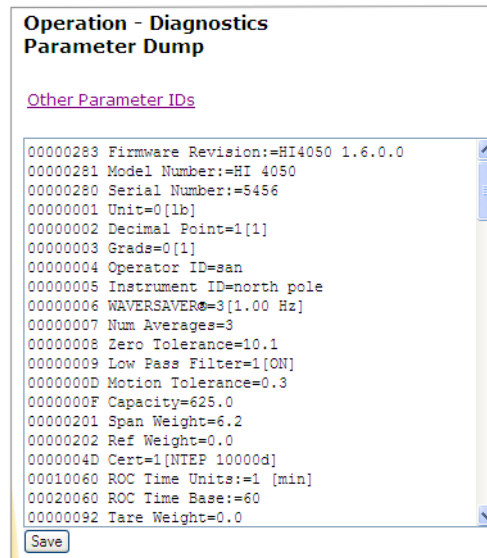

To paste the parameter configuration into the instrument you want to configure:

- Step 1. Enter the IP address of that instrument into a Web browser to display its Home page.
- Step 2. Select Operation, then Diagnostics, then Parameters, as described above.
- Step 3. Right click in the Parameter list.
- Step 4. Click Select All.
- Step 5. Right click again in the Parameter List.
- Step 6. Click on Paste to replace the existing or default parameter settings with the parameters settings of the instrument you copied.
- Step 7. Click the Save button. You now have an exact duplicate of the pre-configured instrument.

If you need to make any modifications to the parameter settings go to Chapter 4 - Configuration for more instructions.

Note the Other Parameter IDs hyperlink at the top of the parameters list. To view all the other parameter settings, click that link.

| Other Parameter IDs |   |
|---------------------|---|
| •                   | 0x0090 Gross Weight                       |
| •                   | 0x0091 Net Weight                         |
| •                   | 0x0092 Tare Weight                        |
| •                   | 0x0800 Command Word                       |
| •                   | 0x0093 Average A/D counts                 |
| •                   | 0x0094 Raw A/D counts                     |
| •                   | 0x0095 loadcell millivolt output          |
| •                   | 0x0096 loadcell millivolt per volt output |

## System and Load Cell Tests

### Overview of Typical Load Cell System

The typical system consists of one or more load cells/points, a summing junction box, and an HI 4050 Weight Controller.

**Load cell sensor point** - Used to measure pressure, weight, or torque, the sensor point is a strain gauge-based force transducer that generates an electrical signal proportional to the load applied. This can be done using either tension or compression type load cells/points. When the HI 4050 sends the load cell a 5-volt DC excitation signal that powers the load cell, the force transducer generates a millivolt output proportional to the load (0-10mv DC for 2mv/V load cells/ points or 0-15mv DC for 3mv/V load cells/points).

**Weight Controller** - This is part of the HI 4050 that, among other functions, powers the load cell(s)/point(s), receives the millivolt signal output from the load cell(s)/point(s), and digitizes, interprets, communicates and displays the results.



## **INTEGRATED TECHNICIAN**

INTEGRATED TECHNICIAN (IT<sup>®</sup>) is an optional diagnostics utility that enables the operator to rapidly troubleshoot individual load cells. The option requires an HI 215IT Summing junction box (shown above) that provides distinct inputs for each load cell.

Without the HI 215IT Summing junction box, there is no way to isolate the signals from different load cells. If any load cell fails, the test will output a FAIL response without identifying the problem load cell. For numerical values, the system will return an average of all the load cell responses and, in some cases, will return values that cannot be used.

With the HI 215IT Summing junction box and IT firmware, the HI 4050 can provide both average numerical values and values specific to each load cell, including PASS/FAIL values for each load cell, as shown below.

### Operation - Diagnostic Integrated Technician

| Sensor No. | weight    | mV/V   | mV  | RTZ  | variation | stability test |
|------------|-----------|--------|-----|------|-----------|----------------|
| Sensor 1   | 1.449430  | 0.1201 | 0.6 | PASS | 3.59      | PASS           |
| Sensor 2   | -0.993904 | 0.0336 | 0.2 | PASS | 3.88      | PASS           |
| Sensor 3   | -6.785617 | 0.0661 | 0.3 | FAIL | 2.82      | PASS           |
| Sensor 4   | 8.293720  | 0.0586 | 0.3 | FAIL | 3.33      | PASS           |
| Reference  |           | 1.9867 | 9.9 |      | 31.51     | FAIL           |

To view this screen on your system, see *Weight and Voltage Tests*. The number for a load sensor is based on the connections in the IT junction box. Check the installation sequence in the box to determine which load sensor is number 1, 2 and so on. You can use the IT functions from either the front panel or Web interface. If you do not have the optional IT junction box, some of the options described below will not appear on either interface.

#### Stability Test

The Stability test lets you check the A/D Raw count and average. With the IT option, it tests and reports for each load cell. The test sends the load cell data to the analog-to-digital convertor and calculates the mean squared variation from the average reading, using 100 samples. The test passes if the mean squared variation is less than 5.0.

If the weighing system passes the stability test, the results show OK and the variation and mean results are posted. FAIL indicates that the Mean Squared Variation is greater than 5.0 so the instrument is considered unstable. In that case, see the Troubleshooting Flow Charts Section.

#### CAUTION

**Do not perform the Stability Test during production. The test activities can cause incorrect readings.**

#### ATTENTION

**Ne pas effectuer le test de stabilité lors de la production. Ces tests peuvent résulter à des lectures incorrectes.**

### Running the Stability Test from the Web Interface

A Stability Test column on the IT test results display (see picture above) shows PASS or FAIL for each load sensor. We obtained the data by running the IT test, as described above.

Stability test is also listed as an option on the Operation - Diagnostics display. Select the Stability Test hyperlink and wait a few seconds.



The results will not be specific to each load sensor, as in the IT test. They will display an average reading and PASS/FAIL for the system as a whole.



### Running the Stability Test from the front panel

Step 1. From the Test menu, select Stability Test with use the down arrow and press Enter. The HI 4050 runs the test and shows the results.



Step 2. To see the AD/Raw Count and the A/D Average select them from the menu.

Step 3. Press Exit to return to the Test Menu.



### Weight and Voltage Tests

The Weight and Voltage tests are used to diagnose a weighing system and, if certain types of problems are indicated, determine their source. It provides the total scale input to the instrument such as mV, mV/V and Weight in the units selected (i.e. lbs, kg, oz, g).



### Weight and Voltage Test from the Web interface

Since the IT Web page shows all the weight and voltage values at once, it is the preferred method for troubleshooting. Click Weight and Voltage to open the Operation/Diagnostics - Weight & Voltage page.



| Operation - Diagnostic<br>Weight and voltage                       |                 |            |            |      |
|--|-----------------|------------|------------|------|
| Gross Weight   | millivolts/volt | millivolts | A/D Counts | RTZ  |
| 0.948012 oz  | 0.0694          | 0.3        | 861263     | PASS |
| <a href="#">Do IT test. WARNING: Do not do with active product</a> |                 |            |            |      |

To view individual load sensor data, click Do IT Test.

| Operation - Diagnostic<br>Integrated Technician |           |        |     |      |           |                |
|---|-----------|--------|-----|------|-----------|----------------|
| Sensor No.                                      | weight    | mV/V   | mV  | RTZ  | variation | stability test |
| Sensor 1  | 1.449430  | 0.1201 | 0.6 | PASS | 3.59      | PASS           |
| Sensor 2  | -0.993904 | 0.0336 | 0.2 | PASS | 3.88      | PASS           |
| Sensor 3  | -6.785617 | 0.0661 | 0.3 | FAIL | 2.82      | PASS           |
| Sensor 4  | 8.293720  | 0.0586 | 0.3 | FAIL | 3.33      | PASS           |
| Reference                                       |           | 1.9867 | 9.9 |      | 31.51     | FAIL           |

These readings allow you to determine if the problem is in the instrument (internal) or in a load sensor(s) (external). The mV reading is a coarser reading than the mV/V or Weight readings. The mV reading is sufficient to balance the corners of your scale or vessel.

The specification range for the Weight Controller is 0-15 mV, so a reading between 0-15 mV is within the normal range. A reading outside this range (15.5 mV, 3.1 mV/V Maximum or any negative values) would normally indicate that the problem is external to the Instrument (most likely improper wiring).

If all the load sensor readings are 0.00, something is wrong between the HI 4050 and the HI 215IT junction box or with the junction box itself. Either the cable is disconnected, or something is causing the junction box to not transmit the readings to the HI 4050.

If you do not get a reading for one or possibly two or more load sensors (Sensor 3 for example reads 0.00 or the reading is either larger or smaller than it should be) and you know that the Load Sensors are connected to the junction box, the individual load sensor cable is disconnected from the junction box or the load sensor is malfunctioning.

### Running the Weight and Voltage test from the front panel


The same information can be obtained from the front panel. From the Test menu, select Weight and Voltage and press Enter to show the menu.



Then select IT Test to run the test. To read the rest of the results, press the down arrow. The weight and voltage/reading raw counts and average are shown below.



- Step 1. To select a Sensor, use the up or down arrows to move through the list, and press Enter to display the sensor IT Test results for the selected sensor. Our example looks at Sensor number 1.
- Step 2. The output values will appear on the Sensor 1 menu. If an arrow appears on a listing, you can select that listing and press Enter to obtain more information.
- Step 3. Press the Exit button to return to the Sensor Menu. If you want to test other load sensors select the sensor and repeat steps 1 through 5 above.
- Step 4. Press Exit to return to the It Test Menu; then press Exit again to return to the Test Menu.



### Return to Zero test

The RTZ column on the Web interface Operation/ Diagnostics - Weight & Voltage IT page means Return to Zero. This test determines whether the instrument returns to a starting zero point. PASS indicates that you are within the sum of the preset Motion and Zero Tolerance settings.



FAIL indicates that you are outside the sum of the preset Motion and Zero Tolerance settings. If this results from too much build up on the scale, you need to clean the scale or you have scale problems. Run this test whenever you cannot zero the scale. If the Return to Zero test fails, see the E Flow Char - Non Return to Zero for troubleshooting help.

### Checking Inputs and Optional Outputs

#### NOTE

*Outputs are an option. See Digital I/O Card.*

You can check to see which inputs or outputs are operating from the Web interface by clicking on I/O at the bottom of the Operation - Diagnostics page to display the Input and Output page. If an Input or Output is in use the



I/O reads 1. If an Input or Output is not in use, the I/O reads 0. In our example none of the inputs (User Switches) are being used so they all read 0.

This information is available from the front panel only by Selecting Digital I/O from the Options menu. See also Configuring the Digital I/O Option Card. For testing the I/O card outputs , you can toggle the outputs on or off from the Configuration - Options - I/O Card page. See *I/O Card Configuration*.

To return to the Diagnostics page click on the back arrow.

### Viewing System C2 Load Sensors

The Sensor 1 and Sensor 2, etc. data on the Web interface Operation/ Diagnostics - Weight & Voltage IT page may be C2 sensors or non-C2 sensors. To check only the C2-type load cells, see the Operations - Diagnostic C2 Data page, which tells you how many C2 load cells are in use and provides the C2 version, Serial Number, Output Resistance, Output Voltage and Capacity for a selected cell. The Read Sensor button allows you to read this information for all C2 load sensors in the system. When you press the Read Sensor button, it receives the information from the first load sensor. The serial number is important if you need to contact Hardy Instruments Technical Support. You do not need an IT summing box.


Step 1. Click on “C2” at the bottom of the page to display the C2 Data page listing the number of C2 load sensors that are found in the weighing system.

Step 2. From the Read Data from: pull-down list, select the C2 load sensor you want to view.

Our example shows only one C2 load sensor found. If no C2 load sensors are installed the “C2 Sensors Found” reads 0.

The information on this page is C2 load sensor data only. It does not refer to any position on the IT Junction box, nor does it tell you the operating condition of the load sensor. To determine the condition of a load cell and its position, use Weight and Voltage/IT Test.

Step 3. Click on the back arrow to return to the Diagnostics page.

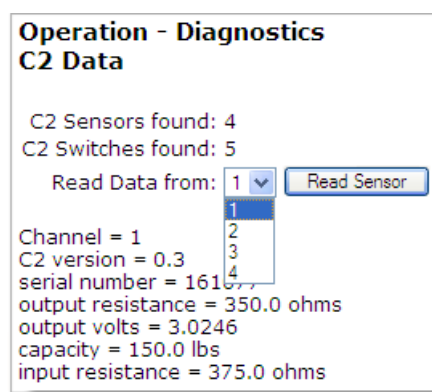


### SMM-SD Card Directory

If your computer is equipped with an SD card reader, you can click on SD Card to display the SD Card page indicating the Write Protect status and listing the base directory with the files where the non-volatile memory is located for the HI 4050.

The Read Param File button invokes a reading of the parameters file, which updates the system based on the current content of that file.

If you type in a filename, including the suffix, and click the Delete File? button, the file will be deleted.

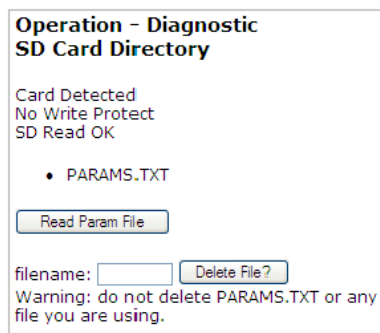


**WARNING - RANDOM FILE DELETION FROM THE SD CARD DIRECTORY CAN RESULT IN LOST AUDIT LOGS OR DAMAGE TO YOUR SYSTEM CONFIGURATION. DO NOT USE THE DELETE FUNCTION UNLESS YOU KNOW THAT THE FILE YOU WANT TO DELETE CURRENTLY HAS NO VITAL SYSTEM FUNCTION (E.G. PARAMETERS OR WORKING INGREDIENT FILES).**

**AVERTISSEMENT – LA SUPPRESSION ALEATOIRE DE FICHIERS DEPUIS LE REPERTOIRE DE LA CARTE SD PEUT CAUSER LA PERTE DES JOURNAUX D’AUDIT OU ENDOMMAGER LA CONFIGURATION DE VOTRE SYSTEME. NE PAS UTILISER LA FONCTION « SUPPRIMER » A MOINS QUE LE FICHIER QUE VOUS VOULEZ SUPPRIMER N’EST PAS VITALE POUR LE FONCTIONNEMENT DU SYSTEME (E.G FICHIERS PARAMETRES OU DE FONCTIONNEMENT SYSTEME.)**

**Audit Trail and Event Log**

The Audit Trail is a log of changes made to select parameters and calibrations that are monitored for NTEP rated instruments. It lists the date and time and whatever transaction performed. The Event Log shows startup dates and times.

On the Web interface, click the Event Log or Audit Trail link at the bottom of the Operations - Diagnostics page.

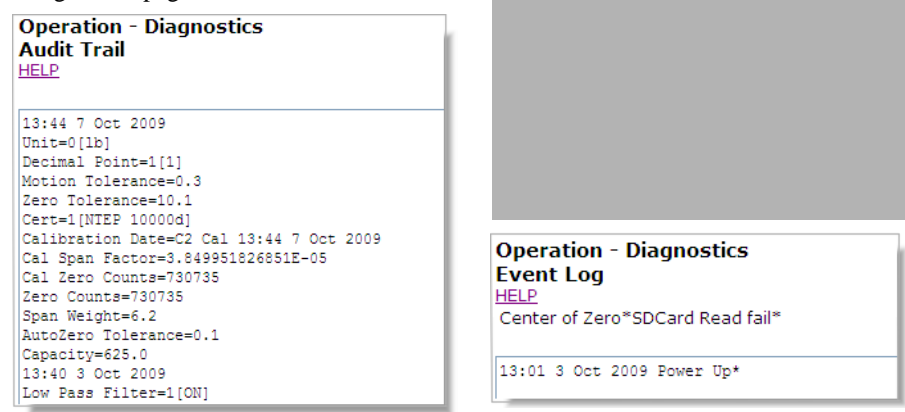

Step 4. From the front panel Test menu, you can select Audit Trail (but not Event Log) . Press Enter to see the Audit Trail display showing the event time and date.



Step 5. To view the rest of the Audit Trail log, press the up or down button.  
Step 6. To return to the summary display, press Exit until the summary display appears.

**Checking Network Connections and Configuration with the "Ping" Tool**

The Ping Tool is used from the computer’s start/run utility. Click Start and then Run.

**Selecting the module by IP Address for Testing**

**NOTE** *You can only ping from the PC. You cannot ping from an instrument.*

Step 1. Type PING <space>IP address of the instrument you want to test. For Example:  
**PING 192.168.110.99**

Our example uses the default address for all HI4050 Series Instruments. The IP address you are testing will be different.

Step 2. Press the Enter key on the PC. The PING utility starts sending out a packet to a specified address and gets a reply if the unit is functioning correctly.

If the instrument or network is configured incorrectly and cables are loose or not connected correctly, nothing prints out after the first line. Do the following:

- Check the Network cables and connectors to be sure they are tightly fastened and the correct cables for this application.
- Check the configuration to be sure that the instrument is configured correctly. (See Configuration IP Address in Chapter 4)

Step 3. If the unit is configured correctly and Ethernet functioning correctly and the cables are the correct ones for this application and are securely fastened, 64 signals should be returned and the print out will reflect this fact.

## General Policies and Information

With over 70 years of industrial weighing experience and products in the field, Hardy Process Solutions continues to design, manufacture, install and support Hardy products worldwide. The following paragraphs describe Hardy's customer support services and equipment warranty.

### NOTE

*For all non-warranty repairs a purchase order or credit card information is required. You can also go to the Hardy web site and request a Return Authorization number. An RA# will be e-mailed to you. <http://www.hardysolutions.com/service/repair.php>*

### Ordering Replacement Parts

Contact the Hardy Process Solutions Sales Department to order replacement parts and option boards. Have your equipment model number and serial number ready.

### Software Downloads for Your HI 4050

To access the software that Hardy Process Solutions has made available for downloads:

Step 1. In a web browser, go to [www.hardysolutions.com/4000\\_support/index.html](http://www.hardysolutions.com/4000_support/index.html) to open the HI 4000 Series On-line Support Site, and click HI 4000 Download Section.



Step 2. This will display the screen shown below which can be used to download software for HI-4000 Series instruments.

|   |  |
|---|--|
| Click on any of the links below to download the software you need for your HI 4000 Series Controller.   |  |
| <b>Hardy Auto Update</b>  | Lets you <a href="#">update</a> HI 4000 Series firmware  |
| <b>IP Setup</b>   | Lets you <a href="#">set the IP address</a> of your HI 4000 Series unit  |
| <b>HI 4050 Weight Controller Firmware</b>   | <a href="#">Latest firmware</a> (Version 1.7.0.0)  |
| <b>HI 4060 Rate Controller Firmware</b>   | <a href="#">Latest firmware</a> (Version 1.0.0.0)  |
| <b>GSD Files</b>  | <a href="#">GSD for Profibus</a> (Version 1.0)   |
| <b>EDS Files</b>  | <a href="#">EtherNet/IP EDS</a><br><a href="#">ControlNet EDS</a><br><a href="#">DeviceNet EDS</a> (Version 2.0) |
| Download the Hardy Auto update program and the latest HI 4000 Weight Controller Firmware to a directory of your choice on your computer. You should not change the name of the HI 4000 Series controller firmware, as the AutoUpdate program will not recognize it if you do. Plug into the Ethernet switch or use a crossover cable. |  |




## Downloading and Installing Firmware Updates (S-19 Files)

In the procedure below, you will download both the Hardy Auto Update program and the latest HI-4050 rate controller firmware to a common directory on the same network as the rate controller.


- Step 1. On the Hardy Auto Update line of the HI 4000 Series Downloads page (shown above), right click on the Update link and use the Save Target As menu option to save the Hardy Auto Update program to a known location on your computer.
- Step 2. Under HI-4050 Rate Controller Firmware, right click on the Latest Firmware link and use the Save Target As menu option to save this file to the same folder. You can rename the firmware, but the name must always include \_APP.s19 for the AutoUpdate program to recognize it.

- Step 3. Find and start the Auto Update.exe program.

- Step 4. Click Find to search for and list the units that are online on this network.

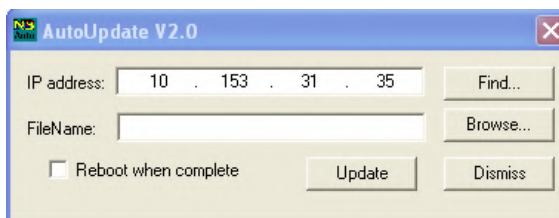


- Step 5. Select the IP address of the unit you want to upgrade.

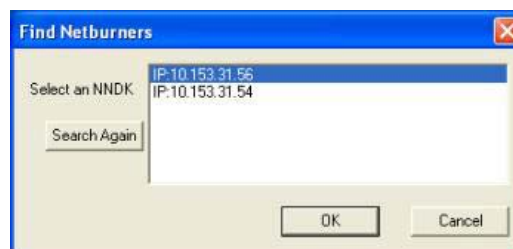

- Step 6. Click Browse to find and select the firmware file you downloaded.

- Step 7. Once you have the IP address and the file selected, click on the Update button.

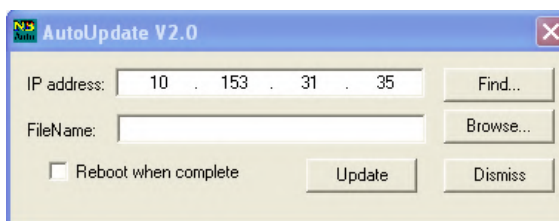

- Step 8. You should now be asked for a User Name and Password. Username is hardy and password is updatepass (all one word in lowercase letters). If Update does not give you the Password screen, the path to your program file may be too long. Try moving your files up to your root directory and run again.

Step 9. After you log on, a percent complete bar will show the progress of the upgrade. Once it completes the download, it should show the screen indicating the programming is complete without error.

Step 10. Cycle power on the HI 4050 unit.

### **Warranty**

A warranty problem may be handled by returning the product to the factory for repair or replacement under warranty. In the event you experience a problem with this instrument contact your local Hardy Representative or the Hardy Process Solutions Service Center to determine if the problem is covered under warranty.

Web Address: <http://www.hardsolutions.com/Service/term.php>.

### **System Support (Requires Purchase Order or Credit Card)**

Technical Service is provided as follows:

- New system start-up: Ensure that the installation is checked and correct; instruments are calibrated, and operators trained.
  - 1** Service: Engineers are trained and qualified to provide on-site installation, calibration, and maintenance.
  - 2** On-site training: A Hardy Support Representative can be scheduled to train your operations and maintenance personnel. This can be as simple as basic load cell theory or as complete as troubleshooting techniques that allow you to service your equipment.

### **Technical Service**

**Technical Service Manager**  
**Hardy Process Solutions**  
**9440 Carroll Park Drive, San Diego, CA 92121**  
**Telephone: (858) 278-2900**  
**FAX: (858) 278-6700**  
**Web Site: <http://www.hardsolutions.com>**  
**E-Mail: [hardysupport@hardsolutions.com](mailto:hardysupport@hardsolutions.com)**

# Appendix A

## About Timezones

.....

### Greenwich Mean Time

There are 25 integer World Time Zones from -12 through 0 (GMT) to +12. Each one is 15° of longitude as measured East and West from the Prime Meridian of the World which is at Greenwich, England. Some countries have adopted non-standard time zones, usually a 30 minute offset.

Each Time Zone is measured relative to Greenwich, England. Civilian designations are typically three letter abbreviations (e.g. EST) for most time zones. Below is a list of the abbreviated time zones with the GMT time adjustment.

| GMT                      | Civilian Time Zones  | Cities  |
|--------------------------|--|---|
| <b>GMT</b>               | GMT: Greenwich Mean<br>UT: Universal<br>UTC: Universal Co-ordinated<br>WET: Western Europe | London, England<br>Dublin, Ireland<br>Edinburgh, Scotland<br>Reykjavik, Iceland<br>Casablanca, Morocco  |
| <b>EAST OF GREENWICH</b> |  |   |
| <b>+1</b>                | CET: Central Europe  | Paris, France<br>Berlin, Germany<br>Amsterdam, Holland<br>Brussels, Belgium<br>Vienna, Austria<br>Madrid, Spain<br>Rome, Italy<br>Bern, Switzerland<br>Oslo, Norway |
| <b>+2</b>                | EET: Eastern Europe  | Athens, Greece<br>Helsinki, Finland<br>Istanbul, Turkey<br>Jerusalem, Israel<br>Harare, Zimbabwe  |
| <b>+3</b>                | BT: Baghdad  | Kuwait<br>Nairobi, Kenya<br>Riyadh, Saudi Arabia<br>Moscow, Russia  |
| <b>+3:30</b>             |  | Tehran, Iran  |

### GREENWICH TIME ZONES (GMT)



| GMT   | Civilian Time Zones   | Cities  |
|-------|---|---|
| -3    |   | Brasilia, Brazil<br>Buenos Aires, Argentina<br>Georgetown, Guyana     |
| -3:30 |   | Newfoundland  |
| -4    | AST: Atlantic Standard  | Caracas, Venezuela<br>La Paz  |
| -5    | EST: Eastern Standard   | Bogota, Colombia<br>Lima, Peru<br>New York, NY, USA                   |
| -6    | CST: Central Standard   | Chicago, Illinois, USA<br>Mexico City, Mexico<br>Saskatchewan, Canada |
| -7    | MST: Mountain Standard  | Phoenix, Arizona<br>Denver, Colorado                                  |
| -8    | PST: Pacific Standard   | Seattle, Washington<br>Portland, Oregon<br>San Francisco, CA          |
| -9    | AHST: Alaska-Hawaii Standard<br>CAT: Central Alaska<br>HST: Hawaii Standard | Anchorage, Alaska<br>Honolulu, Hawaii                                 |
| -11   | NT: Nome  | Nome, Alaska  |
| -12   | IDLW: International Date Line West  |   |

### GREENWICH TIME ZONES (GMT)

- Step 1. Check the Greenwich Time Zones Table for the time zone you are in.
- Step 2. Press the right or left arrow until the correct time zone appears. For example Pacific Standard Time is -8.
- Step 3. Press the Enter button to save the entry.
- Step 4. Press the Down arrow to select Time-Year. (See Fig. 73)



## INDEX

### Symbols

!C2 Caps Unequal! 127  
!Function Error! 127  
!Not Allowed! 127  
!Security Violation! 127  
“clean” primary line 26  
\*.gsd file 67

### Numerics

25 integer World Time Zones 1  
5 VDC excitation 96

### A

A - Guidelines for Instabilities on Formerly  
Operating Systems 132  
A/D Average 152  
A/D Convert Error 126  
A/D Failure Error 126  
A1 - Guidelines for Instabilities on  
Formerly Operating System (Cont'd)  
133  
About Chapter 2 9  
About Chapter 5 95  
AC Input Power Wiring (-AC) 25  
AC Power Input 26  
AD/Raw Count 152  
Additional Field Devices Folder 68  
address allocation list 66  
Address Error 61  
Analog Wiring 35  
AND 112  
ANYBUS-S PDP 68  
Applications 3  
Approvals 11  
appurtenances 96  
Audit Log 158  
Audit Trail 129, 158  
AutoZero 80  
AutoZero Tolerance 80  
average reading 151  
Averages 9

### B

B - Guidelines for Instabilities on Formerly  
Operating Systems (Cont'd) 134  
backlit LCD display 1  
basic load cell theory 162  
Baud Rate 48, 71, 83  
Binding on the Load Cell 95  
board stacker pins 36  
Boolean Mapping 112  
Boolean tables 112  
Boolean variable 112  
Byte Count Error 61  
Bytes 48

### C

C - Guidelines for Instabilities on Formerly  
Operating Systems 137  
C2 Cal 100  
C2 Cal Error 126  
C2 Calibration Menu 100  
C2 Calibration Procedures From the Front  
Panel 100  
C2 Data page 156  
C2 Sensor page 156  
C2 Sensors Found” reads 0 156  
C2 version 156  
C2® Load Point Connection 24  
Cable color Code for Non-C2 Load Points  
25  
Cal Completed OK 101  
Cal completed OK 99  
CAL Failed 127  
Cal Failed 101  
Cal High 103  
Calibrating Procedures From the Web Page  
97  
Calibration Procedures From the Front  
Panel 97  
Capacity 82  
Certification 82  
Channel 1 -Dribble 35  
Channel 2 - Cutoff 35

- Channel 3 - Bag Clamp 35
- Channel 4 - Unused 35
- Channel terminal block 25
- Checking Inputs and Outputs 155
- closed containers 28, 125
- Common Mode Rejection 11
- Communication cables 119
- Communication Options 2
- Configuration 73
- Configuration - Printer form 83
- Configuring Profibus from the Front Panel 71
- Configuring Rate of Change 56
- Configuring Rate of Change From the Browser 55
- Configuring Security for the Instrument from the Web Page 93
- configuring the Hardy Instruments 41
- Connection pull down menu 59
- connector 28, 125
- controlled static environment 28, 125
- ControlNet 13
- ControlNet Connectors 38
- ControlNet Option Card 72
- CWM 82
- Cycle power 67
- cyclic 66

**D**

- Data Bits 84
- data transmission baud rate(s) required. 67
- DC Power Input (-DC) 27
- DC voltage header 27
- Decimal Point 76
- Description 1
- Destination 59
- deterministic 66
- DeviceNet 47, 48
- DeviceNet cable 50
- DeviceNet input table 107
- DeviceNet Menu 49
- DeviceNet™ - Slave 2
- DI is the DeviceNet input image table 112
- Diagnostics Page 117
- Digital I/O Card 65
- Digital Voltmeter 10
- Din Rail Mount 12
- disassembly 28, 125
- Disassembly and Reassembly Notes and Cautions 16, 125
- Display 9
- Display Increments (Graduations) 9
- DNET Baud Rate 49
- DNET Bytes In 49
- DNET Bytes in 49, 54
- DNET Mode Menu 49
- DNET Node 49
- Do C2 Calibration" button 99
- Do Cal High button 102
- Do Cal Low button 102
- DO is the DeviceNet output image table 112
- Do IT Test 153
- Do Trad Cal, (Zero) 103
- DP State (Read Only) 71
- drives 48

**E**

- E - Non-Return to Zero 138
- E Option 4
- EIP Ke 54
- Electrical Check Procedures 96
- electrical parts 28, 125
- electrical plug 28, 126
- electrostatic discharge 28, 126
- embedded controllers 48
- Enabling Modbus TCP/IP from the Front Panel 57
- Enabling Rate of Change 55
- Enter Value display 61
- Entering Set Points from the Web Page 88, 123
- Environmental Requirements 11
- Error list in Chapter 7 103
- Error Messages 126
- ESD 28, 126
- EST 1
- Ethernet communication chips 53
- Ethernet Industrial Protocol 53
- Ethernet Network 47



- Ethernet technology 53
- Ethernet/IP 53
- Ethernet/IP menu 54
- Ethernet/IP page 53
- Ethernet/IP™ - Key Code Activation Required 2
- Ethernet/IP™ Parameters 53
- Excitation Monitor 10
- Excitation Voltage 9

## F

- F - Verify Individual Load Cell Millivolt Readings 139
- factory installed jumpers 25
- follow proper safety procedures 126
- FOR FURTHER INFORMATION CONTACT 159
- Frequency 10
- Front Panel TARE/ZERO Security” pull down list. 91
- Function Not Supported 61

## G

- G - Calibration Failed
  - Not Enough Counts Between ZERO and SPAN 140
- General Folder 68
- General Policies and Information 159
- General Troubleshooting Flow Chart Index 131
- Getting Started 119
- GMT 1
- GMT time adjustment 1
- Graduation Size 77
- gravity 97
- Greenwich Mean Time 1
- Greenwich, England 1
- Ground wire 27
- GSD file 66

## H

- H - Mechanical Inspection 141
- Hardware Catalog 68
- Hardy Auto Update program 161
- Hardy Float Out 60

- Hardy Float Out 60
- Hardy Newsletter 1
- Hardy Web Site 1
- Hardy Web Tech 1
- hardysupport@hardyinst.com 1
- HI 215IT Junction Box 150
- HI 3000 Series Network 47
- HI 3000 Series Network configurations 47
- HI 4050 4
- HI 4050 Series (ANYBUS) module 69
- HI 4050 web page 100
- HI 5800 Hardy Switch 1
- HI is the Hardy input image table 112
- hi\_sales@hardyinst.com 1
- High Password display 64, 92
- High Security Code 91
- High Security Code text field. 91
- highest order bit set 116
- HO is the Hardy output image table 112
- http
  - //www.hardyinstruments.com 1
- Humidity Range 11
- HW Config dialog box 70

## I

- I/O Board Inputs 65
- individual Boolean variable 112
- Initializaion Process 66
- Initialization Procedures 68
- Input 10
- Input and Output page 155
- Input Power Wiring 25
- Installing Network Cards 36
- Installing Optional Boards 30
- Installing the Analog Output Card 32, 36
- Installing the Analog Output Card (-4ANB) in the Option Slot 30
- Installing the DeviceNet Card 38
- Installing the PROFIBUS Card 37
- INTEGRATED TECHNICIAN 147
- Integrated Technician 125
- Internet 47
- IP Setup program 93
- IT Test 129
- IT Web page 153

## **J**

J - Electrical Inspection 142

## **K**

K - Load Sharing and Load Sensor  
Checkout 143  
Key number 55  
Key Pad 10

## **L**

LAN 47  
latitude 97  
LCD Contrast 82  
least significant byte 116  
live load 102  
load (Vessel + Contents) 95  
load (weight) 101  
load cell I&M manual 95  
Load Check 101  
Load Point cables 119  
Lock Washers 28, 126  
Low Pass filter 79

## **M**

M - (\*\*\*\*\*) or (- - - - -) ERROR 144  
Main Control board Network header 30, 32  
master device 66  
Maximum Zero Tolerance 10  
mean squared variation 151  
Mechanical Check Procedures 95  
Medium Password 64, 93  
Medium Password. 64, 93  
Medium Security Code text field 91  
Mixed Mapping 115  
ModBus 57  
MODBUS - TCP/IP Over Ethernet 61  
Modbus Float Out 60  
Modbus Key 57  
Modbus Key menu 57  
Modbus TCP/IP 53, 57  
Model Numbers 4  
Motion Error 126  
Motion Tolerance 79

motor starters 48  
Mounting Options 2  
Mv/V and MV  
129  
mV/V rating 96

## **N**

N - Weight Controller's Front Display is  
Blank 145  
Netburner IP setup program 93  
No C2 Sensor 126  
No Connection" message 50  
Node address 67  
Node Address at #7 71  
Node text field, 48  
Non-C2 Load Point Connection 25  
NONE/MEDIUM/HIGH 93  
Non-Linearity 10  
NOT 112  
NTEP 82  
NTEP rated instruments 158  
Num C2 100  
Num C2 is read only 100  
Number of Channels 9

## **O**

ODVA 53  
Operating Temperature Range 11  
Operating the Weight Controller from the  
Front Panel 90, 124  
Operation 147  
Operation Choose One page 147  
Operation/Diagnostics - Weight & Voltage  
page 153  
Operation-Diagnostics Page 147, 148  
Operations/Diagnostics/C2 100  
Operator ID 76  
Option port 32  
Option Slot Header 30  
Options Configuration 48  
Options Menu 49  
Options. 49  
OR 112  
Ordering Replacement Parts 156, 162  
original point of removal 126

- original point of removal 28
- Output Resistance 156
- Output Voltage 156
- Overview of Typical Load Cell System 149, 158

## P

- P - SD Card Diagnostics and Losing Memory at Power Cycles 146
- Pacific Standard Time 3
- pan cone head screws 37
- Panel Mount 12
- parameterization 66
- PARAMTER ID 116
- Parity 84
- PASS/FAIL and Variance Test 128
- passive nodes 66
- password to the Calibration Section 93
- PCs 47
- Performing a Parameter List (Dump) 117
- periodic 66
- Physical Characteristics 12
- Ping Tool 158
- PING utility 159
- PLC 70
- PLCs 47
- Poll Connection entry 50
- polling mechanism 66
- polls 66
- Power 10
- Power and Utility Requirements 10
- Power Supply 2
- PP# = Program Part Number 148
- Pre-Calibration Procedures 95
- Pre-Initialization Procedures 67
- Prime Meridian 1
- printed circuit boards 28, 126
- Printer Mode 84
- Printer Setup 84
- process weighing 1
- ProfiBus DP 66
- Profibus DP network 67
- PROFIBUS label 37
- Profibus Node Menu 71
- ProfiBus system 66

- PROFIBUS® Configuration 66
- Profibus-DP .GSD File 67
- Profibus-DP cable specifications 67
- Profibus-DP Network 68
- Profibus-DP PLC 67
- Program Part Number 148
- push buttons 48

## R

- rapidly fluctuating setpoint states 87
- Rate of Change 56, 83
- Rate of Change (-ROC) Option Configuration 86
- Rate of Change evaluation 56
- Rate of Change page 55
- Raw A/D Average Counts 128
- Raw A/D Count 128
- Read Data from “pull down list” 156
- Read Sensor button 156
- reassembly 28, 125
- Ref Weight 100
- Ref Weight Menu 100
- Ref Weight text field 101
- Ref Weight” text field 99
- Remote I/O Interface 6
- repairs 125
- Request Error 61
- Resolution 9
- Response OK pop 61
- Response pop up 61
- ROC 55, 83
- ROC Configuration from the Front Panel 56
- ROC Key 55, 56
- ROC Key menu 56
- ROC key text field 55
- ROC Menu 56
- ROC Time Units 56
- RS NetWorx® 112
- RTZ (Return to Zero) Tests 129

## S

- S-19 Files 161

Scoreboard 83  
 Screws 28, 126  
 SD Card page 157  
 Security 92  
   security for the Tare/Zero functions 93  
 Security Menu 64, 92  
 Security page 90  
 Security Violation" message 101  
 Select Destination Module dialog box 69  
 Selecting the module by number for  
   Testing 158  
 Sensor Number 129  
 sensors 48  
 Set Parameter button 56  
 Set Points Configuration 90, 124  
 Setpoint 66  
 Setting up the Command Interface  
   Mapping 115  
 Shield wir 27  
 Siemens PLC 68  
 Siemens Step 7™, Simatic Manager 67,  
   68  
 Simatic Manager 67  
 Simple Ethernet Network 47  
 simple operator interfaces 48  
 slave 66  
 small fasteners 28, 125  
 Spacers 28, 126  
 Span Weight 103  
 Span Weight Menu 103  
 Span Weight text field 102  
 Special (Command) Mapping 115  
 Specifications 9  
 Stability Test 151, 152, 154  
 Stability Test ALL 128  
 Standard Communication 2  
 Starting the HI 4050 37  
 Starting Up for the First Time 90, 124  
 Station Address Dialog box 70  
 Storage Temperature Range 11  
 Support Section 1  
 System Integrity Check and Fault  
   Determination From the Front Panel 147  
 System Support 162

**T**  
 Tare Failed 122  
 Tare OK 122  
 Tare Weight 81  
 Tare/Zero Sec 93  
 TCP/IP Connection display 59  
 Technical Support Department 1  
 Temperature Coefficient 11  
 Tension or Compression type load cells  
   149  
 tensions control 1  
 Test Menu 147  
 The Command Interface 115  
 Time Base Menu 56  
 Time Measure 55  
 Time Measure pull down menu 55  
 Time Zone 85  
 Timebase text field 56  
 Time-Year 3  
 Too Hi Error 126  
 Too Lo Error 126  
 Trad Cal 102  
 Trad Cal Error 126  
 Trad Cal menu 102  
 Traditional Calibration from the Front  
   Panel 101  
 troubleshooting techniques 162  
 Troubleshooting The Network  
   Connections and Configuration with the  
   "Ping" Tool 158  
 Trunk Line 67

**U**  
 Unit of Measure 75  
 Units 75  
 universal power supply 26  
 Update Rate 9  
 UR dialog box 68

**V**  
 Value Error 61  
 vertically passing 95  
 vibration analysis 1  
 Viewing System C2 Load Sensors 156

Viewing the SMM-SD Card 157  
Voltage 10

## **W**

Warranty 162  
Washers 28, 126  
WAVERSAVER 10, 78  
WD State (Read Only) 71  
Web Page Security” pull down list 91  
Weight 129  
Weight and Voltage ALL 128

Wireless IR 47  
Wireless Servers 47  
wiring harness 28, 126  
Write Protect status 157

## **Z**

Zero Failed 122  
Zero OK 122  
Zero Tolerance 80  
Zero Value menu 102







9440 Carroll Park Drive, San Diego, CA 92121  
Telephone: 1-800-821-5831      FAX: (858) 278-6700  
Web Address: <http://www.hardysolutions.com>

Hardy Instruments Document Number: 0596-0303-01 REV U  
Copyright October 2012, Hardy Process Solutions, All Rights Reserved. Printed in the U.S.A.